

Bidwell Junior High School

RECORD OF FRIABLE AND NON-FRIABLE ACM
(FORM B)

Inspection Date(s) August 6, 2013

THREE-YEAR REINSPECTION

SCHOOL Bidwell Junior High School					CDS CODE 04-61424-6057129
ADDRESS (NUMBER) (STREET) (CITY) (ZIP) 2376 North Avenue Chico 95926					SCHOOL PHONE NUMBER (530) 891-3080

-IMPORTANT-

Each building and functional space with friable ACM or friable assumed ACM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACM OR FRIABLE ASSUMED ACM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE <small>(Indicate Address if Different From Above)</small>	CHECK ONE			CHECK ONE			
		SUR-FACING	TSI	MISC	ACBM		ASSUMED ACM	
					FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
1	C-TRAINS (2) NO SUSPECT ACM							
2.	METAL STORAGE NO SUSPECT ACM							
3.	P.E. WEIGHT ROOM NO SUSPECT ACM							
4.	UNIT A	X		X				X
	BOILER ROOM		X				X	
5.	UNIT B	X		X				X
6.	UNITS C & D	X		X		X		X
7.	UNIT E - MAINTENANCE NO SUSPECT ACM							
8.	UNIT F			X				X
9.	UNIT G - ROOM 962							
10.	UNIT H - GREEN HOUSE NO ACM							
11.	UNIT I			X				X
12.	UNIT J			X		X		X
13.	UNIT K			X				X
14.	UNIT L			X				X
15.	GYM, STOREROOM, AND BOILER ROOM		X		X		X	

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell Form B.wpd

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

**ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 6, 2013

School: Bidwell Junior High School

Inspector: Blake Howes

Building & Location(s): Unit A - Boiler Room

ECG- % Asbestos-Assumed Homogeneous Mat. #152

Material description: Boiler

Total amount of material this location: 1 Unit Amount of friable material this location: 1 Unit

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact
Vibration			X	Enclose		Do not drill, cut, sand, or grind
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact
Occupancy			X	O & M	X	

Assessment of Material Condition

Significantly Damaged
(Poor)

Damaged
(Fair)

Not damaged
(Good)

Potential Damage: High High Mod Low High Mod Low

Hazard Ranking: 1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations:

**ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 6, 2013

School: Bidwell Junior High School

Inspector: Blake Howes

Building & Location(s): Unit L - Gym, Storeroom, and Boiler Room

HMS-BID-18B

% Asbestos-5-10%

Homogeneous Mat. #18

Material description: Pipe Wrap Corner Fitting

Total amount of material this location: 28 Each

Amount of friable material this location: 28 Each

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE				RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L	Isolate/Restrict		Fix leaks	
Accessibility	X			Repair/Cleanup		Prevent water contact	
Vibration		X		Enclose	X	Do not drill, cut, sand, or grind	X
Air Erosion			X	Remove	X	Do not affix signs	
Water			X	Encapsulate		Avoid contact	X
Occupancy	X			O & M	X		

Assessment of Material Condition

Significantly Damaged
(Poor)

Damaged
(Fair)

Not damaged
(Good)

Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

						X		
--	--	--	--	--	--	---	--	--

Comments & Observations:

**ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 6, 2013

School: Bidwell Junior High School

Inspector: Blake Howes

Building & Location(s): Unit L - Gym, Storeroom, and Boiler Room

HMS-BID-17B

% Asbestos-15-20%

Homogeneous Mat. #17

Material description: Pipe Wrap Straight

Total amount of material this location: Undetermined

Amount of friable material this location: Undetermined

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE				RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L	Isolate/Restrict		Fix leaks	
Accessibility	X			Repair/Cleanup		Prevent water contact	
Vibration		X		Enclose	X	Do not drill, cut, sand, or grind	X
Air Erosion			X	Remove	X	Do not affix signs	
Water			X	Encapsulate		Avoid contact	X
Occupancy	X			O & M	X		

Assessment of Material Condition

Significantly Damaged
(Poor)

Damaged
(Fair)

Not damaged
(Good)

Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

						X		
--	--	--	--	--	--	---	--	--

Comments & Observations:

**ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 6, 2013

School: Bidwell Junior High School

Inspector: Blake Howes

Building & Location(s): Unit A - Boiler Room

ECG-

% Asbestos-Assumed

Homogeneous Mat. #153

Material description: 6" Mudded Fittings

Total amount of material this location: 13 Each

Amount of friable material this location: 13 Each

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE				RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L	Isolate/Restrict	X	Fix leaks	
Accessibility	X			Repair/Cleanup		Prevent water contact	
Vibration			X	Enclose		Do not drill, cut, sand, or grind	X
Air Erosion			X	Remove	X	Do not affix signs	
Water			X	Encapsulate		Avoid contact	X
Occupancy		X		O & M	X		

Assessment of Material Condition

Significantly Damaged
(Poor)

Damaged
(Fair)

Not damaged
(Good)

Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

						X		
--	--	--	--	--	--	---	--	--

Comments & Observations:

**ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 6, 2013

School: Bidwell Junior High School

Inspector: Blake Howes

Building & Location(s): Unit A - Boiler Room

ECG-

% Asbestos-Assumed

Homogeneous Mat. #508

Material description: 3" OD Mudded Fittings

Total amount of material this location: 5 Each

Amount of friable material this location: 5 Each

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE				RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L	Isolate/Restrict	X	Fix leaks	
Accessibility	X			Repair/Cleanup		Prevent water contact	
Vibration			X	Enclose		Do not drill, cut, sand, or grind	X
Air Erosion			X	Remove	X	Do not affix signs	
Water			X	Encapsulate		Avoid contact	X
Occupancy		X		O & M	X		

Assessment of Material Condition

Significantly Damaged
(Poor)

Damaged
(Fair)

Not damaged
(Good)

Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

						X		
--	--	--	--	--	--	---	--	--

Comments & Observations:

**ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 6, 2013

School: Bidwell Junior High School

Inspector: Blake Howes

Building & Location(s): Unit L - Gym, Storeroom, and Boiler Room

ECG-

% Asbestos-Assumed

Homogeneous Mat. #520

Material description: Boiler Insulation

Total amount of material this location: 1 Boiler

Amount of friable material this location: 1 Boiler

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact
Vibration			X	Enclose		Do not drill, cut, sand, or grind
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact
Occupancy			X	O & M	X	

Assessment of Material Condition

Significantly Damaged
(Poor)

Damaged
(Fair)

Not damaged
(Good)

Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations:

SIX-MONTH SURVEILLANCE

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Unit A

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	TRANSITE PIPE FLUE	99	ASSUMED POSITIVE	1 EACH	KITCHEN AND BOILER ROOM	(1) (4)	N
M	DRYWALL	103	ASSUMED	200 S	KITCHEN - NEAR TRAY WASH	(1) (4)	N
M	9" VINYL FLOOR TILE (GREEN) & ADHESIVE	104	ASSUMED POSITIVE	3,000 S	MPR, KITCHEN, ADMINISTRATION, COUNSELING, AND NURSES OFFICE	(1) (4)	N
T	BOILER INSULATION	152	ASSUMED POSITIVE	1 UNIT	BOILER ROOM	(1) (4)	Y
T	6" MUDDER FITTINGS	153	ASSUMED POSITIVE	13 EACH	BOILER ROOM	(1) (4)	Y
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	300 S	STAFF ROOM, ADMINISTRATION, OFFICES, CONFERENCE ROOM	(1) (4)	N
M	CARPET ADHESIVE	251	ASSUMED POSITIVE	900 S	STAFF ROOM, ADMINISTRATION, OFFICES, CONFERENCE ROOM	(1) (4)	N
S	STUCCO	252	ASSUMED POSITIVE	400 S	COVERED WALKWAY	(1) (4)	N
S	WALL PLASTER	503	NONE DETECTED	3,000 S	THROUGHOUT	(13)	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected
(14) Non AHERA/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Unit A
(Continued)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	ROUGH CEILING PLASTER	506	ASSUMED POSITIVE	800 S	STAFF LOUNGE AND ENTRY FOYER	(1) (4)	N
M	12" ACOUSTIC CEILING TILE - 1/8" HOLE PATTERN	507	ASSUMED POSITIVE	4,200 S	MPR	(1) (4)	N
T	3" OD MUDDER FITTINGS	508	ASSUMED POSITIVE	5 EACH	BOILER ROOM	(1) (4)	Y

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected
 (14) Non AHERA/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Unit B

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes /No
M	9" VINYL FLOOR TILE (CREAM) & ADHESIVE	95	ASSUMED POSITIVE	1,200 S	LIBRARY	(1) (4)	N
M	12" ACOUSTIC CEILING TILE - 1/8" HOLE PATTERN	109	ASSUMED POSITIVE	2,200 S	LIBRARY, OFFICES, AND COMPUTER ROOM	(1) (4)	N
S	SMOOTH WALL PLASTER	110	ASSUMED POSITIVE	2,000 S	THROUGHOUT THE UNIT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	400 S	THROUGHOUT UNIT	(1) (4)	N
M	CARPET ADHESIVE	251	ASSUMED POSITIVE	1,000 S	OFFICES & COMPUTER ROOM	(1) (4)	N
S	STUCCO	252	ASSUMED POSITIVE	2,000 S	COVERED WALKWAYS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Units C & D

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	ACOUSTICAL CEILING & UPPER WALL ROUGH PLASTER	5	1-5 %	30,000 S	ALL ROOMS, CLOSET (C), CLASSROOM 204, AND HALLWAY	(1) (4) WATER STAINS ARE PRESENT. SOME AREAS HAVE 1' X 1' PENETRATIONS WHERE SKY LIGHTS ARE GOING TO BE PLACED. (12) MATERIALS 5&6 MERGED INTO MATERIAL 5	N
M	DRYWALL	90	ASSUMED POSITIVE	4,000 S	CLASSROOMS 250 & 406A, CORRIDORS, AND RESTROOMS	(13) REPRESENTED BY SAMPLE HMS-R1304-03 COLLECTED ON 3-30-04.	N/A
M	3" TRANSITE PIPE	107	ASSUMED POSITIVE	10 L	CLOSET OF CLASSROOM 405	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	2,800 S	THROUGHOUT CLASSROOMS	(1) (4)	N
S	STUCCO	252	ASSUMED POSITIVE	8,000 S	COVERED WALKWAYS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Units C & D
(Continued)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	509	ASSUMED POSITIVE	6,765 S	CLASSROOMS 101-107	(1) (4)	N
M	12" VINYL FLOOR TILE (ORANGE) & ADHESIVE	510	ASSUMED POSITIVE	4,230 S	CLASSROOMS 201-205	(1) (4)	N
M	12" VINYL FLOOR TILE (GREY) & ADHESIVE	511	ASSUMED POSITIVE	14,650 S	CLASSROOMS 250, 301-307 AND 401-407	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	512	ASSUMED POSITIVE	5,070 S	CLASSROOMS 105-107 AND 206-207	(1) (4)	N
M	SPRAYED-ON FLOOR	513	ASSUMED POSITIVE	2,535 S	CLASSROOMS 206 & 207	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Unit F

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	500 S	THROUGHOUT	(1) (4)	N
S	STUCCO	252	ASSUMED POSITIVE	1,200 S	COVERED WALKWAY	(1) (4)	N
M	2'X4' CEILING PANEL - FISSURE PATTERN	255	ASSUMED POSITIVE	1,800 S	ROOMS 108 & 208	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	514	ASSUMED POSITIVE	3,400 S	PERIMETER WALLS - THROUGHOUT	(1) (4)	N
M	SPRAYED-ON FLOOR	515	ASSUMED POSITIVE	5,040 S	THROUGHOUT	(1) (4)	N
M	12" ACOUSTIC CEILING TILE - 1/8" HOLE PATTERN	516	ASSUMED POSITIVE	5,040 S	THROUGHOUT EXCEPT ROOMS 109 & 209	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected
(14) Non AHERA/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Unit I

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	STUCCO	252	ASSUMED POSITIVE	1,200 S	COVERED WALKWAY	(1) (4)	N
M	2'X4' CEILING PANEL - SOLID PATTERN	260	ASSUMED POSITIVE	3,600 S	ROOMS 308, 309, 408, & 409	(1) (4)	N
S	WALL PLASTER	500	NONE DETECTED	350 S	GIRL'S RESTROOM	(13) REPRESENTED BY SAMPLE HMS-R1304-02 COLLECTED ON 3-30-04.	N/A
M	12" VINYL FLOOR TILE (GREY) & ADHESIVE	517	ASSUMED POSITIVE	5,248 S	CLASSROOMS 308, 309, 408, AND 409	(1) (4)	N
M	DRYWALL	518	ASSUMED POSITIVE	200 S	WASHROOM	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Unit J

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" ACOUSTIC CEILING TILE - 1/8" HOLE	108	ASSUMED POSITIVE	1,400 S	CLASSROOMS 501& 502, OFFICE, AND PRACTICE ROOMS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	500 S	ALL ROOMS	(1) (4)	N
M	BUR UNDER GRAVEL	501	NONE DETECTED	200 S	NORTH END, SOUTH END, AND MIDDLE	(13) REPRESENTED BY SAMPLES 34A-C COLLECTED ON 4-5-04.	N/A
M	GRAY ROOF MASTIC	502	5-10% CHRYSOTILE	3,200 S	EXHAUST FAN ROOF JACK	(1) (4) REPRESENTED BY SAMPLES 32A & B COLLECTED ON 4-5-04. (12)	N
M	12" VINYL FLOOR TILE (GREY) & ADHESIVE	519	ASSUMED POSITIVE	3,420 S	ALL ROOMS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Unit K

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	CEMENTITIOUS TRANSITE PANELS	98	ASSUMED POSITIVE	UNDETERMINED	PANELS IN BOTH LOCKER ROOMS	(12) COULD NOT LOCATE.	N
S	WALL PLASTER	504	NONE DETECTED	5,000 S	COACHES ROOM 112	(13) REPRESENTED BY SAMPLE HMS-R1304-01 COLLECTED ON 3-30-04.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District
School: Bidwell Junior High School

Inspector:
Building: Unit L

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	PIPE RUN INSULATION	17	15-20%	310 L	GYM, STOREROOM, AND BOILER ROOM	(1) (4) SAMPLE HMS-BID-17B COLLECTED ON 9/15/87.	Y
T	PIPE FITTING INSULATION	18	5-10%	28 EACH	GYM, BOILER ROOM, AND STOREROOM	(1) (4) SAMPLE HMS-BID-18B COLLECTED ON 9/15/87.	Y
M	12" ACOUSTIC CEILING TILE	111	ASSUMED POSITIVE	10,000 S	GYM	(1) (4) SOME TILES HAVE BEEN REMOVED. THE MASTIC IS SHOWING. THE WALLS ARE CONCRETE & THE CEILING IS METAL.	N
T	BOILER INSULATION	520	ASSUMED POSITIVE	1 BOILER	BOILER ROOM	(9)	Y

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Bidwell JHS\Bidwell 6 month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS