

# **Chico High School**

RECORD OF FRIABLE AND NON-FRIABLE ACM  
(FORM B)

Inspection Date(s) August 1, 2013

THREE-YEAR REINSPECTION

SCHOOL Chico Senior High School					CDS CODE 04-61424-0431676
ADDRESS (NUMBER) (STREET) (CITY) (ZIP) 901 The Esplanade Chico, CA 95926					SCHOOL PHONE NUMBER (530) 891-3026

**-IMPORTANT-**

Each building and functional space with friable ACM or friable assumed ACM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACM OR FRIABLE ASSUMED ACM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE <small>(Indicate Address if Different From Above)</small>	CHECK ONE			CHECK ONE			
		SUR-FACING	TSI	MISC	ACBM		ASSUMED ACM	
					FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
1.	A - 1 <sup>st</sup> Floor			X		X		X
2.	DARK ROOM ATTIC (CLASSROOM 111)		X		X			
3.	A - 2 <sup>ND</sup> FLOOR			X		X		X
4.	AG	X				X		
5.	B			X				X
6.	B.C.O.E RELOCATABLE <b>Removed From Site</b>							
7.	B.C.O.E. PORTABLE <b>Removed From Site</b>							
8.	C			X		X		X
9.	D & H	X		X		X		X
10.	F	X				X		X
11.	FINE ARTS AND CLASSROOM 1		X		X			
12.	G - GYM		X		X			X
13.	IA (FKA IT-1000)			X		X		X
14.	J (Green House) <b>No Longer Noted as Bldg. J</b> <b>No Suspect Materials</b>							

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

RECORD OF FRIABLE AND NON-FRIABLE ACM  
(FORM B)

Inspection Date(s) July 14, 2010

THREE-YEAR REINSPECTION

CDS CODE  
04-61424-0431676

SCHOOL  
Chico Senior High School

SCHOOL PHONE NUMBER  
(530) 891-3026

ADDRESS  
901 The Esplanade

(NUMBER)

(STREET)

(CITY)  
Chico, CA

(ZIP)  
95926

**-IMPORTANT-**

Each building and functional space with friable ACM or friable assumed ACM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACM OR FRIABLE ASSUMED ACM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE <small>(Indicate Address if Different From Above)</small>	CHECK ONE			CHECK ONE			
		SUR-FACING	TSI	MISC	ACBM		ASSUMED ACM	
					FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
15.	J (Classrooms 116-124, 217-227) <b>DISTRICT MUST CERTIFY</b>							
16.	K (Classrooms 111-115, 211-214) <b>DISTRICT MUST CERTIFY</b>							
17.	L (Library)			X				X
18.	LIBRARY ATTIC		X		X			
19.	LH <b>DEMOLISHED SUMMER 2012 DISTRICT MUST CERTIFY NEW CONSTRUCTION</b>							
20.	PORTABLE CLASSROOMS PC1-PC17 AND 2 PORTABLE RESTROOMS ON WEST CAMPUS <b>CERTIFICATION LETTER ON FILE</b>							
21.	S			X		X		X
22.	ALL ROOMS		X		X			
23.	SA <b>DISTRICT MUST CERTIFY</b>							
24.	ST <b>DISTRICT MUST CERTIFY</b>							
25.								
26.								

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: A (1<sup>st</sup> Floor)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS FISSURE PATTERN	1	NONE DETECTED	5,735 S	ADMINISTRATION AREA & CLASSROOMS 113-130	(13) SAMPLE HMS-CHS-01 COLLECTED ON 3-28-88.	N/A
M	12" VINYL FLOOR TILE (BEIGE) & ADHESIVE	2	TRACE	5,700 S	RECEPTION AREA & CLASSROOMS	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	3	NONE DETECTED	3,550 S	PRINCIPLES OFFICE, COMPTROLLER, 120, AND CLASSROOMS 102-107	(13) SAMPLE HMS-CHS-03 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	7	5-10%	20 JOINTS	DARK ROOM ATTIC (CLASSROOM 111)	(11) INACCESSIBLE.	Y
T	MESH WRAP	8	12-20%	½ L	DARK ROOM ATTIC (CLASSROOM 111)	(11) INACCESSIBLE.	Y
M	TRANSITE PANELS	95	ASSUMED POSITIVE	1,300 S	ALONG WALKWAYS, JANITORS CLOSETS, RESTROOMS, AND STAIRWELLS	(1) (4) PANELS PAINTED WHITE 11/19/03.	N
M	DRYWALL & JOINT COMPOUND	166	ASSUMED POSITIVE	8,000 S	THROUGHOUT INTERIOR WALLS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	700 S	THROUGHOUT INTERIOR	(1) (4)	N
S	STUCCO	251	ASSUMED POSITIVE	2,500 S	COVERED WALKWAYS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: A (2<sup>ND</sup> Floor)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (BEIGE) & ADHESIVE	2	TRACE	5,800 S	UPSTAIRS CLASSROOMS	(1) (4)	N
M	2' X 4' CEILING PANELS	6	NONE DETECTED	10,000 S	UPSTAIRS CLASSROOMS	(13) SAMPLE HMS-CHS-06 COLLECTED ON 3-28-88.	N/A
M	CEMENTITIOUS TRANSITE PANELS	95	ASSUMED POSITIVE	1,300 S	COVERED WALKWAYS	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	167	ASSUMED POSITIVE	8,000 S	THROUGHOUT INTERIOR WALLS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	700 S	CLASSROOMS & COVERED WALKWAYS	(1) (4)	N
S	STUCCO	251	ASSUMED POSITIVE	2,800 S	STAIRS & COVERED WALKWAYS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: B

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS	13	NONE DETECTED	10,000 S	ALL CLASSROOMS	(13) SAMPLE HMS-CHS-13 COLLECTED ON 3-28-88.	N/A
M	CEMENTITIOUS TRANSITE PANELS	95	ASSUMED POSITIVE	1,300 S	ALONG WALKWAYS, JANITORS CLOSETS, RESTROOMS, AND STAIRWAYS	(1) (4) PANELS PAINTED WHITE 11/19/03.	N
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	152	CERTIFIED ASBESTOS FREE	9,430 S	THROUGHOUT	(13) CERTIFICATION LETTER ON FILE.	N/A
M	DRYWALL & JOINT COMPOUND	168	ASSUMED POSITIVE	7,500 S	THROUGHOUT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	650 S	THROUGHOUT	(1) (4)	N
S	STUCCO	251	ASSUMED POSITIVE	1,500 S	COVERED WALKWAYS	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	252	ASSUMED POSITIVE	800 S	CORRIDORS AT ROOMS 2 & 10	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: C

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	TRANSITE PANELS	95	ASSUMED POSITIVE	1,300 S	EXTERIOR OF BUILDING	(1) (4) PANELS PAINTED WHITE 11/19/03.	N
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	150	CERTIFIED ASBESTOS FREE	9,513 S	CLASSROOMS 1-11	(13) LETTER IN FILE AS OF 6/2005.	N/A
M	DRYWALL & JOINT COMPOUND	169	ASSUMED POSITIVE	7,500 S	THROUGHOUT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	650 S	THROUGHOUT	(1) (4)	N
S	STUCCO	251	ASSUMED POSITIVE	1,500 S	COVERED WALKWAYS	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	252	ASSUMED POSITIVE	800 S	CORRIDORS AT ROOMS C1 & C10	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: D & H

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	38	1-5%	300 S	934 & 935, CORRIDOR BETWEEN D&H, AND BAND ROOM OFFICE	(1) (4) TROWELED ON CEILING.	N
M	12" VINYL FLOOR TILE (OFF WHITE) & ADHESIVE	150	CERTIFIED ASBESTOS FREE	1,200 S	MUSIC WING HALL, BAND ROOM D1, ROOM 938A	(13) CERTIFICATION LETTER ON FILE AS OF 6/2005.	N/A
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	600 S	CLASSROOMS H1, H2, & H3	(1) (4)	N
M	12" ACOUSTIC CEILING TILE 1/8" HOLE PATTERN	255	ASSUMED POSITIVE	3,500 S	CLASSROOMS H1, H2, & H3, RESTROOMS	(1) (4)	N
M	SHEET VINYL FLOORING (GRAY MARBLED) & ADHESIVE	256	ASSUMED POSITIVE	3,000 S	CLASSROOMS H1, H2, & H3	(1) (4)	N
M	DRYWALL	257	ASSUMED POSITIVE	3,000 S	CLASSROOMS H1, H2, & H3	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	258	ASSUMED POSITIVE	600 S	CORRIDOR BETWEEN D&H, BAND ROOM D1, CHORAL ROOM D2, ROOM 938A	(1) (4)	N
M	CEMENTITIOUS TRANSITE PIPE	259	ASSUMED POSITIVE	10 L	STORAGE (936) AT WATER HEATER	(1) (4)	N
M	12" VINYL FLOOR TILE (DARK GRAY) & ADHESIVE	260	ASSUMED POSITIVE	1,800 S	CHORAL ROOM D2	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

**General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
**Change in Condition:** (4) No (5) Yes (If Yes, explain under comments)  
**Abated:** (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
**Miscellaneous:** (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**



**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: L

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS FISSURE PATTERN	17	NONE DETECTED	11,155 S	ALL ROOMS	(13) SAMPLE HMS-CHS-17 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	19	5-10%	20 JOINTS	LIBRARY ATTIC	(11) NOT ACCESSIBLE	Y
M	12" VINYL FLOOR TILE (BEIGE MOTTLED) & ADHESIVE	151	CERTIFIED ASBESTOS FREE	850 S	LIBRARY ENTRANCE/OFFICE	(13) CERTIFICATION LETTER ON FILE AS OF 6/2005.	N/A
M	DRYWALL & JOINT COMPOUND	170	ASSUMED POSITIVE	10,000 S	THROUGHOUT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	800 S	THROUGHOUT	(1) (4)	N
M	CARPET ADHESIVE	264	ASSUMED POSITIVE	5,000 S	LIBRARY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: F

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	MUD JOINTS	52	5-10%	125 JOINTS	FINE ARTS	(12) UNABLE TO LOCATE	Y
M	2' X 4' CEILING PANELS FISSURE PATTERN	59	NONE DETECTED	4,500 S	CLASSROOMS 1-5	(13) SAMPLE HMS-CHS-59 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	60	5-10%	12 L	CLASSROOM 1	(12) UNABLE TO LOCATE	Y
M	KILN BRICK, TAN	151	NONE DETECTED	10.5 S	INSIDE OLDER TRANSITE PANELS ENCASED KILN	(13) SAMPLE HMS-R1303-01A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK, WHITE	152	NONE DETECTED	10.5 S	LARGER OLDER TRANSITE PANEL ENCASED KILN	(13) SAMPLE HMS-R1303-02A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK, WHITE	153	NONE DETECTED	10.5 S	METAL ENCASED CRESS ELECTRIC KILN MODEL A-22-H	(13) SAMPLE HMS-R1303-03A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK	154	NONE DETECTED	10.5 S	SMALL KILN APPROXIMATELY 2' HIGH BY 14" SQUARE WITH B-19 ON SIDE	(13) SAMPLE HMS-R1303-04A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK	155	NONE DETECTED	10.5 S	3' SQUARE KILN	(13) SAMPLE HMS-R1303-05A COLLECTED ON 4-13-04.	N/A
S	STUCCO	156	<1% CHRYSOTILE	220 S	EXTERIOR WALL AT SOUTH SIDE OF CERAMICS LAB ROOM 505	(1) (4) SAMPLE HMS-R1303-06A COLLECTED ON 4-13-04.	N
M	VINYL COVERED TAGBOARD	157	NONE DETECTED	800 S	CERAMICS LAB ROOM 505D	(13) SAMPLE HMS-R1303-07A COLLECTED ON 4-13-04.	N/A
M	BASE COVE ADHESIVE	250	ASSUMED POSITIVE	400 S	THROUGHOUT	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: S

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS	22	NONE DETECTED	8,000 S	ROOMS 1-7	(13) SAMPLE HMS-CHS-22 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	23	5-10%	40 JOINTS	ROOMS 1-7	(12) UNABLE TO LOCATE	Y
M	9" VINYL FLOOR TILE (BEIGE MARBLED) & ADHESIVE	24	1-5%	8,100 S	SCIENCE LAB/STORAGE	(1) (5) MISSING TILES	N
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	171	ASSUMED POSITIVE	8,000 S	ALL ROOMS EXCEPT SCIENCE LAB/STORAGE	(1) (4)	N
M	BASE COVE ADHESIVE	250	ASSUMED POSITIVE	500 S	THROUGHOUT	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: G (Gym)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	WALLS & CEILING PLASTER	46	NONE DETECTED	2,000 S	ALL ROOMS EXCEPT BOILER	(13) SAMPLE HMS-CHS-46A-C COLLECTED ON 3-28-88.  ADDITIONAL SAMPLES HMS-93103-03A-C COLLECTED ON 7-8-93.	N/A
T	PIPEWRAP STRAIGHT	50	50-55%	2,700 S	GIRL'S & BOY'S LOCKER ROOM AND BOILER ROOM CRAWL SPACES	(10) ISOLATED & RESTRICTED (11) INACCESSIBLE	Y
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	150 S	COACH OFFICE (GIRLS & BOYS)	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY) & ADHESIVE	264	ASSUMED POSITIVE	500 S	COACH OFFICE (GIRLS & BOYS)	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: IA

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	500 S	THROUGHOUT	(1) (4)	N
M	DRYWALL	257	ASSUMED POSITIVE	8,000 S	ROOMS 1, 2, 4, & 5	(1) (4)	N
M	12" VINYL FLOOR TILE (LIGHT GRAY MOTTLED) & ADHESIVE	261	ASSUMED POSITIVE	4,500 S	ROOMS 1, 2, 4, & 5	(1) (4)	N
M	2'X4' CEILING PANELS - SOLID PATTERN	270	ASSUMED POSITIVE	4,500 S	THROUGHOUT	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Senior High School

Building: AG-1100

Material Class	Material	Homo Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	WALL PLASTER	46	1-5%	950 S	CLASSROOM 2	(1) (4)	N
M	WALL PLASTER	160	NONE DETECTED	150 S	SOUTH WEST CORNER AREA BY DOOR OF TOILET ROOM OF CLASSROOM 1	(13) SAMPLE HMS-R1303-15A COLLECTED ON 4-13-04.	N/A
S	STUCCO	161	NONE DETECTED	1,000 S	EXTERIOR SOUTH ENTRY DOOR AND EAST WALL BY COKE MACHINE	(13) SAMPLES HMS-R1303-16A & B COLLECTED ON 4-13-04.	N/A
M	LINOLEUM LIKE COUNTER TOP W/ASPHALT LIKE BACKING - GREEN	162	NONE DETECTED	100 S	CLASSROOM 3	(13) SAMPLE HMS-R1303-17A COLLECTED ON 4-13-04.	N/A
M	BROWN COLORED GLOSS LIKE FLOOR FINISH	163	NONE DETECTED	300 S	HALLWAY BY CLASSROOM 2	(13) SAMPLE HMS-R1303-13A COLLECTED ON 4-13-04.	N/A
M	GREEN COLORED GLOSS LIKE FLOOR FINISH	164	NONE DETECTED	50 S	TOILET ROOM OFF CLASSROOM 1	(13) SAMPLE HMS-R1303-14A COLLECTED ON 4-13-04.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS HMR.wpd

**CONDITION CODE**

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Senior High School

Inspector: Blake Howes

Building & Location(s): A - Dark Room Attic (Classroom 111)

ECG- % Asbestos-5-10%

Homogeneous Mat. #7

Material description: Mud Joints

Total amount of material this location: 20 Joints

Amount of friable material this location: 20 Joints

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict	X	Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact
Vibration			X	Enclose		Do not drill, cut, sand, or grind
Air Erosion			X	Remove		Do not affix signs
Water			X	Encapsulate		Avoid contact
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged  
(Poor)

Damaged  
(Fair)

Not damaged  
(Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations: ATTIC SPACE SEALED CLOSED AND NOT ACCESSIBLE DURING THIS INSPECTION

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Senior High School

Inspector: Blake Howes

Building & Location(s): A - Dark Room Attic (Classroom 111)

ECG- % Asbestos-12-20%

Homogeneous Mat. #8

Material description: Mesh Wrap

Total amount of material this location: 0.5 L

Amount of friable material this location: 0.5 L

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE				RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L				
				Isolate/Restrict		Fix leaks	
Accessibility			X	Repair/Cleanup		Prevent water contact	X
Vibration			X	Enclose		Do not drill, cut, sand, or grind	X
Air Erosion			X	Remove	X	Do not affix signs	
Water			X	Encapsulate		Avoid contact	X
Occupancy			X	O & M	X		

**Assessment of Material Condition**

Significantly Damaged  
(Poor)

Damaged  
(Fair)

Not damaged  
(Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations: ATTIC SPACE SEALED CLOSED AND NOT ACCESSIBLE DURING THIS INSPECTION



**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Senior High School

Inspector: Blake Howes

Building & Location(s): L - Library Attic

ECG- % Asbestos-5-10%

Homogeneous Mat. #19

Material description: Mud Joints

Total amount of material this location: 20 Joints

Amount of friable material this location: 20 Joints

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact X
Vibration			X	Enclose		Do not drill, cut, sand, or grind X
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact X
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged (Poor)

Damaged (Fair)

Not damaged (Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations: ATTIC SPACE NOT ACCESSIBLE

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Senior High School

Inspector: Blake Howes

Building & Location(s): S - Rooms 1-7

ECG- % Asbestos-5-10%

Homogeneous Mat. #23

Material description: Mud Joints

Total amount of material this location: 40 Joints

Amount of friable material this location: 40 Joints

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact X
Vibration			X	Enclose		Do not drill, cut, sand, or grind X
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact X
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged (Poor)

Damaged (Fair)

Not damaged (Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations: UNABLE TO LOCATE

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Senior High School

Inspector: Blake Howes

Building & Location(s): G - Gym - Girl's & Boy's Locker Room and Boiler Room Crawl Spaces

ECG- % Asbestos-50-55%

Homogeneous Mat. #50

Material description: Pipewrap Straight

Total amount of material this location: 2,700 S

Amount of friable material this location: 2,700 S

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict	X	Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact X
Vibration			X	Enclose		Do not drill, cut, sand, or grind X
Air Erosion			X	Remove		Do not affix signs
Water			X	Encapsulate		Avoid contact X
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged  
(Poor)

Damaged  
(Fair)

Not damaged  
(Good)




Potential Damage:

High

High

Mod

Low

High

Mod

Low

Hazard Ranking:

1

2

3

4

5

6

7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations: INACCESSIBLE - MATERIAL IS ISOLATED AND RESTRICTED.

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Senior High School

Inspector: Blake Howes

Building & Location(s): F - Fine Arts

ECG- % Asbestos-5-10%

Homogeneous Mat. #52

Material description: Mud Joints

Total amount of material this location: 125 Joints

Amount of friable material this location: 125 Joints

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact X
Vibration			X	Enclose		Do not drill, cut, sand, or grind X
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact X
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged (Poor)

Damaged (Fair)

Not damaged (Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations: UNABLE TO LOCATE

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Senior High School

Inspector: Blake Howes

Building & Location(s): F - Classroom 1

ECG- % Asbestos-5-10%

Homogeneous Mat. #60

Material description: Mud Joints

Total amount of material this location: 12 L

Amount of friable material this location: 12 L

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact X
Vibration			X	Enclose		Do not drill, cut, sand, or grind X
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact X
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged (Poor)

Damaged (Fair)

Not damaged (Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7


								X
--	--	--	--	--	--	--	--	---

Comments & Observations: UNABLE TO LOCATE

# Chico Senior High School



New Building  
Under Construction  
at Time of Survey

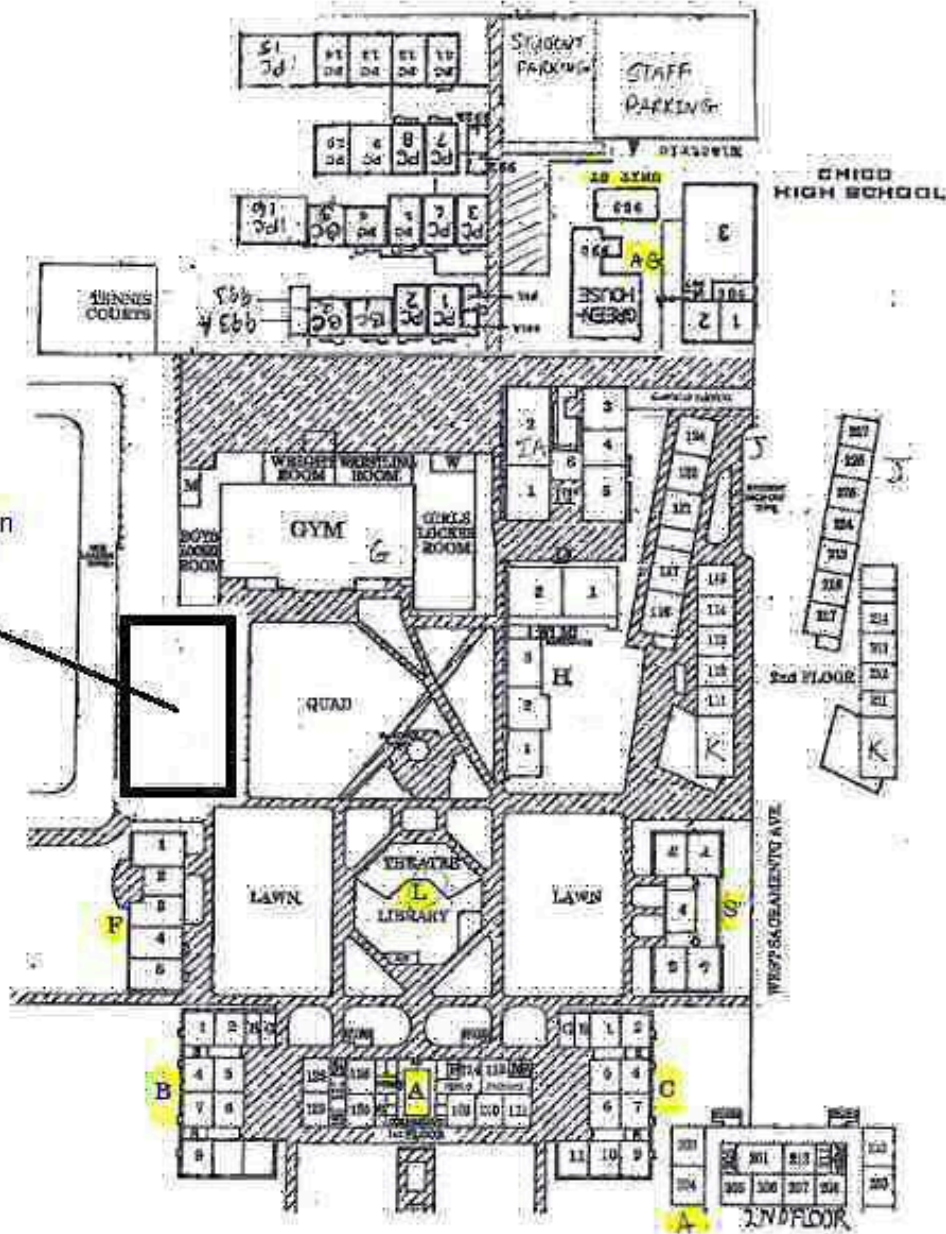

*Blake Howes*

Chico Unified School District  
Chico Senior High School  
901 The Esplanade  
Chico, CA 95926

Entek Consulting Group, Inc.  
4200 Rocklin Road, Suite 7  
Rocklin, California 95677  
Map Not To Scale

3-Year AHERA Reinspection  
Conducted by Blake Howes  
August 1, 2013  
Project 13-2751

# **SIX-MONTH SURVEILLANCE**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: A (1<sup>st</sup> Floor)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS FISSURE PATTERN	1	NONE DETECTED	5,735 S	ADMINISTRATION AREA & CLASSROOMS 113-130	(13) SAMPLE HMS-CHS-01 COLLECTED ON 3-28-88.	N/A
M	12" VINYL FLOOR TILE (BEIGE) & ADHESIVE	2	TRACE	5,700 S	RECEPTION AREA & CLASSROOMS	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	3	NONE DETECTED	3,550 S	PRINCIPLES OFFICE, COMPTROLLER, 120, AND CLASSROOMS 102-107	(13) SAMPLE HMS-CHS-03 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	7	5-10%	20 JOINTS	DARK ROOM ATTIC (CLASSROOM 111)	(11) INACCESSIBLE.	Y
T	MESH WRAP	8	12-20%	½ L	DARK ROOM ATTIC (CLASSROOM 111)	(11) INACCESSIBLE.	Y
M	TRANSITE PANELS	95	ASSUMED POSITIVE	1,300 S	ALONG WALKWAYS, JANITORS CLOSETS, RESTROOMS, AND STAIRWELLS	(1) (4) PANELS PAINTED WHITE 11/19/03.	N
M	DRYWALL & JOINT COMPOUND	166	ASSUMED POSITIVE	8,000 S	THROUGHOUT INTERIOR WALLS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	700 S	THROUGHOUT INTERIOR	(1) (4)	N
S	STUCCO	251	ASSUMED POSITIVE	2,500 S	COVERED WALKWAYS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**



**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: A (2<sup>ND</sup> Floor)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (BEIGE) & ADHESIVE	2	TRACE	5,800 S	UPSTAIRS CLASSROOMS	(1) (4)	N
M	2' X 4' CEILING PANELS	6	NONE DETECTED	10,000 S	UPSTAIRS CLASSROOMS	(13) SAMPLE HMS-CHS-06 COLLECTED ON 3-28-88.	N/A
M	CEMENTITIOUS TRANSITE PANELS	95	ASSUMED POSITIVE	1,300 S	COVERED WALKWAYS	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	167	ASSUMED POSITIVE	8,000 S	THROUGHOUT INTERIOR WALLS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	700 S	CLASSROOMS & COVERED WALKWAYS	(1) (4)	N
S	STUCCO	251	ASSUMED POSITIVE	2,800 S	STAIRS & COVERED WALKWAYS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: B

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS	13	NONE DETECTED	10,000 S	ALL CLASSROOMS	(13) SAMPLE HMS-CHS-13 COLLECTED ON 3-28-88.	N/A
M	CEMENTITIOUS TRANSITE PANELS	95	ASSUMED POSITIVE	1,300 S	ALONG WALKWAYS, JANITORS CLOSETS, RESTROOMS, AND STAIRWAYS	(1) (4) PANELS PAINTED WHITE 11/19/03.	N
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	152	CERTIFIED ASBESTOS FREE	9,430 S	THROUGHOUT	(13) CERTIFICATION LETTER ON FILE.	N/A
M	DRYWALL & JOINT COMPOUND	168	ASSUMED POSITIVE	7,500 S	THROUGHOUT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	650 S	THROUGHOUT	(1) (4)	N
S	STUCCO	251	ASSUMED POSITIVE	1,500 S	COVERED WALKWAYS	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	252	ASSUMED POSITIVE	800 S	CORRIDORS AT ROOMS 2 & 10	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: C

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	TRANSITE PANELS	95	ASSUMED POSITIVE	1,300 S	EXTERIOR OF BUILDING	(1) (4) PANELS PAINTED WHITE 11/19/03.	N
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	150	CERTIFIED ASBESTOS FREE	9,513 S	CLASSROOMS 1-11	(13) LETTER IN FILE AS OF 6/2005.	N/A
M	DRYWALL & JOINT COMPOUND	169	ASSUMED POSITIVE	7,500 S	THROUGHOUT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	650 S	THROUGHOUT	(1) (4)	N
S	STUCCO	251	ASSUMED POSITIVE	1,500 S	COVERED WALKWAYS	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	252	ASSUMED POSITIVE	800 S	CORRIDORS AT ROOMS C1 & C10	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: D & H

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	38	1-5%	300 S	934 & 935, CORRIDOR BETWEEN D&H, AND BAND ROOM OFFICE	(1) (4) TROWELED ON CEILING.	N
M	12" VINYL FLOOR TILE (OFF WHITE) & ADHESIVE	150	CERTIFIED ASBESTOS FREE	1,200 S	MUSIC WING HALL, BAND ROOM D1, ROOM 938A	(13) CERTIFICATION LETTER ON FILE AS OF 6/2005.	N/A
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	600 S	CLASSROOMS H1, H2, & H3	(1) (4)	N
M	12" ACOUSTIC CEILING TILE 1/8" HOLE PATTERN	255	ASSUMED POSITIVE	3,500 S	CLASSROOMS H1, H2, & H3, RESTROOMS	(1) (4)	N
M	SHEET VINYL FLOORING (GRAY MARBLED) & ADHESIVE	256	ASSUMED POSITIVE	3,000 S	CLASSROOMS H1, H2, & H3	(1) (4)	N
M	DRYWALL	257	ASSUMED POSITIVE	3,000 S	CLASSROOMS H1, H2, & H3	(1) (4)	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	258	ASSUMED POSITIVE	600 S	CORRIDOR BETWEEN D&H, BAND ROOM D1, CHORAL ROOM D2, ROOM 938A	(1) (4)	N
M	CEMENTITIOUS TRANSITE PIPE	259	ASSUMED POSITIVE	10 L	STORAGE (936) AT WATER HEATER	(1) (4)	N
M	12" VINYL FLOOR TILE (DARK GRAY) & ADHESIVE	260	ASSUMED POSITIVE	1,800 S	CHORAL ROOM D2	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspection\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: L

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS FISSURE PATTERN	17	NONE DETECTED	11,155 S	ALL ROOMS	(13) SAMPLE HMS-CHS-17 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	19	5-10%	20 JOINTS	LIBRARY ATTIC	(11) NOT ACCESSIBLE	Y
M	12" VINYL FLOOR TILE (BEIGE MOTTLED) & ADHESIVE	151	CERTIFIED ASBESTOS FREE	850 S	LIBRARY ENTRANCE/OFFICE	(13) CERTIFICATION LETTER ON FILE AS OF 6/2005.	N/A
M	DRYWALL & JOINT COMPOUND	170	ASSUMED POSITIVE	10,000 S	THROUGHOUT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	800 S	THROUGHOUT	(1) (4)	N
M	CARPET ADHESIVE	264	ASSUMED POSITIVE	5,000 S	LIBRARY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: F

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	MUD JOINTS	52	5-10%	125 JOINTS	FINE ARTS	(12) UNABLE TO LOCATE	Y
M	2' X 4' CEILING PANELS FISSURE PATTERN	59	NONE DETECTED	4,500 S	CLASSROOMS 1-5	(13) SAMPLE HMS-CHS-59 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	60	5-10%	12 L	CLASSROOM 1	(12) UNABLE TO LOCATE	Y
M	KILN BRICK, TAN	151	NONE DETECTED	10.5 S	INSIDE OLDER TRANSITE PANELS ENCASED KILN	(13) SAMPLE HMS-R1303-01A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK, WHITE	152	NONE DETECTED	10.5 S	LARGER OLDER TRANSITE PANEL ENCASED KILN	(13) SAMPLE HMS-R1303-02A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK, WHITE	153	NONE DETECTED	10.5 S	METAL ENCASED CRESS ELECTRIC KILN MODEL A-22-H	(13) SAMPLE HMS-R1303-03A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK	154	NONE DETECTED	10.5 S	SMALL KILN APPROXIMATELY 2' HIGH BY 14" SQUARE WITH B-19 ON SIDE	(13) SAMPLE HMS-R1303-04A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK	155	NONE DETECTED	10.5 S	3' SQUARE KILN	(13) SAMPLE HMS-R1303-05A COLLECTED ON 4-13-04.	N/A
S	STUCCO	156	<1% CHRYSOTILE	220 S	EXTERIOR WALL AT SOUTH SIDE OF CERAMICS LAB ROOM 505	(1) (4) SAMPLE HMS-R1303-06A COLLECTED ON 4-13-04.	N
M	VINYL COVERED TAGBOARD	157	NONE DETECTED	800 S	CERAMICS LAB ROOM 505D	(13) SAMPLE HMS-R1303-07A COLLECTED ON 4-13-04.	N/A
M	BASE COVE ADHESIVE	250	ASSUMED POSITIVE	400 S	THROUGHOUT	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)  
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: S

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS	22	NONE DETECTED	8,000 S	ROOMS 1-7	(13) SAMPLE HMS-CHS-22 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	23	5-10%	40 JOINTS	ROOMS 1-7	(12) UNABLE TO LOCATE	Y
M	9" VINYL FLOOR TILE (BEIGE MARBLED) & ADHESIVE	24	1-5%	8,100 S	SCIENCE LAB/STORAGE	(1) (5) MISSING TILES	N
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	171	ASSUMED POSITIVE	8,000 S	ALL ROOMS EXCEPT SCIENCE LAB/STORAGE	(1) (4)	N
M	BASE COVE ADHESIVE	250	ASSUMED POSITIVE	500 S	THROUGHOUT	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: G (Gym)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	WALLS & CEILING PLASTER	46	NONE DETECTED	2,000 S	ALL ROOMS EXCEPT BOILER	(13) SAMPLE HMS-CHS-46A-C COLLECTED ON 3-28-88.  ADDITIONAL SAMPLES HMS-93103-03A-C COLLECTED ON 7-8-93.	N/A
T	PIPEWRAP STRAIGHT	50	50-55%	2,700 S	GIRL'S & BOY'S LOCKER ROOM AND BOILER ROOM CRAWL SPACES	(10) ISOLATED & RESTRICTED (11) INACCESSIBLE	Y
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	150 S	COACH OFFICE (GIRLS & BOYS)	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY) & ADHESIVE	264	ASSUMED POSITIVE	500 S	COACH OFFICE (GIRLS & BOYS)	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**



**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: IA

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	500 S	THROUGHOUT	(1) (4)	N
M	DRYWALL	257	ASSUMED POSITIVE	8,000 S	ROOMS 1, 2, 4, & 5	(1) (4)	N
M	12" VINYL FLOOR TILE (LIGHT GRAY MOTTLED) & ADHESIVE	261	ASSUMED POSITIVE	4,500 S	ROOMS 1, 2, 4, & 5	(1) (4)	N
M	2'X4' CEILING PANELS - SOLID PATTERN	270	ASSUMED POSITIVE	4,500 S	THROUGHOUT	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Senior High School

Building: AG-1100

Material Class	Material	Homo Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	WALL PLASTER	46	1-5%	950 S	CLASSROOM 2	(1) (4)	N
M	WALL PLASTER	160	NONE DETECTED	150 S	SOUTH WEST CORNER AREA BY DOOR OF TOILET ROOM OF CLASSROOM 1	(13) SAMPLE HMS-R1303-15A COLLECTED ON 4-13-04.	N/A
S	STUCCO	161	NONE DETECTED	1,000 S	EXTERIOR SOUTH ENTRY DOOR AND EAST WALL BY COKE MACHINE	(13) SAMPLES HMS-R1303-16A & B COLLECTED ON 4-13-04.	N/A
M	LINOLEUM LIKE COUNTER TOP W/ASPHALT LIKE BACKING - GREEN	162	NONE DETECTED	100 S	CLASSROOM 3	(13) SAMPLE HMS-R1303-17A COLLECTED ON 4-13-04.	N/A
M	BROWN COLORED GLOSS LIKE FLOOR FINISH	163	NONE DETECTED	300 S	HALLWAY BY CLASSROOM 2	(13) SAMPLE HMS-R1303-13A COLLECTED ON 4-13-04.	N/A
M	GREEN COLORED GLOSS LIKE FLOOR FINISH	164	NONE DETECTED	50 S	TOILET ROOM OFF CLASSROOM 1	(13) SAMPLE HMS-R1303-14A COLLECTED ON 4-13-04.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspection\Sites\Chico HS\Chico HS 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**