

# **Chico Junior High**

**RECORD OF FRIABLE AND NON-FRIABLE ACM  
(FORM B)**

Inspection Date(s) August 1, 2013

**THREE-YEAR REINSPECTION**

					CDS CODE 04-61424-6057137
SCHOOL Chico Junior High School					SCHOOL PHONE NUMBER (530) 891-3066
ADDRESS 280 Memorial Way	(NUMBER)	(STREET)	(CITY) Chico, CA	(ZIP) 95926	

**-IMPORTANT-**

Each building and functional space with friable ACM or friable assumed ACM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACM OR FRIABLE ASSUMED ACM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE <small>(Indicate Address if Different From Above)</small>	CHECK ONE			CHECK ONE			
		SUR-FACING	TSI	MISC	ACBM		ASSUMED ACM	
					FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
1	A (Main Office Bldg.)	X		X		X		X
2	B (Classrooms 201-211) (fka K)	X		X				X
3	C (Classrooms 301-311)	X		X				X
4	D (Classrooms 401, 403, 405, 407 & 409)	X		X				X
5	E (Gymnasium)	X		X				X
6	F (PE Locker Rooms)	X	X	X		X		X
7	CEILING PIPE CHASE		X				X	
8	G (Maintenance)		X				X	
9	H & I (Classrooms 501 A & B, 503 & 505)	X		X				X
10	J (Maintenance)	X		X			X	
11	K (No Longers Exists)							
12	L (Classrooms 500, 502, 504 & 506)	X		X		X		X
13	Classrooms 502 & 506		X		X		X	
14	M (Classrooms 400, 402, 404, 406 & 408)	X		X				X
15	N (Classrooms 300, 302, 304 & 306)	X		X		X		X
16	O (Classrooms 200, 202, 204, 206 & 208)	X		X		X		X
17	P (MPR)	X		X		X		X
18	Q (Main Corridor)	X		X		X		X

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-Form B.wpd

**See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.**

**RECORD OF FRIABLE AND NON-FRIABLE ACM  
(FORM B)**

Inspection Date(s) August 1, 2013

**THREE-YEAR REINSPECTION**

					CDS CODE 04-61424-6057137	
SCHOOL Chico Junior High School					SCHOOL PHONE NUMBER (530) 891-3066	
ADDRESS	(NUMBER)	(STREET)	(CITY)	(ZIP)		
280 Memorial Way			Chico, CA	95926		

**-IMPORTANT-**

Each building and functional space with friable ACM or friable assumed ACM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACM OR FRIABLE ASSUMED ACM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE <small>(Indicate Address if Different From Above)</small>	CHECK ONE			CHECK ONE			
		SUR-FACING	TSI	MISC	ACBM		ASSUMED ACM	
					FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
19.	METAL STORAGE'S (2) <b>NO SUSPECT ACM</b>							
20.	P-1 <b>DISTRICT MUST CERTIFY</b>							
21.	STORAGE <b>NO SUSPECT ACM</b>							
22.	SPEECH UNIT <b>DISTRICT MUST CERTIFY</b>							
23.	UNIT 600 COUNTY CH <b>DISTRICT MUST CERTIFY</b>							
24.								
25.								
26.								
27.								
28.								
29.								
30.								
31.								
32.								
33.								
34.								
35.								

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-Form B.wpd

**See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: P (MPR)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	6,500 S	TEACHER'S DINING ROOM, MPR, AND REST OF THE WING	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	106	ASSUMED POSITIVE	5,000 S	THROUGHOUT UNIT - ALL WALLS AND KITCHEN CEILING	(1) (4)	N
M	NON-SLIP LINOLEUM (DARK GRAY) & ADHESIVE	107	ASSUMED POSITIVE	2,200 S	KITCHEN AND KITCHEN OFFICE	(1) (4)	N
M	12" VINYL FLOOR TILE (BLUE MOTTLED) & ADHESIVE	108	ASSUMED POSITIVE	5,570 S	MPR AND STAFF DINNING	(1) (4)	N
S	DRYWALL TEXTURE	109	ASSUMED POSITIVE	1,400 S	NURSE OFFICE AND CONFERENCE ROOM	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY/BLUE) & ADHESIVE	110	ASSUMED POSITIVE	200 S	NURSE OFFICE	(1) (4)	N
M	SHEET VINYL FLOORING - (GRAY/ WHITE PEBBLED)	111	ASSUMED POSITIVE	25 S	NURSE RESTROOM	(1) (4)	N
M	BASE COVE ADHESIVE	250	ASSUMED POSITIVE	700 L	THROUGHOUT UNIT	(1) (4)	N
M	CARPET ADHESIVE	252	ASSUMED POSITIVE	500 S	NURSE OFFICE & CONFERENCE ROOM	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	1,200 S	COVERED WALKWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

**General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
**Change in Condition:** (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
**Abated:** (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
**Miscellaneous:** (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: O (Classrooms 200, 202, 204, 206 & 208)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	300 S	TITLE ONE OFFICE AND RESTROOMS	(1) (4) MINOR CRACKS IN THE MIDDLE AREA.	N
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	640 S	EXTERIOR OF UNIT	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	97	ASSUMED POSITIVE	4,000 S	ALL CLASSROOMS	(1) (4) (11) TITLE ONE OFFICE COVERED WITH CARPET.	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	99	ASSUMED POSITIVE	4,000 S	THROUGHOUT CLASSROOM WING	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	600 S	THROUGHOUT CLASSROOM WING	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	800 S	CLASSROOMS 202-208 AT LOWER WALLS	(1) APPEARS TO BE PAINTED WOOD PANELS. (12) FURTHER INVESTIGATION REQUIRED	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: N (Classrooms 300, 302, 304 & 306)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VINYL FLOOR TILE (RED) & ADHESIVE	2	1-5%	70 S	JANITOR'S CLOSET (ROOM 310)	(1) (4)	N
S	CEILING PLASTER	8	1-5%	300 S	JANITOR'S CLOSET (ROOM 310) AND GIRL'S RESTROOM	(1) (4)	N
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	640 S	EXTERIOR OF UNIT	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	97	ASSUMED POSITIVE	4,000 S	CLASSROOMS 300, 302, 304, & 306	(1) (4)	N
M	2' X 4' CEILING PANELS - FISSURE PATTERN	99	ASSUMED POSITIVE	4,000 S	THROUGHOUT CLASSROOMS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	600 S	THROUGHOUT CLASSROOMS & JANITOR CLOSET	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAYS	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	600 S	CLASSROOMS 300-304 AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: M (Classrooms 400, 402, 404, 406 & 408)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	112	ASSUMED POSITIVE	175 S	PSYCHOLOGIST OFFICE & STAFF RESTROOM	(1) (4)	N
M	TRANSITE PANELS	113	ASSUMED POSITIVE	640 S	EXTERIOR	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	114	ASSUMED POSITIVE	4,000 S	ALL CLASSROOMS	(1) (4) (11) CLASSROOM 402 AND PSYCHOLOGIST OFFICE ARE COVERED WITH CARPET.	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	115	ASSUMED POSITIVE	4,000 S	ALL CLASSROOMS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	600 S	THROUGHOUT CLASSROOMS	(1) (4)	N
M	CARPET ADHESIVE	252	ASSUMED POSITIVE	850 S	CLASSROOM 402 & PSYCHOLOGIST	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	1,000 S	CLASSROOMS 400-408 AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

**General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
**Change in Condition:** (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
**Abated:** (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
**Miscellaneous:** (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: L (Classrooms 500, 502, 504 & 506)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VINYL FLOOR TILE (RED) & ADHESIVE	2	1-5%	70 S	MIGRANT EDUCATION OFFICE	(1) (4)	N
S	CEILING PLASTER	8	1-5%	175 S	MIGRANT EDUCATION OFFICE'S & GIRL'S RESTROOM	(1) (4)	N
T	PIPE WRAP STRAIGHT	26	40-45%	UNDETERMINED	CLASSROOM 502	(1) VISIBLE IN STORAGE @ MISSING 12" CEILING TILES	Y
T	PIPE WRAP STRAIGHT	95	ASSUMED POSITIVE	UNDETERMINED	CLASSROOM 506	(11) UNABLE TO LOCATE MATERIAL	Y
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	640 S	EXTERIOR OF UNIT	(1) (4)	N
M	12" VINYL FLOOR TILE (LIGHT GRAY /BEIGE) & ADHESIVE	98	ASSUMED POSITIVE	4,000 S	CLASSROOMS 500, 502, 504, & 506	(1) (4) ROOM 506 HAS MISSING TILES AT DOOR	N
M	2' X 4' CEILING PANELS - FISSURE PATTERN	116	ASSUMED POSITIVE	4,000 S	ALL CLASSROOMS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	500 S	ALL CLASSROOMS	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAYS	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	1,000 S	ALL CLASSROOMS AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**



**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: L (Classrooms 500, 502, 504 & 506) CONTINUED

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	12" ACOUSTIC CEILING TILE	256	ASSUMED POSITIVE	50 S	ROOM 502 STORAGE 2	(1)	N
S	PLASTER	257	ASSUMED POSITIVE	300 S	ROOM 502 STORAGE 1 & 2	(1)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: J (Maintenance)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
T	BOILER REFRACTORY	100	ASSUMED POSITIVE	UNDETE-RMINED	TWO BOILER UNITS	(1) (4)	Y

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: H & I (Classrooms 501A&B, 503 & 505)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	12" ACOUSTIC CEILING TILE	17	NONE DETECTED	4,300 S	WOOD SHOP, DURST THEATER, MUSIC CLASSROOM, & PRACTICE CLASSROOMS 1-5	(13) SAMPLE HMS-CJH-17 COLLECTED IN 1988. DURST THEATER & MUSIC CLASSROOM ARE SAME AREA	N/A
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	100 S	EXTERIOR OF UNIT AT WINDOWS	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	97	ASSUMED POSITIVE	2,200 S	COMPUTER ROOM, MATERIAL STORAGE, STORAGE, & STAFF OFFICE, DURST THEATER, OFFICES, MUSIC CLASSROOM, AND PRACTICE CLASSROOMS 1-5	(1) (4) DURST THEATER & MUSIC CLASSROOM ARE SAME AREA	N
S	CEILING PLASTER	117	ASSUMED POSITIVE	700 S	OFFICES, STORAGE ROOMS, AND WOODSHOP CLASSROOM	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	200 S	CLASSROOM	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	1,500 S	COVERED WALKWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: A (Main Office)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	2,500 S	LIBRARY	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY) & ADHESIVE	97	ASSUMED POSITIVE	600 S	ADMINISTRATION OFFICES, HALLWAY, AND LIBRARY	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	101	ASSUMED POSITIVE	14,100 S	THROUGHOUT UNIT AND LIBRARY	(1) (4) NEW DRYWALL WAS PUT INTO THIS UNIT DURING THE RENOVATION IN THE SUMMER OF 2000.	N
S	DRYWALL TEXTURE	118	ASSUMED POSITIVE	14,100 S	THROUGHOUT UNIT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	800 S	THROUGHOUT UNIT	(1) (4)	N
M	12" VINYL FLOOR TILE (DARK GRAY) & ADHESIVE	251	ASSUMED POSITIVE	100 S	ROOM 908	(1) (4)	N
M	CARPET ADHESIVE	252	ASSUMED POSITIVE	4,000 S	OFFICES & LIBRARY	(1) (4)	N
M	12" VINYL FLOOR TILE (LIGHT GRAY) & ADHESIVE	253	ASSUMED POSITIVE	700 S	HALLWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
**Change in Condition:** (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
**Abated:** (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
**Miscellaneous:** (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: B (Classrooms 201-211)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	700 S	EXTERIOR OF UNIT AT WINDOWS	(1) (4)	N
M	2' X 4' CEILING PANELS - FISSURE PATTERN	99	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	12" VINYL FLOOR TILE (LIGHT GRAY) & ADHESIVE	102	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	BASE COVE ADHESIVE	250	ASSUMED POSITIVE	720 S	THROUGHOUT CLASSROOMS	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	2,000 S	CLASSROOMS AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: C (Classrooms 301-311)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	700 S	EXTERIOR OF UNIT	(1) (4)	N
M	2' X 4' CEILING PANELS - FISSURE PATTERN	99	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	12" VINYL FLOOR TILE (LIGHT GREY MOTTLED) & ADHESIVE	103	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	720 S	THROUGHOUT CLASSROOMS	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	2,000 S	CLASSROOMS AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: D (Classrooms 401, 403, 405, 407 & 409)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	TRANSITE PANELS	96	ASSUMED POSITIVE	700 S	EXTERIOR OF UNIT	(1) (4)	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	99	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	12" VINYL FLOOR TILE (LIGHT GREY MOTTLED) & ADHESIVE	103	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	650 S	THROUGHOUT CLASSROOMS	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	1,200 S	CLASSROOMS AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: E (Gymnasium)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	12" CEILING TILE	119	ASSUMED POSITIVE	5,000 S	GYM	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	2,200 S	CORRIDOR	(1) (4)	N
S	TEXTURE ON CONCRETE & PLASTER WALLS	300	ASSUMED POSITIVE	1,800 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	301	ASSUMED POSITIVE	400 S	RESTROOMS	(1) (4)	N
S	TEXTURE ON DRYWALL	302	ASSUMED POSITIVE	400 S	RESTROOMS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**



**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: F (Locker Rooms)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VINYL FLOOR TILE (GREEN) & ADHESIVE	5	1-5%	UNDETERMINED	CLASSROOM 18 STORAGE	(12) UNABLE TO LOCATE CLASSROOM 18	N
T	PIPE WRAP	105	ASSUMED POSITIVE	UNDETERMINED	IN CEILING PIPE CHASE	(10)	Y
S	STUCCO	254	ASSUMED POSITIVE	800 S	COVERED WALKWAY	(1) (4)	N
S	PLASTER	260	ASSUMED POSITIVE	5,000 S	THROUGHOUT UNIT	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**THREE-YEAR REINSPECTION  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: August 1, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Chico Junior High School

Building: Q (Main Corridor)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	PLASTER	8	1-5%	10,000 S	CEILINGS & WALLS	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY) & ADHESIVE	97	ASSUMED POSITIVE	500 S	THROUGHOUT CORRIDOR AT BORDERS	(1) (4)	N
M	12" VINYL FLOOR TILE (LIGHT GRAY) & ADHESIVE	253	ASSUMED POSITIVE	3,000 S	THROUGHOUT CORRIDOR	(1) (4)	N
M	COVE BASE ADHESIVE	261	ASSUMED POSITIVE	1,000 S	THROUGHOUT CORRIDOR	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS-HMR.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Junior High School

Inspector: Blake Howes

Building & Location(s): L - Classroom 502

ECG- % Asbestos-40-45%

Homogeneous Mat. #26

Material description: Pipe Wrap Straight

Total amount of material this location: Undetermined

Amount of friable material this location: Undetermined

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact
Vibration			X	Enclose		Do not drill, cut, sand, or grind
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged  
(Poor)

Damaged  
(Fair)

Not damaged  
(Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations: Partially accessible through missing 12" acoustic ceiling tile in storage room. Assumed to exist above ceiling tiles throughout area.

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Junior High School

Inspector: Blake Howes

Building & Location(s): L - Classroom 506

ECG- % Asbestos-Assumed

Homogeneous Mat. #95

Material description: Pipe Wrap Straight.

Total amount of material this location: Undetermined

Amount of friable material this location: Undetermined

Damage	Local		Distributed		Damaged	%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage:

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact
Vibration			X	Enclose		Do not drill, cut, sand, or grind
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged  
(Poor)

Damaged  
(Fair)

Not damaged  
(Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

--	--	--	--	--	--	--	--	--

Comments & Observations: This material is inaccessible. Assumed to exist in wall or ceiling cavities.

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Junior High School

Inspector: Blake Howes

Building & Location(s): J - Two Boiler Units

ECG- % Asbestos-Assumed

Homogeneous Mat. #100

Material description: Boiler Refractory.

Total amount of material this location: Undetermined

Amount of friable material this location: Undetermined

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact
Vibration			X	Enclose		Do not drill, cut, sand, or grind
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged  
(Poor)

Damaged  
(Fair)

Not damaged  
(Good)




Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

								X
--	--	--	--	--	--	--	--	---

Comments & Observations: Boilers are in good condition, no damage.

**ENTEK CONSULTING GROUP, INC.  
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Chico Junior High School

Inspector: Blake Howes

Building & Location(s): F - In Ceiling Pipe Chase

ECG- % Asbestos-Assumed

Homogeneous Mat. #105

Material description: Pipe Wrap

Total amount of material this location: Undetermined

Amount of friable material this location: Undetermined

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility			X	Repair/Cleanup		Prevent water contact
Vibration			X	Enclose		Do not drill, cut, sand, or grind
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate		Avoid contact
Occupancy			X	O & M	X	

**Assessment of Material Condition**

Significantly Damaged  
(Poor)

Damaged  
(Fair)

Not damaged  
(Good)




Potential Damage: High

High Mod Low

High Mod Low


Hazard Ranking:

1 2 3 4 5 6 7

--	--	--	--	--	--	--	--	--

Comments & Observations: Material is inaccessible. No assessment can be made.

# Chico Junior High School

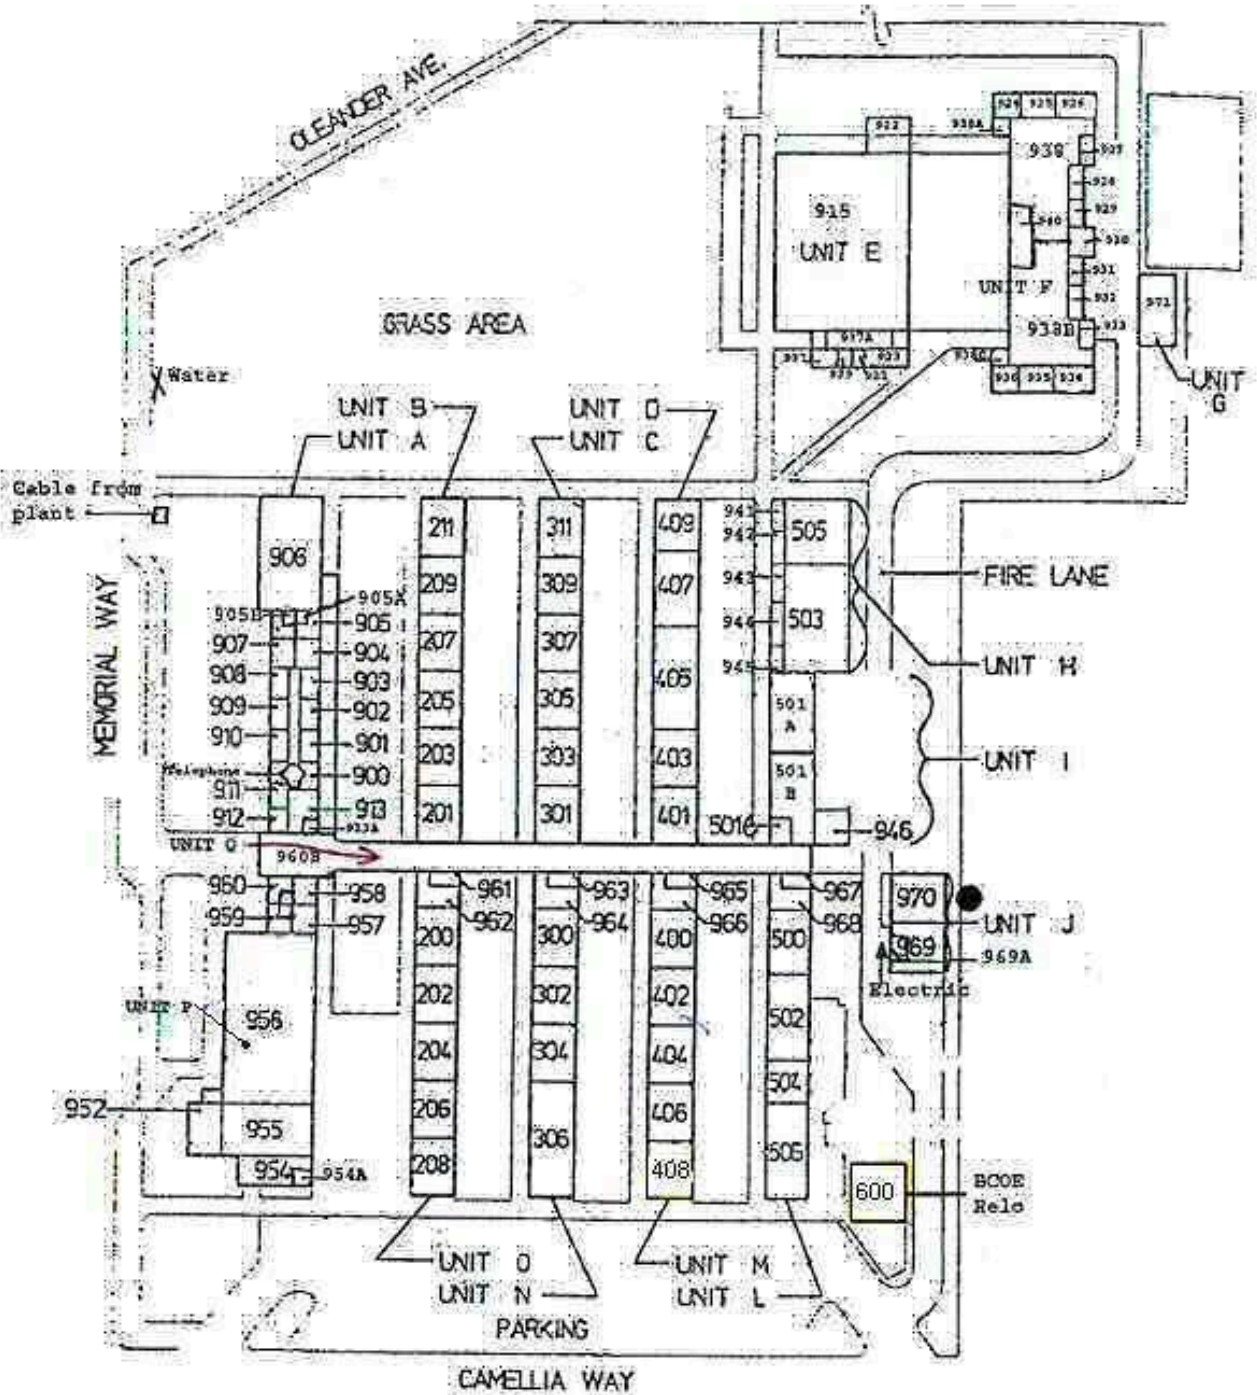

*Blake Howes*

Chico Unified School District  
 Chico Junior High School  
 280 Memorial Way  
 Chico, CA 95926

Entek Consulting Group, Inc.  
 4200 Rocklin Road, Suite 7  
 Rocklin, California 95677  
 Map Not To Scale

3-Year AHERA Reinspection  
 Conducted by Blake Howes  
 August 5, 2013  
 Project 13-2751

# **SIX-MONTH SURVEILLANCE**



**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District  
School: Chico Junior High School

Inspector:  
Building: P (MPR)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	6,500 S	TEACHER'S DINING ROOM, MPR, AND REST OF THE WING	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	106	ASSUMED POSITIVE	5,000 S	THROUGHOUT UNIT - ALL WALLS AND KITCHEN CEILING	(1) (4)	N
M	NON-SLIP LINOLEUM (DARK GRAY) & ADHESIVE	107	ASSUMED POSITIVE	2,200 S	KITCHEN AND KITCHEN OFFICE	(1) (4)	N
M	12" VINYL FLOOR TILE (BLUE MOTTLED) & ADHESIVE	108	ASSUMED POSITIVE	5,570 S	MPR AND STAFF DINNING	(1) (4)	N
S	DRYWALL TEXTURE	109	ASSUMED POSITIVE	1,400 S	NURSE OFFICE AND CONFERENCE ROOM	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY/BLUE) & ADHESIVE	110	ASSUMED POSITIVE	200 S	NURSE OFFICE	(1) (4)	N
M	SHEET VINYL FLOORING - (GRAY/ WHITE PEBBLED)	111	ASSUMED POSITIVE	25 S	NURSE RESTROOM	(1) (4)	N
M	BASE COVE ADHESIVE	250	ASSUMED POSITIVE	700 L	THROUGHOUT UNIT	(1) (4)	N
M	CARPET ADHESIVE	252	ASSUMED POSITIVE	500 S	NURSE OFFICE & CONFERENCE ROOM	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	1,200 S	COVERED WALKWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous:(11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: O (Classrooms 200, 202, 204, 206 & 208)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	300 S	TITLE ONE OFFICE AND RESTROOMS	(1) (4) MINOR CRACKS IN THE MIDDLE AREA	N
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	640 S	EXTERIOR OF UNIT	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	97	ASSUMED POSITIVE	4,000 S	ALL CLASSROOMS	(1) (4) (11) TITLE ONE OFFICE COVERED WITH CARPET.	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	99	ASSUMED POSITIVE	4,000 S	THROUGHOUT CLASSROOM WING	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	600 S	THROUGHOUT CLASSROOM WING	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	800 S	CLASSROOMS 202-208 AT LOWER WALLS	(1) APPEARS TO BE PAINTED WOOD PANELS. (12) FURTHER INVESTIGATION REQUIRED	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: N (Classrooms 300, 302, 304 & 306)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VINYL FLOOR TILE (RED) & ADHESIVE	2	1-5%	70 S	JANITOR'S CLOSET (ROOM 310)	(1) (4)	N
S	CEILING PLASTER	8	1-5%	300 S	JANITOR'S CLOSET (ROOM 310) AND GIRL'S RESTROOM	(1) (4)	N
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	640 S	EXTERIOR OF UNIT	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	97	ASSUMED POSITIVE	4,000 S	CLASSROOMS 300, 302, 304, & 306	(1) (4)	N
M	2' X 4' CEILING PANELS - FISSURE PATTERN	99	ASSUMED POSITIVE	4,000 S	THROUGHOUT CLASSROOMS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	600 S	THROUGHOUT CLASSROOMS & JANITOR CLOSET	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAYS	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	600 S	CLASSROOMS 300-304 AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: M (Classrooms 400, 402, 404, 406 & 408)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	112	ASSUMED POSITIVE	175 S	PSYCHOLOGIST OFFICE & STAFF RESTROOM	(1) (4)	N
M	TRANSITE PANELS	113	ASSUMED POSITIVE	640 S	EXTERIOR	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	114	ASSUMED POSITIVE	4,000 S	ALL CLASSROOMS	(1) (4) (11) CLASSROOM 402 AND PSYCHOLOGIST OFFICE ARE COVERED WITH CARPET.	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	115	ASSUMED POSITIVE	4,000 S	ALL CLASSROOMS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	600 S	THROUGHOUT CLASSROOMS	(1) (4)	N
M	CARPET ADHESIVE	252	ASSUMED POSITIVE	850 S	CLASSROOM 402 & PSYCHOLOGIST	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	1,000 S	CLASSROOMS 400-408 AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

District: Chico Unified School District  
School: Chico Junior High School

Date of Inspection:  
Inspector:  
Building: L (Classrooms 500, 502, 504 & 506)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VINYL FLOOR TILE (RED) & ADHESIVE	2	1-5%	70 S	MIGRANT EDUCATION OFFICE	(1) (4)	N
S	CEILING PLASTER	8	1-5%	175 S	MIGRANT EDUCATION OFFICE'S & GIRL'S RESTROOM	(1) (4)	N
T	PIPE WRAP STRAIGHT	26	40-45%	UNDETERMINED	CLASSROOM 502	(1) VISIBLE IN STORAGE @ MISSING 12" CEILING TILES	Y
T	PIPE WRAP STRAIGHT	95	ASSUMED POSITIVE	UNDETERMINED	CLASSROOM 506	(11) UNABLE TO LOCATE MATERIAL	Y
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	640 S	EXTERIOR OF UNIT	(1) (4)	N
M	12" VINYL FLOOR TILE (LIGHT GRAY /BEIGE) & ADHESIVE	98	ASSUMED POSITIVE	4,000 S	CLASSROOMS 500, 502, 504, & 506	(1) (4) ROOM 506 HAS MISSING TILES AT DOOR	N
M	2' X 4' CEILING PANELS - FISSURE PATTERN	116	ASSUMED POSITIVE	4,000 S	ALL CLASSROOMS	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	500 S	ALL CLASSROOMS	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAYS	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	1,000 S	ALL CLASSROOMS AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: L (Classrooms 500, 502, 504 & 506) CONTINUED

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	12" ACOUSTIC CEILING TILE	256	ASSUMED POSITIVE	50 S	ROOM 502 STORAGE 2	(1)	N
S	PLASTER	257	ASSUMED POSITIVE	300 S	ROOM 502 STORAGE 1 & 2	(1)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous:(11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: J (Maintenance)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
T	BOILER REFRACTORY	100	ASSUMED POSITIVE	UNDETE-RMINED	TWO BOILER UNITS	(1) (4)	Y

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE**

**HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: H & I (Classrooms 501A&B, 503 & 505)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	12" ACOUSTIC CEILING TILE	17	NONE DETECTED	4,300 S	WOOD SHOP, DURST THEATER, MUSIC CLASSROOM, & PRACTICE CLASSROOMS 1-5	(13) SAMPLE HMS-CJH-17 COLLECTED IN 1988. DURST THEATER & MUSIC CLASSROOM ARE SAME AREA	N/A
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	100 S	EXTERIOR OF UNIT AT WINDOWS	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	97	ASSUMED POSITIVE	2,200 S	COMPUTER ROOM, MATERIAL STORAGE, STORAGE, & STAFF OFFICE, DURST THEATER, OFFICES, MUSIC CLASSROOM, AND PRACTICE CLASSROOMS 1-5	(1) (4) DURST THEATER & MUSIC CLASSROOM ARE SAME AREA	N
S	CEILING PLASTER	117	ASSUMED POSITIVE	700 S	OFFICES, STORAGE ROOMS, AND WOODSHOP CLASSROOM	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	200 S	CLASSROOM	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	1,500 S	COVERED WALKWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous:(11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**



**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District  
School: Chico Junior High School

Inspector:  
Building: A (Main Office)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	2,500 S	LIBRARY	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY) & ADHESIVE	97	ASSUMED POSITIVE	600 S	ADMINISTRATION OFFICES, HALLWAY, AND LIBRARY	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	101	ASSUMED POSITIVE	14,100 S	THROUGHOUT UNIT AND LIBRARY	(1) (4) NEW DRYWALL WAS PUT INTO THIS UNIT DURING THE RENOVATION IN THE SUMMER OF 2000.	N
S	DRYWALL TEXTURE	118	ASSUMED POSITIVE	14,100 S	THROUGHOUT UNIT	(1) (4)	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	800 S	THROUGHOUT UNIT	(1) (4)	N
M	12" VINYL FLOOR TILE (DARK GRAY) & ADHESIVE	251	ASSUMED POSITIVE	100 S	ROOM 908	(1) (4)	N
M	CARPET ADHESIVE	252	ASSUMED POSITIVE	4,000 S	OFFICES & LIBRARY	(1) (4)	N
M	12" VINYL FLOOR TILE (LIGHT GRAY) & ADHESIVE	253	ASSUMED POSITIVE	700 S	HALLWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous(11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District  
School: Chico Junior High School

Inspector:  
Building: B (Classrooms 201-211)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	700 S	EXTERIOR OF UNIT AT WINDOWS	(1) (4)	N
M	2' X 4' CEILING PANELS - FISSURE PATTERN	99	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	12" VINYL FLOOR TILE (LIGHT GRAY) & ADHESIVE	102	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	BASE COVE ADHESIVE	250	ASSUMED POSITIVE	720 S	THROUGHOUT CLASSROOMS	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	2,000 S	CLASSROOMS AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: C (Classrooms 301-311)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	CEMENTITIOUS TRANSITE PANELS	96	ASSUMED POSITIVE	700 S	EXTERIOR OF UNIT	(1) (4)	N
M	2' X 4' CEILING PANELS - FISSURE PATTERN	99	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	12" VINYL FLOOR TILE (LIGHT GREY MOTTLED) & ADHESIVE	103	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	720 S	THROUGHOUT CLASSROOMS	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	2,000 S	CLASSROOMS AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

**CONDITION CODE**

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: D (Classrooms 401, 403, 405, 407 & 409)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	TRANSITE PANELS	96	ASSUMED POSITIVE	700 S	EXTERIOR OF UNIT	(1) (4)	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	99	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	12" VINYL FLOOR TILE (LIGHT GREY MOTTLED) & ADHESIVE	103	ASSUMED POSITIVE	4,800 S	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000.	N
M	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	650 S	THROUGHOUT CLASSROOMS	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	250 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL	255	ASSUMED POSITIVE	1,200 S	CLASSROOMS AT LOWER NORTH WALLS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)  
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected  
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted  
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: E (Gymnasium)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	12" CEILING TILE	119	ASSUMED POSITIVE	5,000 S	GYM	(1) (4)	N
S	STUCCO	254	ASSUMED POSITIVE	2,200 S	CORRIDOR	(1) (4)	N
S	TEXTURE ON CONCRETE & PLASTER WALLS	300	ASSUMED POSITIVE	1,800 S	COVERED WALKWAY	(1) (4)	N
M	DRYWALL & JOINT COMPOUND	301	ASSUMED POSITIVE	400 S	RESTROOMS	(1) (4)	N
S	TEXTURE ON DRYWALL	302	ASSUMED POSITIVE	400 S	RESTROOMS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: F (Locker Rooms)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VINYL FLOOR TILE (GREEN) & ADHESIVE	5	1-5%	UNDETE R-MINED	CLASSROOM 18 STORAGE	(12) UNABLE TO LOCATE CLASSROOM 18	N
T	PIPE WRAP	105	ASSUMED POSITIVE	UNDETE R-MINED	IN CEILING PIPE CHASE	(10)	Y
S	STUCCO	254	ASSUMED POSITIVE	800 S	COVERED WALKWAY	(1) (4)	N
S	PLASTER	260	ASSUMED POSITIVE	5,000 S	THROUGHOUT UNIT	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**

**SIX MONTH SURVEILLANCE  
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Chico Junior High School

Building: Q (Main Corridor)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	PLASTER	8	1-5%	10,000 S	CEILINGS & WALLS	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY) & ADHESIVE	97	ASSUMED POSITIVE	500 S	THROUGHOUT CORRIDOR AT BORDERS	(1) (4)	N
M	12" VINYL FLOOR TILE (LIGHT GRAY) & ADHESIVE	253	ASSUMED POSITIVE	3,000 S	THROUGHOUT CORRIDOR	(1) (4)	N
M	COVE BASE ADHESIVE	261	ASSUMED POSITIVE	1,000 S	THROUGHOUT CORRIDOR	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Chico JHS\Chico JHS- 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

**CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS**