

# RECORD OF FRIABLE AND NON-FRIABLE ACM (FORM B)

THREE-YEAR	REINSPECTION
------------	--------------

				CDS CODE 04-61424-0437558	
SCHOOL PLEASANT VALLEY HI	IGH SCHOOL			SCHOOL PHONE NUMBER (530) 879-5101	
ADDRESS 1475 EAST AVENUE	(NUMBER)	(STREET)	(CITY) CHICO, CA	(ZIP) 95926	

#### -IMPORTANT-

Each building and functional space with friable ACBM or friable assumed ACBM listed on this form requires completion of <u>FORM C</u> (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACBM OR FRIABLE ASSUMED ACBM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

		CHI	ECK OI	NE		CHEC	K ONE	
LINE	BUILDING NAME & FUNCTIONAL SPACE	SUR-			AC	вм	ASSUME	D ACBM
	(Indicate Address if Different From Above)	FACING	TSI	MISC	FRIABLE	NON- FRIABLE	FRIABLE	NON- FRIABLE
1.	A - ADMINISTRATION OFFICE NO ACBM							
2.	B - ROOMS 1-10	х		х				х
3.	C - ROOMS 1-7	х		х				х
4.	ATTIC AREA		x		x		х	
5.	D - ROOMS 1-5			х		Х		х
6.	ATTIC AREA		x		x		х	
7.	E - ROOMS 1-3	х		х		Х		х
8.	ATTIC AREA OF CLASSROOM 3		x		x			
9.	F - GIRL'S (938) & BOY'S (943) LOCKER ROOMS	х		х		х		х
10.	ATTIC (ACCESS IN STORE ROOM)		х		x			
11.	G - EAST GYM (933)	х		х		х		х
12.	H - WEST GYM (948)	х				Х		
13.	I - NEW BUILDING UNDER CONSTRUCTION							
14.	J- J3-J9 CERTIFICATION LETTER ON FILE							
15.	K - P.E. MAT ROOM NO SUSPECT ACBM							
16.	L - LIBRARY - CONSTRUCTED IN 1994 CERTIFICATION LETTER ON FILE							

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley Form B.wpd

# RECORD OF FRIABLE AND NON-FRIABLE ACM (FORM B)

				CDS CODE 04-61424-0437558	
SCHOOL PLEASANT VALLEY H	GH SCHOOL			SCHOOL PHONE NUMBER (530) 879-5101	
ADDRESS 1475 EAST AVENUE	(NUMBER)	(STREET)	(CITY) CHICO, CA	(ZIP) 95926	

#### -IMPORTANT-

Each building and functional space with friable ACBM or friable assumed ACBM listed on this form requires completion of <u>FORM C</u> (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACBM OR FRIABLE ASSUMED ACBM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

		СНІ	ECK OI	NE		CHECK ONE			
LINE	BUILDING NAME & FUNCTIONAL SPACE	SUR-			AC	ВМ	ASSUMED ACBM		
	(Indicate Address if Different From Above)	FACING	TSI	MISC	FRIABLE	NON- FRIABLE	FRIABLE	NON- FRIABLE	
1.	M - ROOMS 1-11 CERTIFICATION LETTER ON FILE								
2.	O - ROOMS 1-6 CERTIFICATION LETTER ON FILE								
3.	P - ROOMS 1-4 CERTIFICATION LETTER ON FILE								
4.	R - P.E. WEIGHT ROOM (957A) NO SUSPECT ACBM								
5.	S - ROOMS 1-8 CERTIFICATION LETTER ON FILE								
6.	T - STUDENT STORE - VENDING MACHINE CERTIFICATION LETTER ON FILE								
7.	T1 - BUTTE COE PORTABLE DISTRICT MUST CERTIFY								
8.	U -MAINTENANCE & GROUNDS NO SUSPECT ACBM								
9.	V - ROOMS 1 & 928-932	х		х				х	
10.	PERFORMING ARTS CENTER DISTRICT MUST CERTIFY								

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley Form B.wpd

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

District: Chico Unified School District

School: Pleasant Valley High School

Inspector: Blake Howes

Building: A	- Administration	Office
-------------	------------------	--------

Date of Inspection: August 5, 2013

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	on: Code & Comments	Friable Yes/No
S	PLASTER	9	NONE DETECTED	1,900 S	COVERED WALK (OUTDOORS)	(13)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	N/A
М	1' X 1' CEILING PANELS FISSURE PATTERN	94	NONE DETECTED	300 S	PRINCIPAL'S OFFICE, ASSISTANT PRINCIPAL'S OFFICE, NURSE'S STATION, AND COUNSELING ROOM	(13)	CERTIFICATION LETTER ON FILE. SAMPLE II COLLECTED ON 3-21-95.	N/A
М	DRYWALL JOINT COMPOUND	95	NONE DETECTED	250 S	STAFF RESTROOMS	(13)	CERTIFICATION LETTER ON FILE. SAMPLE EE & FF COLLECTED ON 3-21-95.	N/A
М	2' X 2' CEILING PANELS FISSURE PATTERN	96	CERTIFIED NON- ASBESTOS	1,000 S	ATTENDANCE AREA CEILING	(13)	CERTIFICATION LETTER ON FILE.	N/A
М	2' X 4' CEILING PANELS FISSURE PATTERN	97	NONE DETECTED	650 S	STAFF ROOM CEILING (909)	(13)	CERTIFICATION LETTER ON FILE. SAMPLE GG COLLECTED ON 3-21-95.	N/A
М	12" VINYL FLOOR TILE (WHITE/BLUE) & ADHESIVE	100	CERTIFIED NON- ASBESTOS	5,000 S	ATTENDANCE AREA, STAFF ROOM (909), ROOM 1, AND HALLWAYS AROUND ATTENDANCE AREA	(13)	CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

District: Chico Unified School District

School: Pleasant Valley High School

Inspector: Blake Howes

Date of Inspection: August 5, 2013

Building: B - Rooms 1-10

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	9	NONE DETECTED	1,900 S	COVERED WALK (OUTDOORS)	<ul> <li>(13) SAMPLES HMS-PVH-09A, B, &amp; C, COLLECTED ON 3-30-88. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.</li> </ul>	N/A
М	9" VINYL FLOOR TILE (TAN/BROWN) & ADHESIVE	92	ASSUMED POSITIVE	8,500 S	CLASSROOMS 1-10	(1) (4)	Ν
М	1' X 3' CEILING PANELS	93	NONE DETECTED	4,550 S	CLASSROOMS 2-6, 9, & 10	(13) CUSD SAMPLED ON 3-22-05.	N/A
м	1' X 1' CEILING PANELS	94	NONE DETECTED	1,950 S	CLASSROOMS 1, 7, & 8	(13)	N/A
м	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	800 S	CLASSROOMS 1-10	(1)	Ν

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired<br/>Miscellaneous:(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & Restricted(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

District: Chico Unified School District

School: Pleasant Valley High School

Date of Inspection: August 5, 2013

Inspector: Blake Howes

Building: C - Rooms 1-7

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	on: Code & Comments	Friable Yes/No
т	PIPE WRAP CORNER	5	10-15%	23 L	ATTIC AREA	(11)		Y
S	PLASTER	8	NONE DETECTED	250 S	STUDENT RESTROOMS (924 & 925)	(13)	STUDENT RESTROOMS FKA ROOM 18. SAMPLE HMS-PVH-08C COLLECTED ON 3-30-88.	N/A
S	PLASTER	9	NONE DETECTED	10,000 S	COVERED WALK (OUTDOORS)	(13)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	N/A
М	9" VINYL FLOOR TILE (TAN/BROWN) & ADHESIVE	92	ASSUMED POSITIVE	6,300 S	CLASSROOMS 1-7	(1) (4)		Ν
М	1' X 3' CEILING PANELS	93	NONE DETECTED	6,300 S	CLASSROOMS 1-7	(13)	SAMPLED BY CUSD ON 3-22-05.	N/A
М	MOLDED BLACK TABLE TOPS	99	ASSUMED POSITIVE	MULTIPLE TABLES	CLASSROOM 3	(1) (4)		Ν
т	WHITE DUCT TAPE	151	ASSUMED POSITIVE	150 L	ATTIC	(11)	THIS MATERIAL WAS PREVIOUSLY DESIGNATED FRIABLE.	Ν

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

District: Chico Unified School District

School: Pleasant Valley High School

Date of Inspection: August 5, 2013

Inspector: Blake Howes

Building: D - Rooms 1-5

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition	n: Code & Comments	Friable Yes/No
т	PIPE WRAP CORNER	5	1-10%	38 JOINTS	ATTIC AREA	(11)		Y
S	PLASTER	9	NONE DETECTED	1,900 S	COVERED WALK (OUTDOORS)	(13)		N/A
М	12" VINYL FLOOR TILE (WHITE/BLUE) & ADHESIVE	14	TRACE	925 S	CLASSROOM 5	(1) (4)	SAMPLE HMS-PVH-14 COLLECTED ON 3-30-88.	N
М	9" VINYL FLOOR TILE (BROWN/WHITE) & ADHESIVE	91	ASSUMED POSITIVE	3,500 S	CLASSROOMS 1-3, CLASSROOM 4- TEACHER'S ROOM AND 5.	(1) (4) (11)	COVERED WITH 12" VINYL FLOOR TILE WHITE/BLUE IN CLASSROOM 5.	N
М	1' X 3' CEILING PANELS	93	NONE DETECTED	3,500 S	CLASSROOMS 1-5	(13)	SAMPLE COLLECTED BY CUSD ON 3-22-05.	N/A
Т	DUCT TAPE WHITE	150	ASSUMED POSITIVE	150 L	ATTIC	(11)		Y
М	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	550 S	THROUGHOUT CLASSROOMS	(1) (4)		N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired<br/>Miscellaneous:(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & Restricted(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

## CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

# CONDITIC

District: Chico Unified School District

School: Pleasant Valley High School

Date of Inspection: August 5, 2013

Inspector: Blake Howes

Building: E - Rooms 1-3

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	n: Code & Comments	Friable Yes/No
Т	PIPEWRAP FITTING	5	1-10%	10 L	ATTIC AREA OF CLASSROOM 3	(1) (4)		Y
S	PLASTER	9	1-5%	1,100 S	COVERED WALK (OUTSIDE)	(1) (4)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	Ν
М	2' X 4' CEILING PANELS	12	NONE DETECTED	812 S	DRAFTING ROOM 2	(13)	SAMPLE HMS-PVH-12 COLLECTED ON 3-30- 88.	N/A
М	12" VINYL FLOOR TILE (OFF-WHITE) & ADHESIVE	15	1-5%	812 S	DRAFTING ROOM 2	(12)	COULD NOT LOCATE.	Ν
М	12" VINYL FLOOR TILE (WHITE/BLACK0 & ADHESIVE	90	ASSUMED POSITIVE	650 S	CLASSROOM 2	(1) (4)		Ν
м	CEMENTITIOUS TRANSITE WALLBOARD	98	ASSUMED POSITIVE	350 S	CLASSROOM 1 - METAL SHOP	(1) (4)		Ν
м	DRYWALL & TEXTURE	101	ASSUMED POSITIVE	2,700 S	CLASSROOMS 1-3	(1) (4)		Ν

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

District: Chico Unified School District

Date of Inspection: August 5, 2013

Inspector: Blake Howes

School: Pleasant Valley High School

Buildings: F - Girl's (938) & Boy's (943) Locker Rooms

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	n: Code & Comments	Friable Yes/No
S	PLASTER	8	NONE DETECTED	3,200 S	GIRL'S LOCKER ROOM (938), BOY'S LOCKER ROOM (943), AND RESTROOMS (940 & 942)	(13)	SAMPLES HMS-PVH-08D, 08E, & 08G COLLECTED ON 03-30-88.	N/A
S	PLASTER	9	1-5%	2,500 S	COVERED WALK (OUTDOORS)	(1) (4)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	Ν
т	DEBRIS & PIPEWRAP CORNER	18	15-20%	DEBRIS 200 S 23 JOINTS	ATTIC (ACCESS IN STOREROOM)	(11)	COULD NOT ACCESS THIS AREA.	Y
М	DRYWALL	87	ASSUMED POSITIVE	300 S	SNACK BAR (941)	(1) (4)		N
М	12" VINYL FLOOR TILE (WHITE/BROWN) & ADHESIVE	88	ASSUMED POSITIVE	600 S	BOY'S AND GIRL'S LOCKER ROOM OFFICES	(1) (4)		N
М	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	100 S	BOY'S AND GIRL'S LOCKER ROOM OFFICES	(1) (4)		N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

District: Chico Unified School District

School: Pleasant Valley High School

Buildings: G - East Gym (933)

Inspector: Blake Howes

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	9	1-5%	2,500 S	COVERED WALK (OUTDOORS)	<ul> <li>(1) (4) SAMPLES HMS-PVH-09A&amp;B COLLECTED 3-30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.</li> </ul>	Z
M	12" ACOUSTIC CEILING TILE	89	ASSUMED POSITIVE	3,500 S	EAST GYM (933)	(1) (4)	Ν

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired<br/>Miscellaneous:(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & Restricted(11) Inaccessible, no inspection data(12) Other (Explain under comments)

## CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

District: Chico Unified School District

School: Pleasant Valley High School

Building: H - West Gym (948)

Inspector: Blake Howes

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	9	1-5%	355 S	COVERED WALK (OUTDOORS)	<ul> <li>(1) (4) SAMPLES HMS-PVH-09A&amp;B COLLECTED 3-30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.</li> </ul>	Ν

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

### CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

#### CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

District: Chico Unified School District

School: Pleasant Valley High School

Date of Inspection: August 5, 2013

Inspector: Blake Howes

Building: J - J3-J7

Material Class	Material	Homo. Mat. #	% Asb.	Fť²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
М	DRYWALL & JOINT COMPOUND	77	CERTIFIED NON- ASBESTOS	3,500 S	CLASSROOMS J1-J7	(1) (4)	N/A
М	2' X 4' CEILING PANELS	78	CERTIFIED NON- ASBESTOS	6,300 S	CLASSROOMS J1-J7	(1) (4)	N/A
М	12" VINYL FLOOR TILE & ADHESIVE	79	CERTIFIED NON- ASBESTOS	6,300 S	CLASSROOMS J1-J7	(1) (4)	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

District: Chico Unified School District

School: Pleasant Valley High School

Inspector: Blake Howes Building: M - Rooms 1-12

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
М	DRYWALL	75	CERTIFIED NON- ASBESTOS	1,000 S	ELECTRICAL ROOM AND BOOKS	(13) CERTIFICATION LETTER ON FILE.	N/A
М	2' X 4' CEILING PANELS	76	CERTIFIED NON- ASBESTOS	10,000 S	CLASSROOMS 1-11 AND TEACHERS ROOM	(13) CERTIFICATION LETTER ON FILE.	N/A
М	12" VINYL FLOOR TILE (WHITE/GRAY) & ADHESIVE	80	CERTIFIED NON- ASBESTOS	600 S	CLASSROOMS 1-11, ELECTRICAL ROOM, BOOKS, AND TEACHER ROOM	(13) CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:	(1) Good	(2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition:	(4) No	(5) Yes (If Yes, explain under comments)
<u>Abated:</u>	(6) Repaired	(7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous:	(11) Inaccessit	le, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

## CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

District: Chico Unified School District

School: Pleasant Valley High School

Building: O - Rooms 1-6

Inspector: Blake Howes

laterial lass	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
Μ	2' X 4' CEILING PANELS	81	CERTIFIED NON- ASBESTOS	3,500 S	CLASSROOMS 1A, 1B, AND 2-6	(13) CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

### CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

## CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

District: Chico Unified School District

School: Pleasant Valley High School

Building: P - Rooms 1-4

Inspector: Blake Howes

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
М	2' X 4' CEILING PANELS	81	CERTIFIED NON- ASBESTOS	3,600	CLASSROOMS 1-4	(13) CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

## CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

District: Chico Unified School District

School: Pleasant Valley High School

Inspector: Blake Howes

Date of Inspection: August 5, 2013

Building: S - Rooms 1-8

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	82	CERTIFIED NON- ASBESTOS	500 S	CUSTODIAN OFFICE (963)	(13) CERTIFICATION LETTER ON FILE	N/A
М	12" VINYL FLOOR TILE & ADHESIVE	83	CERTIFIED NON- ASBESTOS	500 S	CUSTODIAN OFFICE (963)	(13) CERTIFICATION LETTER ON FILE	N/A
М	DRYWALL	84	CERTIFIED NON- ASBESTOS	1,200 S	STAFF RESTROOMS (964, 964, 960, & 961) AND GIRL'S & BOY'S RESTROOM (962)	(13) CERTIFICATION LETTER ON FILE	N/A
М	2' X 4' CEILING PANELS	85	CERTIFIED NON- ASBESTOS	8,000 S	CLASSROOMS 1-8	(13) CERTIFICATION LETTER ON FILE	N/A
М	12" VINYL FLOOR TILE (WHITE/GRAY) & ADHESIVE	86	CERTIFIED NON- ASBESTOS	8,000 S	CLASSROOMS 1-8	(13) CERTIFICATION LETTER ON FILE	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

### CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

District: Chico Unified School District

School: Pleasant Valley High School

Building: L - Library

Inspector: Blake Howes

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
						(13) THE LIBRARY WAS CONSTRUCTED IN 1994. CERTIFICATION LETTER ON FILE DATED DECEMBER 27, 1994.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

## CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

Date of Inspection: August 5, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Pleasant Valley High School

Building: T - Student Store - Vending Machines

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
М	DRYWALL & JOINT COMPOUND	72	CERTIFIED NON- ASBESTOS	320 S	STUDENT STORE (937)	(13) CERTIFICATION LETTER ON FILE.	N/A
S	PLASTER	73	CERTIFIED NON- ASBESTOS	225 S	VENDING AREA	(13) CERTIFICATION LETTER ON FILE.	N/A
М	SHEET VINYL FLOORING (YELLOW/BROWN) & ADHESIVE	74	CERTIFIED NON- ASBESTOS	550 S	VENDING AREA AND STUDENT STORE (937)	(13) CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

## CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

District: Chico Unified School District

Date of Inspection: August 5, 2013

Inspector: Blake Howes

School: Pleasant Valley High School

Building: V - Rooms 1 & 928-932

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	n: Code & Comments	Friable Yes/No
S	PLASTER	9	NONE DETECTED	600 S	COVERED WALKWAYS	(13)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	Ν
М	12" ACOUSTIC CEILING TILE	72	ASSUMED POSITIVE	1,200 S	NORTH & SOUTH ENDS OF VALHALLA CEILING (929)	(1) (12)	THE DISTRICT MUST CERTIFY AS NON ASBESTOS CONTAINING BUILDING MATERIAL.	N
м	9" VINYL FLOOR TILE (WHITE/ BROWN) & ADHESIVE	73	ASSUMED POSITIVE	5,000 S	VALHALLA AREA (929) AND ROOM 1 (MUSIC ROOM)	(1) (12)	THE DISTRICT MUST CERTIFY AS NON ASBESTOS CONTAINING BUILDING MATERIAL.	N
S	PLASTER	74	ASSUMED POSITIVE	5,800 S	GIRL'S & BOY'S RESTROOMS (930 & 932), VALHALLA CEILING (929), AND KITCHEN WALLS (928)	(1) (12)	THE DISTRICT MUST CERTIFY AS NON ASBESTOS CONTAINING BUILDING MATERIAL.	N
м	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	700 S	THROUGHOUT BUILDING	(1) (4)		N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley HMR.wpd

### CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & Restricted(11) Inaccessible, no inspection data(12) Other (Explain under comments)

District: Chico Unified School District

School: Pleasant Valley High School

Building & Location(s): C - Rooms 1-7, Attic Area

ECG-

% Asbestos-10-15%

Homogeneous Mat. #5

Inspector: Blake Howes

Date: August 5, 2013

Material description: Pipe Wrap Corner

Total amount of material this location: 23 L

Amount of friable material this location: 23 L

Damage	Local	Distributed	Damaged	0%
Type of Damage	Air Erosion	Water	Flaking	
	Deterioration	Physical	Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR	DIST	URBA	NCE	RESPONSE ACTIO	NS	PREVENTIVE MEASURES		
	Н	М	L	Isolate/Restrict X F		Fix leaks		
Accessibility			х	Repair/Cleanup		Prevent water contact	х	
Vibration			х	Enclose		Do not drill, cut, sand, or grind	х	
Air Erosion			х	Remove	x	Do not affix signs		
Water			х	Encapsulate		Avoid contact	х	
Occupancy			х	O & M	х			

	As	sessme	nt of Ma	aterial C	ondition				
	ntly Damaged Poor)			amageo (Fair)	Not damaged (Good)				
[						x			
Potential Damage:	High	High	Mod	Low		High	Mod	Low	
Hazard Ranking:	1	2	3	4		5	6	7	
								х	

Comments & Observations:

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley Assmt #5 Unit C .wpd

District: Chico Unified School District

School: Pleasant Valley High School

Building & Location(s): D - Rooms 1-5, Attic Area

ECG-

% Asbestos-1-10%

Date: August 5, 2013

Inspector: Blake Howes

Homogeneous Mat. #5

Material description: Pipe Wrap Corner

Total amount of material this location: 38 Joints

Amount of friable material this location: 38 Joints

Damage	Local	Distributed	Damaged	0%
Type of Damage	Air Erosion	Water	Flaking	
	Deterioration	Physical	Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR	DIST	URBA	NCE	RESPONSE ACTIO	NS	PREVENTIVE MEASURE	S
	н	м	L	Isolate/Restrict Fi		Fix leaks	
Accessibility			х	Repair/Cleanup		Prevent water contact	
Vibration			х	Enclose		Do not drill, cut, sand, or grind	
Air Erosion			х	Remove		Do not affix signs	
Water			х	Encapsulate		Avoid contact	Х
Occupancy			х	O & M	х		

		As	sessme	nt of Ma	aterial C	ondition						
Signific	ignificantly Damaged (Poor)			Damaged (Fair)					Not damaged (Good)			
				x								
Potential Damage:	High		High	Mod	Low		High	Mod	Low			
Hazard Ranking:	1		2	3	4		5	6	7	_		
									х			

Comments & Observations:

 District:
 Chico Unified School District
 Date: August 5, 2013

 School:
 Pleasant Valley High School
 Inspector: Blake Howes

 Building & Location(s):
 E - Rooms 1-3, Attic Area of Classroom 3
 Homogeneous Mat. #5

 ECG % Asbestos-1-10%
 Homogeneous Mat. #5

Material description: Pipe Wrap Corner

Total amount of material this location: 10 L

Amount of friable material this location: 10 L

Damage	Local	Distributed	Damaged	0%
Type of Damage	Air Erosion	Water	Flaking	
	Deterioration	Physical	Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR	DIST	URBA	NCE	RESPONSE ACTIO	NS	PREVENTIVE MEASURES		
	Н	М	L	Isolate/Restrict X Fi		Fix leaks		
Accessibility	х			Repair/Cleanup		Prevent water contact	х	
Vibration		х		Enclose		Do not drill, cut, sand, or grind	х	
Air Erosion			х	Remove	x	Do not affix signs		
Water			х	Encapsulate		Avoid contact	х	
Occupancy	х			O & M	х			

Signific	antly Da (Poor)	-	sessme	C	<b>aterial C</b> Damageo (Fair)		Not damaged (Good)			
						x				
Potential Damage:	High		High	Mod	Low		High	Mod	Low	
Hazard Ranking:	1		2	3	4		5	6	7	
								х		

Comments & Observations:

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley Assmt#5-Unit E.wpd

District: Chico Unified School District

School: Pleasant Valley High School

Building & Location(s): D - Rooms 1-5, Attic

ECG-

% Asbestos-Assumed

Homogeneous Mat. #150

Date: August 5, 2013

Inspector: Blake Howes

Material description: White Duct Tape

Total amount of material this location: 150 L

Amount of friable material this location: 150 L

Damage	Local	Distributed	Damaged	0%
Type of Damage	Air Erosion	Water	Flaking	
	Deterioration	Physical	Delamination	

Probable cause(s) of damage: Physical Damage

POTENTIAL FOR	DIST	URBA	NCE	RESPONSE ACTIO	NS	PREVENTIVE MEASURES		
	н	М	L	Isolate/Restrict F		Fix leaks		
Accessibility			х	Repair/Cleanup		Prevent water contact		
Vibration			х	Enclose		Do not drill, cut, sand, or grind		
Air Erosion			х	Remove		Do not affix signs		
Water			х	Encapsulate	х	Avoid contact	х	
Occupancy			х	O & M				

		Assessment of Material Condition										
Signific	antly Da	maged		C	amageo	1	Not damaged					
	(Poor)			(	(Fair)			(0	Good)			
							x					
Potential Damage:	High		High	Mod	Low		High	Mod	Low			
Hazard Ranking:	1		2	3	4		5	6	7	-		
									x			

Comments & Observations:

District:Chico Unified School DistrictDate: August 5, 2013School:Pleasant Valley High SchoolInspector: Blake HowesBuilding & Location(s):F - Girl's (938) & Boy's (943) Locker Rooms, Attic (Access in Storeroom)ECG-% Asbestos-15-20%Homogeneous Mat. #18

Material description: Debris & Pipe Wrap Corner

Total amount of material this location:

200 S (Debris) Amount of friable material this location:200 S (Debris)23 Joints23 Joints

Damage	Local	Distributed	Damaged	0%
Type of Damage	Air Erosion	Water	Flaking	
	Deterioration	Physical	Delamination	


Probable cause(s) of damage: Physical Damage

POTENTIAL FOR	DIST	URBA	NCE	RESPONSE ACTIO	NS	PREVENTIVE MEASURE	S
	Н	М	L	Isolate/Restrict		Fix leaks	
Accessibility			х	Repair/Cleanup		Prevent water contact	
Vibration			х	Enclose		Do not drill, cut, sand, or grind	
Air Erosion			х	Remove		Do not affix signs	
Water			х	Encapsulate		Avoid contact	х
Occupancy			х	O & M	х		

		As	sessme	nt of Ma	aterial C	ondition					
Signific	antly Da	maged	Damaged					Not damaged			
	(Poor)			(	(Fair)			(0	Good)		
						x					
Potential Damage:	High		High	Mod	Low		High	Mod	Low		
Hazard Ranking:	1		2	3	4		5	6	7	-	
									x		

Comments & Observations:

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley Assmt #18 -Unit F.wpd

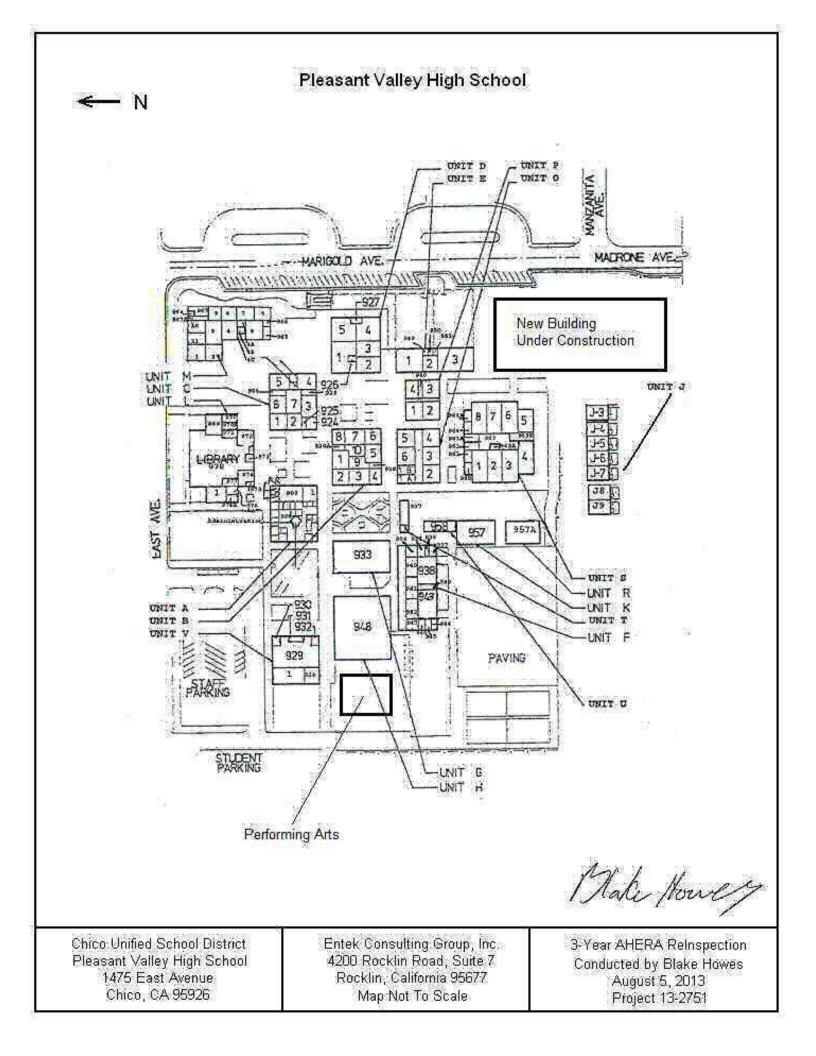

# SIX-MONTH SURVEILLANCE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: A - Administration Office

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	on: Code & Comments	Friable Yes/No
S	PLASTER	9	NONE DETECTED	1,900 S	COVERED WALK (OUTDOORS)	(13)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	N/A
М	1' X 1' CEILING PANELS FISSURE PATTERN	94	NONE DETECTED	300 S	PRINCIPAL'S OFFICE, ASSISTANT PRINCIPAL'S OFFICE, NURSE'S STATION, AND COUNSELING ROOM	(13)	CERTIFICATION LETTER ON FILE. SAMPLE II COLLECTED ON 3-21-95.	N/A
М	DRYWALL JOINT COMPOUND	95	NONE DETECTED	250 S	STAFF RESTROOMS	(13)	CERTIFICATION LETTER ON FILE. SAMPLE EE & FF COLLECTED ON 3-21-95.	N/A
М	2' X 2' CEILING PANELS FISSURE PATTERN	96	CERTIFIED NON- ASBESTOS	1,000 S	ATTENDANCE AREA CEILING	(13)	CERTIFICATION LETTER ON FILE.	N/A
М	2' X 4' CEILING PANELS FISSURE PATTERN	97	NONE DETECTED	650 S	STAFF ROOM CEILING (909)	(13)	CERTIFICATION LETTER ON FILE. SAMPLE GG COLLECTED ON 3-21-95.	N/A
М	12" VINYL FLOOR TILE (WHITE/BLUE) & ADHESIVE	100	CERTIFIED NON- ASBESTOS	5,000 S	ATTENDANCE AREA, STAFF ROOM (909), ROOM 1, AND HALLWAYS AROUND ATTENDANCE AREA	(13)	CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: B - Rooms 1-10

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	9	NONE DETECTED	1,900 S	COVERED WALK (OUTDOORS)	<ul> <li>(13) SAMPLES HMS-PVH-09A, B, &amp; C, COLLECTED ON 3-30-88. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.</li> </ul>	N/A
М	9" VINYL FLOOR TILE (TAN/BROWN) & ADHESIVE	92	ASSUMED POSITIVE	8,500 S	CLASSROOMS 1-10	(1) (4)	Ν
М	1' X 3' CEILING PANELS	93	NONE DETECTED	4,550 S	CLASSROOMS 2-6, 9, & 10	(13) CUSD SAMPLED ON 3-22-05.	N/A
М	1' X 1' CEILING PANELS	94	NONE DETECTED	1,950 S	CLASSROOMS 1, 7, & 8	(13)	N/A
М	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	800 S	CLASSROOMS 1-10	(1)	Ν

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: C - Rooms 1-7

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	on: Code & Comments	Friable Yes/No
Т	PIPE WRAP CORNER	5	10-15%	23 L	ATTIC AREA	(11)		Y
s	PLASTER	8	NONE DETECTED	250 S	STUDENT RESTROOMS (924 & 925)	(13)	STUDENT RESTROOMS FKA ROOM 18. SAMPLE HMS-PVH-08C COLLECTED ON 3-30-88.	N/A
S	PLASTER	9	NONE DETECTED	10,000 S	COVERED WALK (OUTDOORS)	(13)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	N/A
М	9" VINYL FLOOR TILE (TAN/BROWN) & ADHESIVE	92	ASSUMED POSITIVE	6,300 S	CLASSROOMS 1-7	(1) (4)		N
М	1' X 3' CEILING PANELS	93	NONE DETECTED	6,300 S	CLASSROOMS 1-7	(13)	SAMPLED BY CUSD ON 3-22-05.	N/A
М	MOLDED BLACK TABLE TOPS	99	ASSUMED POSITIVE	MULTIPLE TABLES	CLASSROOM 3	(1) (4)		N
Т	WHITE DUCT TAPE	151	ASSUMED POSITIVE	150 L	ATTIC	(11)	THIS MATERIAL WAS PREVIOUSLY DESIGNATED FRIABLE.	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: D - Rooms 1-5

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
т	PIPE WRAP CORNER	5	1-10%	38 JOINTS	ATTIC AREA	(11)	Y
S	PLASTER	9	NONE DETECTED	1,900 S	COVERED WALK (OUTDOORS)	(13)	N/A
М	12" VINYL FLOOR TILE (WHITE/BLUE) & ADHESIVE	14	TRACE	925 S	CLASSROOM 5	(1) (4) SAMPLE HMS-PVH-14 COLLECTED ON 3-30-88.	Ν
М	9" VINYL FLOOR TILE (BROWN/WHITE) & ADHESIVE	91	ASSUMED POSITIVE	3,500 S	CLASSROOMS 1-3, CLASSROOM 4- TEACHER'S ROOM AND 5.	(1) (4) (11) COVERED WITH 12" VINYL FLOOR TILE WHITE/BLUE IN CLASSROOM 5.	N
М	1' X 3' CEILING PANELS	93	NONE DETECTED	3,500 S	CLASSROOMS 1-5	(13) SAMPLE COLLECTED BY CUSD ON 3-22-05.	N/A
т	DUCT TAPE WHITE	150	ASSUMED POSITIVE	150 L	ATTIC	(11)	Y
М	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	550 S	THROUGHOUT CLASSROOMS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: E - Rooms 1-3

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	n: Code & Comments	Friable Yes/No
Т	PIPEWRAP FITTING	5	1-10%	10 L	ATTIC AREA OF CLASSROOM 3	(1) (4)		Y
S	PLASTER	9	1-5%	1,100 S	COVERED WALK (OUTSIDE)	(1) (4)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	Ν
М	2' X 4' CEILING PANELS	12	NONE DETECTED	812 S	DRAFTING ROOM 2	(13)	SAMPLE HMS-PVH-12 COLLECTED ON 3-30- 88.	N/A
М	12" VINYL FLOOR TILE (OFF-WHITE) & ADHESIVE	15	1-5%	812 S	DRAFTING ROOM 2	(12)	COULD NOT LOCATE.	Ν
М	12" VINYL FLOOR TILE (WHITE/BLACK0 & ADHESIVE	90	ASSUMED POSITIVE	650 S	CLASSROOM 2	(1) (4)		N
М	CEMENTITIOUS TRANSITE WALLBOARD	98	ASSUMED POSITIVE	350 S	CLASSROOM 1 - METAL SHOP	(1) (4)		N
М	DRYWALL & TEXTURE	101	ASSUMED POSITIVE	2,700 S	CLASSROOMS 1-3	(1) (4)		N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

Date of Inspection:

District: Chico Unified School District School: Pleasant Valley High School Inspector: Buildings: F - Girl's (938) & Boy's (943) Locker Rooms

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditic	n: Code & Comments	Friable Yes/No
s	PLASTER	8	NONE DETECTED	3,200 S	GIRL'S LOCKER ROOM (938), BOY'S LOCKER ROOM (943), AND RESTROOMS (940 & 942)	(13)	SAMPLES HMS-PVH-08D, 08E, & 08G COLLECTED ON 03-30-88.	N/A
S	PLASTER	9	1-5%	2,500 S	COVERED WALK (OUTDOORS)	(1) (4)	SAMPLES HMS-PVH-09A&B COLLECTED 3-30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	Ν
Т	DEBRIS & PIPEWRAP CORNER	18	15-20%	DEBRIS 200 S 23 JOINTS	ATTIC (ACCESS IN STOREROOM)	(11)	COULD NOT ACCESS THIS AREA.	Y
м	DRYWALL	87	ASSUMED POSITIVE	300 S	SNACK BAR (941)	(1) (4)		N
м	12" VINYL FLOOR TILE (WHITE/BROWN) & ADHESIVE	88	ASSUMED POSITIVE	600 S	BOY'S AND GIRL'S LOCKER ROOM OFFICES	(1) (4)		Ν
м	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	100 S	BOY'S AND GIRL'S LOCKER ROOM OFFICES	(1) (4)		N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

Date of Inspection:

District: Chico Unified School District School: Pleasant Valley High School Inspector: Buildings: G - East Gym (933)

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditior	n: Code & Comments	Friable Yes/No
S	PLASTER	9	1-5%	2,500 S	COVERED WALK (OUTDOORS)	(1) (4)	SAMPLES HMS-PVH-09A&B COLLECTED 3-30-88 SHOW 1- 5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	Ν
М	12" ACOUSTIC CEILING TILE	89	ASSUMED POSITIVE	3,500 S	EAST GYM (933)	(1) (4)		Ν

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

**District: Chico Unified School District** School: Pleasant Valley High School

Inspector: Building: H - West Gym (948)

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	9	1-5%	355 S	COVERED WALK (OUTDOORS)	(1) (4) SAMPLES HMS-PVH-09A&B COLLECTED 3-30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	Ν

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

General Condition:(1) Good(2) DamagedChange in Condition:(4) No (3) Significantly Damaged (25% or more)(5) Yes (If Yes, explain under comments) Abated: (8) Encapsulated (9) Enclosed (6) Repaired (7) Removed (10) Isolated & Restricted Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS Date of Inspection:

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: J - J3-J7

Material Class	Material	Homo. Mat. #	% Asb.	Fť²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
М	DRYWALL & JOINT COMPOUND	77	CERTIFIED NON- ASBESTOS	3,500 S	CLASSROOMS J1-J7	(1) (4)	N/A
М	2' X 4' CEILING PANELS	78	CERTIFIED NON- ASBESTOS	6,300 S	CLASSROOMS J1-J7	(1) (4)	N/A
м	12" VINYL FLOOR TILE & ADHESIVE	79	CERTIFIED NON- ASBESTOS	6,300 S	CLASSROOMS J1-J7	(1) (4)	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: M - Rooms 1-12

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	on: Code & Comments	Friable Yes/No
М	DRYWALL	75	CERTIFIED NON- ASBESTOS	1,000 S	ELECTRICAL ROOM AND BOOKS	(13)	CERTIFICATION LETTER ON FILE.	N/A
М	2' X 4' CEILING PANELS	76	CERTIFIED NON- ASBESTOS	10,000 S	CLASSROOMS 1-11 AND TEACHERS ROOM	(13)	CERTIFICATION LETTER ON FILE.	N/A
м	12" VINYL FLOOR TILE (WHITE/GRAY) & ADHESIVE	80	CERTIFIED NON- ASBESTOS	600 S	CLASSROOMS 1-11, ELECTRICAL ROOM, BOOKS, AND TEACHER ROOM	(13)	CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: O - Rooms 1-6

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
М	2' X 4' CEILING PANELS	81	CERTIFIED NON- ASBESTOS	3,500 S	CLASSROOMS 1A, 1B, AND 2-6	(13) CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: P - Rooms 1-4

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
М	2' X 4' CEILING PANELS	81	CERTIFIED NON- ASBESTOS	3,600	CLASSROOMS 1-4	(13) CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: S - Rooms 1-8

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	82	CERTIFIED NON- ASBESTOS	500 S	CUSTODIAN OFFICE (963)	(13) CERTIFICATION LETTER ON FILE	N/A
М	12" VINYL FLOOR TILE & ADHESIVE	83	CERTIFIED NON- ASBESTOS	500 S	CUSTODIAN OFFICE (963)	(13) CERTIFICATION LETTER ON FILE	N/A
М	DRYWALL	84	CERTIFIED NON- ASBESTOS	1,200 S	STAFF RESTROOMS (964, 964, 960, & 961) AND GIRL'S & BOY'S RESTROOM (962)	(13) CERTIFICATION LETTER ON FILE	N/A
М	2' X 4' CEILING PANELS	85	CERTIFIED NON- ASBESTOS	8,000 S	CLASSROOMS 1-8	(13) CERTIFICATION LETTER ON FILE	N/A
М	12" VINYL FLOOR TILE (WHITE/GRAY) & ADHESIVE	86	CERTIFIED NON- ASBESTOS	8,000 S	CLASSROOMS 1-8	(13) CERTIFICATION LETTER ON FILE	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: L - Library

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
						(13) THE LIBRARY WAS CONSTRUCTED IN 1994. CERTIFICATION LETTER ON FILE DATED DECEMBER 27, 1994.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

Date of Inspection:

District: Chico Unified School District School: Pleasant Valley High School Inspector: Building: T - Student Store - Vending Machines

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes/No
М	DRYWALL & JOINT COMPOUND	72	CERTIFIED NON- ASBESTOS	320 S	STUDENT STORE (937)	(13) CERTIFICATION LETTER ON FILE.	N/A
S	PLASTER	73	CERTIFIED NON- ASBESTOS	225 S	VENDING AREA	(13) CERTIFICATION LETTER ON FILE.	N/A
М	SHEET VINYL FLOORING (YELLOW/BROWN) & ADHESIVE	74	CERTIFIED NON- ASBESTOS	550 S	VENDING AREA AND STUDENT STORE (937)	(13) CERTIFICATION LETTER ON FILE.	N/A

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE

District: Chico Unified School District School: Pleasant Valley High School Date of Inspection:

Inspector: Building: V - Rooms 1 & 928-932

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Conditio	Condition: Code & Comments	
S	PLASTER	9	NONE DETECTED	600 S	COVERED WALKWAYS	(13)	SAMPLES HMS-PVH-09A&B COLLECTED 3- 30-88 SHOW 1-5% ASBESTOS. MATERIAL RETESTED BY ROBERT PETERS OF CUSD DURING 2000 PERIODIC SURVEILLANCE WITH RESULTS OF NONE DETECTED. ENTEK DOESN'T HAVE DOCUMENTATION OF THIS ADDITIONAL SAMPLING.	Ν
М	12" ACOUSTIC CEILING TILE	72	ASSUMED POSITIVE	1,200 S	NORTH & SOUTH ENDS OF VALHALLA CEILING (929)	(1) (12)	THE DISTRICT MUST CERTIFY AS NON ASBESTOS CONTAINING BUILDING MATERIAL.	N
М	9" VINYL FLOOR TILE (WHITE/ BROWN) & ADHESIVE	73	ASSUMED POSITIVE	5,000 S	VALHALLA AREA (929) AND ROOM 1 (MUSIC ROOM)	(1) (12)	THE DISTRICT MUST CERTIFY AS NON ASBESTOS CONTAINING BUILDING MATERIAL.	Ν
S	PLASTER	74	ASSUMED POSITIVE	5,800 S	GIRL'S & BOY'S RESTROOMS (930 & 932), VALHALLA CEILING (929), AND KITCHEN WALLS (928)	(1) (12)	THE DISTRICT MUST CERTIFY AS NON ASBESTOS CONTAINING BUILDING MATERIAL.	Ν
м	COVE BASE ADHESIVE	250	ASSUMED POSITIVE	700 S	THROUGHOUT BUILDING	(1) (4)		N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Pleasant Valley HS\Pleasant Valley 6 month.wpd

CONDITION CODE