

# **Bulk Asbestos Analysis**

(EPA Method 600/R-93-116, Visual Area Estimation)

Chico Unified School Dist Leroy Christophersen 2455 Carmichael Drive Chico, CA 95928					Client ID: Report Numl Date Receive Date Analyze Date Printed First Reporte	d:       02/15/         ed:       02/16/         :       02/16/	/06 /06 /06
Job ID/Site: Chico Jr High - Drin	iking Fountain - PO# 05				FASI Job ID:	: 2921-	91
Date(s) Collected: 02/14/2006					Total Samples Submitted: 1 Total Samples Analyzed: 1		
Sample ID	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
CJH01	10493907						
Layer: Grey Cementitious Materi	al		ND				
Layer: Off-White Skimcoat/Joint	Compound		ND				
Layer: Paint			ND				
Total Composite Values of Fibro Cellulose (Trace)	us Components: As	sbestos (ND)					

James Flores, Laboratory Supervisor, Hayward Laboratory

Note: Limit of Quantification ('LOQ') = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full, unless approved by Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Forensic Analytical reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. All samples were received in acceptable condition unless otherwise noted.

	(* <b>1</b>	20	121-91					_	
Forensic Anal			T		Ar	nalysis R	equest	Form	
÷			P.O. #: (	)50289		Date:	2114	106	
Chico Unified So	CNOOL DIST	rict	Turn Around Time:hr/ 12hr / 24hr / 48hr) ext:						
2455 Carmichael	Drive		Due Date:	,	/ 1				
Chico, CA 95928									
Contact:	Maistan	1							
Contact: <u>Leroy</u> A. ( Phone #: Ichristo( <u>5-30-89</u>	chico usd	.org							
Fax#:		·	D TEM M			·			
(530) 891-3 Site:			Metals A		Mathad				
Job: Chico IR.	High		Matrix:	alarysis: i	wethod		· · · · · · · · · · · · · · · · · · ·	<u></u>	
Job: Drinkin	Analytes: _								
Comments:	1				· · · · · · · · · · · · · · · · · · ·				
0i ID	Batal			1000				Sample	
Sample ID	Date/ Time	Sample Location/De	escription	Туре	Time On/Off	MPLES ONLY Avg. LPM	Total	Area or Air	
	2/ ,		/ .	A P			Time	Volume	
CJHOI	114 En	dof 200 wing 1	terior	C A					
				P C					
				A P				*	
				C					
				A P					
			<u> </u>						
	·			P C A					
				P C					
				A P					
				C A					
				P C					
				A P C					
Sampled by:	A. Christ	haren.	Date:	<u> </u>	14 106	Time:	÷ ۲	3.8 Tm	
Shipped via:  Fed Ex		/	Mail 🗖 Co		(	D Other:			
Relinquished by:		Relinquished by:			-	ished by:			
Date / Time:		Date / Time:			Date / Ti	me:			
Received by:	21,12	Received by:			Receive				
Date Time	YK	Date / Time:			Date / Ti	-			
Condition Acceptable?	10 10 Yes 🛛 No	Condition Accepta	ible? 🗖 Yes	<b>D</b> N	o <b>Conditi</b> d	on Acceptable	? 🛛 Yes	🗆 No	
×/									

San Francisco Office: 3777 Depot Road, Suite 409, Hayward, California 94545 / Telephone: (510)887-8828 (800)827-FASI / Fax: (510)887-4218 Los Angeles Office: 2959 Pacific Commerce Drive, Rancho Dominguez, California 90221 / Telephone: (310)763-2374 / Fax: (310)763-8684 Portland Office: 17400 SW Upper Boones Ferry Road, Suite 245, Durham, Oregon 97224 / Telephone: (503)595-1001 (877)410-1888 / Fax: (503)595-1006 Las Vegas Office: 3900 Paradise Road, Suite 181, Las Vegas, Nevada 89109 / Telephone: (702)784-0040 / Fax: (702)784-0030

Maintenance and Operations 2455 Carmichael Drive Chico, CA 95928 Phone: (530) 891-3195 Fax: (530) 891-3190

# Chico Unified School District

Fed Ex Airbill #8358 1795 0952

February 14, 2006

Forensic Analytical Specialties, Inc. 3777 Depot Road, Suite 409 Hayward, CA 94545

Re: Chico Junior High School

To Whom It May Concern:

Please test the enclosed samples from the Chico Junior High School 200 wing exterior for both lead and asbestos. We would like a 48-hour turnaround on the samples. Please e-mail the results as soon as they are available to lchristo@chicousd.org.

Site Sampled:

Location: Date Sampled: Number of Samples: Chico Junior High


End of 200 Wing Exterior (Drinking Fountain) February 14, 2006 Two – #CJH01 – Asbestos #CJH02 – Lead


Thank you for your prompt response to this request.

Sincerely, nor

Leroy Christophersen Safety & Loss Coordinator

Enclosures (2)

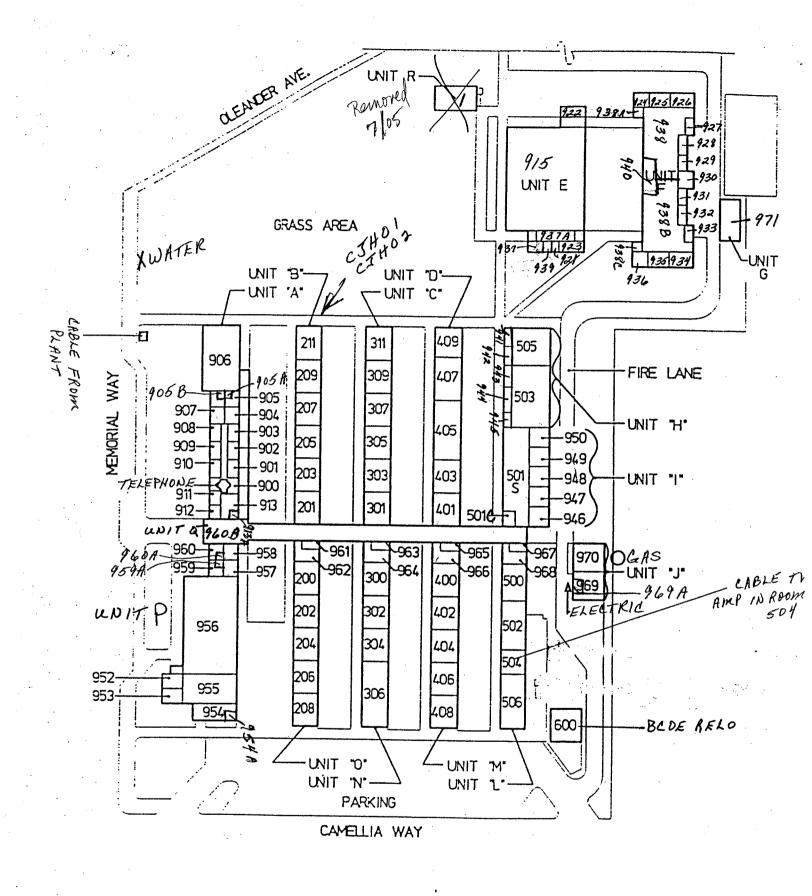

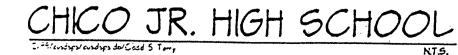

NORTH

! 1

# Date of Inspection: 06/16/2006

Inspector: Leroy Christophersen

# School: Chico Junior High School

**District: Chico Unified School District** 

Building: MPR (AKA Building A) Unit P

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Conditio	n: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	TEACHER'S LOUNGE, MPR, AND REST OF THE WING	(1) (4)		Ν
М	DRYWALL	104	ASSUMED	UNDETERMINED	THROUGHOUT UNIT	(7)	ABATED PRIOR TO 2004 INSPECTION ACCORDING TO CHICO USD RECORDS.	N/A
М	DRYWALL	106	ASSUMED	UNDETERMINED	THROUGHOUT UNIT	(1) (4)	DISTRICT MUST CERTIFY.	Ν

# Building: C - (AKA Classrooms 200, 202, 204, 206, & 208)

Unit O

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	CLASSROOM 11 (TITLE ONE OFFICE) & BOY'S RESTROOM	(1) (4)	Ν
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	12" VFT CREAM	97	ASSUMED	UNDETERMINED	CLASSROOMS 200, 202, 206, & 208	(1) (4) THE DISTRICT MUST CERTIFY.	Ν
М	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOM WING	(1) (4) NEW MATERIAL. THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON- ASBESTOS. CONTAINING.	N

# CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired<br/>Miscellaneous:(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & Restricted(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

# Date of Inspection: 06/16/2006

Inspector: Leroy Christophersen

District: Chico Unified School District

School: Chico Junior High School

Abated:

Building: D – (Classrooms 300, 302, 304, & 306)

Unit Ń

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	9" VFT RED	2	1-5%	UNDETERMINED	JANITOR'S CLOSET – NEAR GIRLS RESTROOM	(1) (4)	Ν
S	CEILING PLASTER	8	1-5%	UNDETERMINED	CLASSROOM 311 (ROOM 11)	(12) UNABLE TO LOCATE	Ν
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	12" VFT CREAM	97	ASSUMED	UNDETERMINED	CLASSROOMS 300, 302, 304, 306, & 308	(1) (4) THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON-ASBESTOS CONTAINING.	Ν
М	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) NEW MATERIAL. THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON- ASBESTOS CONTAINING.	Ν

# CONDITION CODE

<u>General Condition:</u> (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

(6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

# Date of Inspection: 06/16/2006

Inspector: Leroy Christophersen

District: Chico Unified School District

School: Chico Junior High School

Building: F – (AKA Classrooms 500, 502, 504, & 506)

ι	Jnit	Μ

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	9" VFT RED	2	1-5%	UNDETERMINED	MIGRANT EDUCATION OFFICE	(5) (6)	Ν
S	CEILING PLASTER	8	1-5%	UNDETERMINED	MIGRANT EDUCATION OFFICE'S & GIRL'S RESTROOM	(5) (6)	Ν
Т	PIPE WRAP STRAIGHT	26	40-45%	UNDETERMINED	CLASSROOM 502	(12) CANNOT LOCATE	Ν
Т	PIPER WRAP STRAIGHT	95	ASSUMED	UNDETERMINED	CLASSROOM 506	(12) CANNOT LOCATE	Ν
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	12" VFT	98	ASSUMED	UNDETERMINED	CLASSROOMS 500, 502, 504, & 506	(1) (4) THE DISTRICT MUST CERTIFY THIS IS A NON-ASBESTOS CONTAINING MATERIAL.	Ν

Building: G - (AKA Maintenance)

						- · ·	Unit J
Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes / No
Т	BOILER REFRACTORY	100	ASSUMED	UNDETERMINED	TWO BOILER UNITS	(1) (4) NEED SIGNAGE	Ν

# CONDITION CODE

General Condition:	(1) Good	(2)	Damaged	(3)	Significantly Damaged (25% or more)
Change in Condition:	(4) No	(5)	Yes (If Yes,	exp	lain under comments)
Abated:	(6) Repaired	(7)	Removed	(8)	Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous:	(11) Inaccessible	e, n	o inspection	data	a (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

# Date of Inspection: 06/16/2006

District: Chico Unified School District

Inspector: Leroy Christophersen

School: Chico Junior High School

Building: H & N – (AKA 501-Industrial Arts/Wood Shop & 503 & 505 –Durst Theater & Music Room) Unit H & I

							Unitina
Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	12" ACT	17	NONE DETECTED	UNDETERMINED	WOOD SHOP, DURST THEATER, MUSIC CLASSROOM, & PRACTICE CLASSROOMS 1-5	(13) SAMPLE HMS-CJH-17 COLLECTED IN 1988.	N/A
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	N
М	12" VFT CREAM	97	ASSUMED	UNDETERMINED	COMPUTER ROOM, MATERIAL STORAGE, STORAGE, & STAFF OFFICE, DURST THEATRE, OFFICES, MUSIC CLASSROOM, AND PRACTICE CLASSROOMS 1-5	(1) (4) THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL.	Ν

# CONDITION CODE

General Condition:	(1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition:	(4) No (5) Yes (If Yes, explain under comments)
Abated:	(6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous:	(11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

# Date of Inspection: 06/16/2006

Unit A

**District: Chico Unified School District** 

Inspector: Leroy Christophersen

School: Chico Junior High School

Abated:

Building: J (AKA Main Office Building)

	÷		á		•		
Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	LIBRARY	(1) (4)	N
М	12" VFT CREAM	97	NON ASBESTOS	UNDETERMINED	ADMINISTRATION OFFICES, HALLWAY, AND LIBRARY	(1) (4) THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL. LETTER ON FILE FOR PROJECT 9633	N
М	DRYWALL	101	NON ASBESTOS	UNDETERMINED	THROUGHOUT UNIT	<ul> <li>(1) (4) NEW DRYWALL WAS PUT INTO THIS UNIT DURING THE RENOVATION IN THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON- ASBESTOS CONTAINING MATERIAL.</li> <li>LETTER ON FILE FOR PROJECT 9633</li> </ul>	Ν

# CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more) Change in Condition:

(4) No (5) Yes (If Yes, explain under comments)

(7) Removed (8) Encapsulated (6) Repaired (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

# Date of Inspection: 06/16/2006

District: Chico Unified School District

Inspector: Leroy Christophersen

School: Chico Junior High School

Building: K – (AKA Classrooms 201, 203, 205, 207, 209, & 211) Unit B

Friable Yes / No N
N
l
N
N

# Building: L – (AKA Classrooms 301, 303, 305, 307, 309, & 311)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν
м	12" VFT GREY	103	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν

#### CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & Restricted(11) Inaccessible, no inspection data(12) Other (Explain under comments)

# Date of Inspection: 06/16/2006

District: Chico Unified School District

Inspector: Leroy Christophersen

School: Chico Junior High School

Building: M - (AKA Classrooms 401, 403, 405, 407, & 409) Unit D

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν
М	12" VFT GREY	103	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν

Building: O – (AKA Gymnasium) Unit E

Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	9" VFT GREEN	5	1-5%	200 S	RESTROOMS	(10)	Ν

Building: P - (AKA PE Locker Rooms)

		-
U	nit	

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition	: Code & Comments	Friable Yes / No
М	9" VFT GREEN	5	1-5%	UNDETERMINED	CLASSROOM 18 STORAGE	(12)	COULD NOT FIND DURING TIME OF INSPECTION.	Ν
Т	PIPE WRAP	105	ASSUMED	UNDETERMINED	IN CEILING PIPE CHASE	(10)	COULD NOT LOCATE	Ν

# CONDITION CODE

General Condition:	(1) Good	(2) Da	amaged	3) Sig	nificantly Da	amaged (	25% or more	e)			
Change in Condition:	(4) No	(5) Ye	es (If Yes,	xplain	under comr	nents)					
Abated:	(6) Repaired	(7) Re	emoved	B) End	capsulated	(9)	Enclosed	(10) Iso	lated &	Restricted	
<u>Miscellaneous:</u>	(11) Inaccessible	e, no ir	nspection (	ata	(12) Other (	Explain u	Inder comme	ents)	(13) N	Ion-Asbestos/No	ot Inspected

Date of Inspection: 12/28/2006

District: Chico Unified School District

Inspector: Leroy Christophersen

# School: Chico Junior High School

Building: MPR (AKA Building A) Unit P

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Conditio	n: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	TEACHER'S LOUNGE, MPR, AND REST OF THE WING	(1) (4)		N
М	DRYWALL	104	ASSUMED	UNDETERMINED	THROUGHOUT UNIT	(7)	ABATED PRIOR TO 2004 INSPECTION ACCORDING TO CHICO USD RECORDS.	N/A
М	DRYWALL	106	NON- ASBESTOS	UNDETERMINED	THROUGHOUT UNIT	(1) (4)	LETTER ON FILE	Ν

# Building: C – (AKA Classrooms 200, 202, 204, 206, & 208)

-							
Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	CLASSROOM 11 (TITLE ONE OFFICE) & BOY'S RESTROOM	(1) (4)	Ν
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	12" VFT CREAM	97	ASSUMED	UNDETERMINED	CLASSROOMS 200, 202, 206, & 208	(1) (4) THE DISTRICT MUST CERTIFY.	N
м	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOM WING	(1) (4) NEW MATERIAL. THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON- ASBESTOS. CONTAINING.	Ν

# CONDITION CODE

General Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Change in Condition:(4) No(5) Yes (If Yes, explain under comments)Abated:(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & RestrictedMiscellaneous:(11) Inaccessible, no inspection data(12) Other (Explain under comments)(13) Non-Asbestos/Not Inspected

Date of Inspection: <u>12/28/2006</u>

Inspector: Leroy Christophersen

District: Chico Unified School District

School: Chico Junior High School

Abated:

Building: D - (Classrooms 300, 302, 304, & 306)

Unit N

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	9" VFT RED	2	1-5%	UNDETERMINED	JANITOR'S CLOSET – NEAR GIRLS RESTROOM	(1) (4)	Ν
s	CEILING PLASTER	8	1-5%	UNDETERMINED	CLASSROOM 311 (ROOM 11)	(12) UNABLE TO LOCATE	Ν
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	12" VFT CREAM	97	ASSUMED	UNDETERMINED	CLASSROOMS 300, 302, 304, 306, & 308	(1) (4) THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON-ASBESTOS CONTAINING.	Ν
М	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) NEW MATERIAL. THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON- ASBESTOS CONTAINING.	Ν

# CONDITION CODE

<u>General Condition:</u> (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

(6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

Date of Inspection: <u>12/28/2006</u>

Inspector: Leroy Christophersen

District: Chico Unified School District

School: Chico Junior High School

Building: F - (AKA Classrooms 500, 502, 504, & 506)

Unit M

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	9" VFT RED	2	1-5%	UNDETERMINED	MIGRANT EDUCATION OFFICE	RANT EDUCATION OFFICE (1)	
S	CEILING PLASTER	8	1-5%	UNDETERMINED	MIGRANT EDUCATION OFFICE'S & GIRL'S RESTROOM	(1)	Ν
т	PIPE WRAP STRAIGHT	26	40-45%	UNDETERMINED	CLASSROOM 502	(12) CANNOT LOCATE	Ν
Т	PIPER WRAP STRAIGHT	95	ASSUMED	UNDETERMINED	CLASSROOM 506	(12) CANNOT LOCATE	Ν
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	12" VFT	98	ASSUMED	UNDETERMINED	CLASSROOMS 500, 502, 504, & 506	(1) (4) THE DISTRICT MUST CERTIFY THIS IS A NON-ASBESTOS CONTAINING MATERIAL.	Ν

Building: G - (AKA Maintenance)

							Unit J
Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes / No
Т	BOILER REFRACTORY	100	ASSUMED	UNDETERMINED	TWO BOILER UNITS	(1) (4)	Ν

# CONDITION CODE

General Condition:	(1) Good	(2)	Damaged	(3)	Significantly D	amaged	(25% or mor	e)			
Change in Condition:	(4) No	(5)	Yes (If Yes,	exp	lain under com	iments)					
Abated:	(6) Repaired	(7)	Removed	(8)	Encapsulated	(9)	Enclosed	(10)	Isolated	& Restricted	
Miscellaneous:	(11) Inaccessible	e, n	o inspection	data	a (12) Other	(Explain i	under comm	ents)	(13)	Non-Asbestos	/Not Inspected

# Date of Inspection: <u>12/28/2006</u>

District: Chico Unified School District

Inspector: Leroy Christophersen

School: Chico Junior High School

Building: H & N – (AKA 501-Industrial Arts/Wood Shop & 503 & 505 –Durst Theater & Music Room) Unit H & I

							Unitina
Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	12" ACT	17	NONE DETECTED	UNDETERMINED	WOOD SHOP, DURST THEATER, MUSIC CLASSROOM, & PRACTICE CLASSROOMS 1-5	(13) SAMPLE HMS-CJH-17 COLLECTED IN 1988.	N/A
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	12" VFT CREAM	97	ASSUMED	UNDETERMINED	COMPUTER ROOM, MATERIAL STORAGE, STORAGE, & STAFF OFFICE, DURST THEATRE, OFFICES, MUSIC CLASSROOM, AND PRACTICE CLASSROOMS 1-5	(1) (4) THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL.	Ν

# CONDITION CODE

General Condition:	(1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition:	(4) No (5) Yes (If Yes, explain under comments)
Abated:	(6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous:	(11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

#### Date of Inspection: <u>12/28/2006</u>

District: Chico Unified School District

Inspector: Leroy Christophersen

Building: J (AKA Main Office Building)

School: Chico Junior	High School
----------------------	-------------

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	LIBRARY	(1) (4)	N
М	12" VFT CREAM	97	NON ASBESTOS	UNDETERMINED	ADMINISTRATION OFFICES, HALLWAY, AND LIBRARY	(1) (4) LETTER ON FILE FOR PROJECT 9633	N
М	DRYWALL	101	NON ASBESTOS	UNDETERMINED	THROUGHOUT UNIT	(1) (4) LETTER ON FILE FOR PROJECT 9633	N

# CONDITION CODE

<u>General Condition:</u> Change in Condition:

Abated:

(1) Good

(2) Damaged (3) Significantly Damaged (25% or more)

tion: (4) No (5) Yes (If Yes, explain under comments)

(6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

Date of Inspection: <u>12/28/2006</u>

District: Chico Unified School District

Inspector: Leroy Christophersen

School: Chico Junior High School

Building: K – (AKA Classrooms 201, 203, 205, 207, 209, & 211) Unit B

Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes / No
TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν
12" VFT GREY	102	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν
	TRANSITE PANELS 2' X 4' FCP	Mat. #       TRANSITE PANELS     96       2' X 4' FCP     99	Mat. #       TRANSITE PANELS       2' X 4' FCP       99       ASSUMED	Mat. #     Mat. #       TRANSITE PANELS     96     ASSUMED     UNDETERMINED       2' X 4' FCP     99     ASSUMED     UNDETERMINED	Mat. #     Mat. #       TRANSITE PANELS     96       2' X 4' FCP     99       ASSUMED     UNDETERMINED       EXTERIOR OF UNIT	Mat. #Mat. #Mat. #Mat. #Mat. #Mat. #Mat. #Mat. #TRANSITE PANELS96ASSUMEDUNDETERMINEDEXTERIOR OF UNIT(1) (4)2' X 4' FCP99ASSUMEDUNDETERMINEDTHROUGHOUT CLASSROOMS(1) (4)RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.12" VFT GREY102ASSUMEDUNDETERMINEDTHROUGHOUT CLASSROOMS(1) (4)RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.

# Building: L – (AKA Classrooms 301, 303, 305, 307, 309, & 311)

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
м	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
м	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν
М	12" VFT GREY	103	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν

# CONDITION CODE

General Condition:<br/>Change in Condition:(1) Good(2) Damaged(3) Significantly Damaged (25% or more)Abated:<br/>Miscellaneous:(4) No(5) Yes (If Yes, explain under comments)(6) Repaired(7) Removed(8) Encapsulated(9) Enclosed(10) Isolated & Restricted(11) Inaccessible, no inspection data(12) Other (Explain under comments)

Date of Inspection: <u>12/28/2006</u>

District: Chico Unified School District

Inspector: Leroy Christophersen

School: Chico Junior High School

Building: M - (AKA Classrooms 401, 403, 405, 407, & 409) Unit D

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) (4)	Ν
М	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν
М	12" VFT GREY	103	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) (4) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	Ν

Building: O - (AKA Gymnasium)

							Unit E
Material Class	Material	Homo. Mat. #	% Asb.	Ft²/L.F.	Location	Condition: Code & Comments	Friable Yes / No
М	9" VFT GREEN	5	1-5%	200 S	RESTROOMS	(10) (4)	Ν

Building: P - (AKA PE Locker Rooms)

		_
	nıt	_
- U	nit	

Material Class	Material	Homo. Mat. #	% Asb.	Ft <sup>2</sup> /L.F.	Location	Condition	: Code & Comments	Friable Yes / No
М	9" VFT GREEN	5	1-5%	UNDETERMINED	CLASSROOM 18 STORAGE	(12)	COULD NOT FIND DURING TIME OF INSPECTION.	Ν
Т	PIPE WRAP	105	ASSUMED	UNDETERMINED	IN CEILING PIPE CHASE	(10)	COULD NOT LOCATE	Ν

# CONDITION CODE

General Condition:	(1) Good	(2)	Damaged	(3)	Significantly Damaged (25% or more)
Change in Condition:	(4) No	(5)	Yes (If Yes,	exp	plain under comments)
Abated:	(6) Repaired	(7)	Removed	(8)	Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous:	(11) Inaccessibl	e, no	o inspection	data	a (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected