

Rosedale

RECORD OF FRIABLE AND NONFRIABLE ACM
(FORM B)

Inspection Date(s) August 1, 2013

THREE-YEAR REINSPECTION

CDS CODE
04-61424-6003081

SCHOOL
Rosedale Elementary School

SCHOOL PHONE NUMBER
(530) 891-3104

ADDRESS
100 Oak Street

(NUMBER)

(STREET)

(CITY)
Chico, CA

(ZIP)
95928

-IMPORTANT-

Each building and functional space with friable ACM or friable assumed ACM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACM OR FRIABLE ASSUMED ACM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE <small>(Indicate Address if Different From Above)</small>	CHECK ONE			CHECK ONE			
		SUR- FACING	TSI	MISC	ACBM		ASSUMED ACM	
					FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
1.	UNIT A			X		X		X
2.	KITCHEN WATER HEATER CLOSET		X				X	
3.	UNIT B			X				X
4.	UNIT C - PORTABLE 3			X				X
5.	UNIT D - PORTABLE 4			X		X		X
6.	UNIT E - PORTABLES 5 & 5B - RSP & READ RECOVERY 2			X				X
7.	UNIT F			X				X
8.	UNIT G NO ACM			X				
9.	UNIT H			X		X		X
10.	UNIT I			X				X
11.	UNIT J		X	X				X
12.	UNIT K		X	X		X		X
13.								
14.								
15.								
16.								

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

**ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Rosedale Elementary School

Inspector: Blake Howes

Building & Location(s): Unit A - Kitchen Water Heater Closet

% Asbestos - Assumed

Homogeneous Mat. #111

Material description: 3" O.D. Pipe Runs

Total amount of material this location: 20 L Amount of friable material this location: 20 L

Damage	Local		Distributed	X	Damaged	5%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration	X	Physical		Delamination	

Probable cause(s) of damage:

	POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L				
				Isolate/Restrict		Fix leaks	
Accessibility	X			Repair/Cleanup	X	Prevent water contact	X
Vibration			X	Enclose		Do not drill, cut, sand, or grind	X
Air Erosion			X	Remove	X	Do not affix signs	
Water			X	Encapsulate	X	Avoid contact	X
Occupancy		X		O & M	X		

Assessment of Material Condition

Significantly Damaged
(Poor)

Damaged
(Fair)

Not damaged
(Good)

Potential Damage: High

High Mod Low

High Mod Low

Hazard Ranking:

1 2 3 4 5 6 7

						X		
--	--	--	--	--	--	---	--	--

Comments & Observations:

**ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL**

District: Chico Unified School District

Date: August 1, 2013

School: Rosedale Elementary School

Inspector: Blake Howes

Building & Location(s): Unit A - Kitchen Water Heater Closet

% Asbestos - Assumed

Homogeneous Mat. #112

Material description: 3" O.D. Pipe Fittings

Total amount of material this location: 3 Each

Amount of friable material this location: 3 Each

Damage	Local		Distributed	X	Damaged	5%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration	X	Physical		Delamination	

Probable cause(s) of damage:

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L	Isolate/Restrict		Fix leaks
Accessibility	X			Repair/Cleanup	X	Prevent water contact X
Vibration			X	Enclose		Do not drill, cut, sand, or grind X
Air Erosion			X	Remove	X	Do not affix signs
Water			X	Encapsulate	X	Avoid contact X
Occupancy		X		O & M	X	

Assessment of Material Condition

Significantly Damaged
(Poor)

Damaged
(Fair)

Not damaged
(Good)

Potential Damage: High

High Mod Low

High Mod Low


Hazard Ranking:

1 2 3 4 5 6 7

					X		
--	--	--	--	--	---	--	--

Comments & Observations:

Rosedale Elementary School

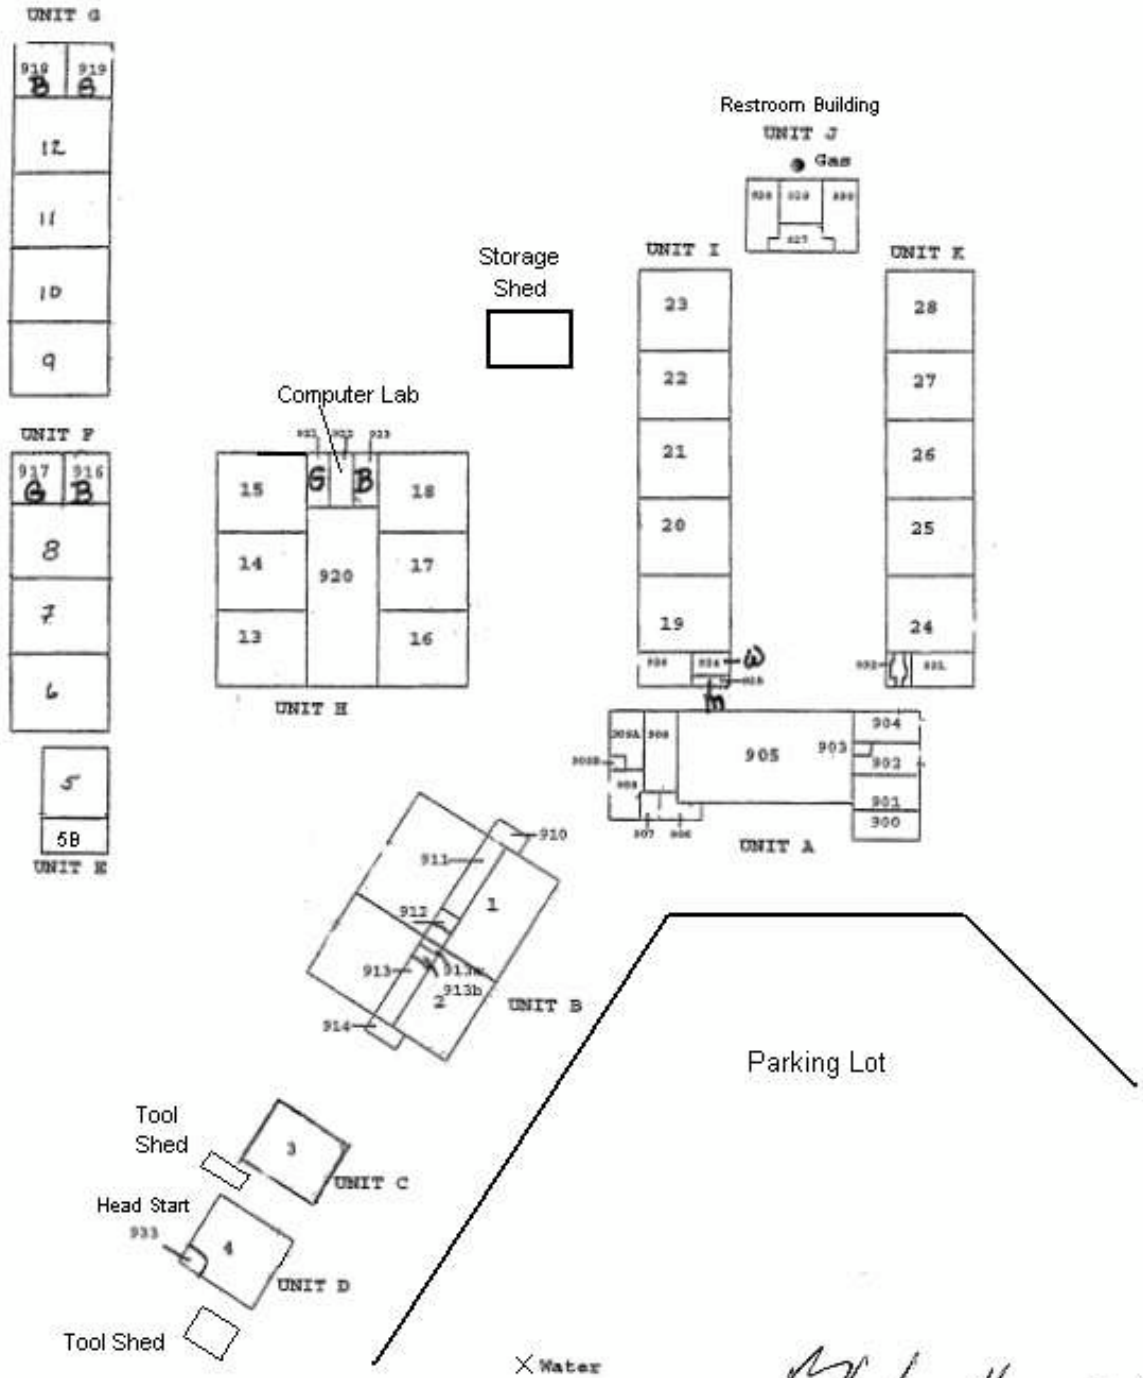

Blake Howes

Chico Unified School District
 Rosedale Elementary School
 100 Oak Street
 Chico, CA 95928

Entek Consulting Group, Inc.
 4200 Rocklin Road, Suite 7
 Rocklin, California 95677
 Map Not To Scale

3-Year AHERA Reinspection
 Conducted by Blake Howes
 August 1, 2013
 Project 13-2751

SIX-MONTH SURVEILLANCE

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit A

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	9" VINYL FLOOR TILE (GREEN) & ADHESIVE	3	5-10%	3,200 S	MPR (905), KITCHEN 908, KITCHEN STORAGE 909A, AND STORAGE ROOM 909B	(1) (4)	N
M	CEMENTITIOUS TRANSITE PIPE FLUE	90	ASSUMED POSITIVE	10 L	KITCHEN WATER HEATER CLOSET	(1) (4)	N
M	12" VINYL FLOOR TILE (WHITE) & ADHESIVE	93	ASSUMED POSITIVE	3,000 S	CORRIDOR	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY/BLUE) & ADHESIVE	107	ASSUMED POSITIVE	400 S	ADMINISTRATION OFFICES 900-903, 906, 907 & 909	(1) (4) INSTALLED DURING MODERNIZATION.	N
M	12" ACOUSTIC CEILING TILE FISSURE PATTERN	108	ASSUMED POSITIVE	400 S	ADMINISTRATION OFFICES 900-903, 906, 907 & 909	(1) (4) INSTALLED DURING MODERNIZATION.	N
M	SHEET VINYL FLOORING (WHITE) & ADHESIVE	109	ASSUMED POSITIVE	150 S	RESTROOM 904 & NURSE'S RESTROOM	(1) (4)	N
S	PLASTER	110	NONE DETECTED	2,000 S	MPR (905) /KITCHEN 908	(13) SAMPLE ROS01 COLLECTED ON FEBRUARY 22, 2006.	N/A
T	3" O.D. PIPE RUNS	111	ASSUMED POSITIVE	20 L	KITCHEN WATER HEATER CLOSET	(1) (4) PHYSICAL DAMAGE REPAIRED WITH DUCT TAPE.	Y
T	3" O.D. PIPE FITTINGS	112	ASSUMED POSITIVE	3 EACH	KITCHEN WATER HEATER CLOSET	(1) (4) PHYSICAL DAMAGE REPAIRED WITH DUCT TAPE.	Y

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit A
(Continued)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	COVE BASE ADHESIVE	113	ASSUMED POSITIVE	200 L	CORRIDOR	(1) (4)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	400 L	ADMINISTRATION OFFICES 900-903, 907, AND 909	(1) (4)	N
S	STUCCO	152	ASSUMED POSITIVE	1,000 S	COVERED WALKWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit B

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS	94	ASSUMED POSITIVE	2,000 S	CLASSROOMS K-1, & K-2	(1) (4)	N
M	12" VINYL FLOOR TILE CREAM	95	ASSUMED POSITIVE	2,000 S	CLASSROOMS K-1, & K-2	(1) (4)	N
M	12" ACOUSTIC CEILING TILES	114	ASSUMED POSITIVE	160 S	2 CLASSROOMS K-1, & K-2	(1) (4)	N
M	SHEET VINYL FLOORING (WHITE/ GREY PEBBLED) & ADHESIVE	115	ASSUMED POSITIVE	120 S	4 RESTROOMS IN EACH K-1, & K-2	(1) (4)	N
M	BASE COVE ADHESIVE	150	ASSUMED POSITIVE	320 L	CLASSROOMS K1 & K2	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	550 SF	CLASSROOMS K1 & K2	(1) (4)	N
M	STUCCO	152	ASSUMED POSITIVE	1,000 SF	COVERED WALKWAY	(1) (4)	N
M	DRYWALL WITH JOINT COMPOUND	154	ASSUMED POSITIVE	200 SF	ROOM 2 RESTROOMS	(1) (4)	N
M	PLASTER	156	ASSUMED POSITIVE	200 SF	ROOM 1 STORAGE & RESTROOMS ROOM 2 STORAGE & RESTROOMS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit C - Portable 3

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS FIBERGLASS	103	NON-SUSPECT	1,200 S	PORTABLE CLASSROOM 3	(1) (4)	N
M	SHEET VINYL FLOORING (CREAM) & ADHESIVE	116	ASSUMED POSITIVE	200 S	PORTABLE CLASSROOM 3	(1) (4)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	300 L	PORTABLE CLASSROOM 3	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	1,000 S	PORTABLE CLASSROOM 3	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit D - Portable 4

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS FISSURE PATTERN	103	ASSUMED POSITIVE	1,200 S	PORTABLE CLASSROOM 4	(1) (4)	N
M	SHEET VINYL FLOORING (CREAM WITH BLUE SPECKS) & ADHESIVE	117	ASSUMED POSITIVE	200 S	PORTABLE CLASSROOM 4	(1) (4)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	120 L	PORTABLE CLASSROOM 4	(1) (4)	N
M	TEXTURE WALL PAINT	158	ASSUMED POSITIVE	600 S	COVERED WALKWAY AT EXTERIOR WALL	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit E - Portables 5 & 5B

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS	107	ASSUMED POSITIVE	600 S	CEILING OF PORTABLE CLASSROOMS 5 & 5B - RSP & READ RECOVERY	(1) (4) HOLES IN THE 2' X 4' CEILING PANELS.	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	118	ASSUMED POSITIVE	360 S	PORTABLE CLASSROOMS 5 & 5A	(1) (4)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	150 L	PORTABLE CLASSROOMS 5 & 5B	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	575 S	PORTABLE CLASSROOMS 5 & 5B	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit F

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (WHITE MOTTLED) & ADHESIVE	18	NONE DETECTED	1,600 S	CLASSROOMS 6, 7, & 8	(13) REPRESENTED SAMPLE HMS-RSD-18 WAS COLLECTED ON 3-31-88.	N/A
M	SHEET VINYL FLOORING (BEIGE & WHITE PEBBLED) & ADHESIVE	21	NONE DETECTED	375 S	BOTH RESTROOMS (916 & 917)	(13) REPRESENTED SAMPLE HMS-RSD-21 WAS COLLECTED ON 3-31-88.	N/A
M	2' X 4' CEILING PANELS	106	ASSUMED POSITIVE	1,600 S	CLASSROOMS 6, 7, & 8	(1) (4)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	360 L	CLASSROOM 6	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	2,100 S	CLASSROOM 6	(1) (4)	N
M	DRYWALL WITH JOINT COMPOUND	154	ASSUMED POSITIVE	1,000 S	CLASSROOM 6	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit G

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (WHITE) & ADHESIVE	18	NONE DETECTED	2,000 S	CLASSROOMS 9, 10, & 12	(13) REPRESENTED SAMPLE HMS-RSD-18 WAS COLLECTED ON 3-31-88.	N/A
M	SHEET VINYL FLOORING (TAN) & ADHESIVE	21	NONE DETECTED	375 S	BOTH RESTROOMS (918 & 919)	(13) REPRESENTED SAMPLE HMS-RSD-21 WAS COLLECTED ON 3-31-88.	N/A
M	2' X 4' CEILING PANELS FIBERGLASS	105	NON-SUSPECT	2,000 S	CLASSROOMS 9-12	(13)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	980 L	CLASSROOMS 9-12	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	2,160 S	CLASSROOMS 9, 10, & 12	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY) & ADHESIVE	153	ASSUMED POSITIVE	960 S	CLASSROOM 11	(1) (4)	N
M	DRYWALL WITH JOINT COMPOUND	154	ASSUMED POSITIVE	1,600 S	BOTH RESTROOMS	(1) (4)	N
S	WALL TEXTURE ON DRYWALL	155	ASSUMED POSITIVE	1,600 S	BOTH RESTROOMS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit H

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	9" VINYL FLOOR TILE (CREAM) & ADHESIVE	15	15-20%	6,500 S	CLASSROOMS 13-18	(1) (4) CRACKS AT ALL ENTRIES.	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	91	ASSUMED POSITIVE	6,500 S	CLASSROOMS 13-18 AND LIBRARY (920)	(1) (4)	N
M	DRYWALL	101	ASSUMED POSITIVE	500 S	TV/PARENT AREA (920)	(1) (4)	N
M	12" ACOUSTIC CEILING TILE	102	ASSUMED POSITIVE	370 S	TV/PARENT AREA (920) & COMPUTER LAB (922)	(1) (4)	N
M	12" VINYL FLOOR TILE (GRAY/BLUE) & ADHESIVE	119	ASSUMED POSITIVE	1,370 S	LIBRARY/TV PARENT AREA (920) & COMPUTER LAB (922)	(1) (4)	N
S	STUCCO	152	ASSUMED POSITIVE	2,000 S	COVERED WALKWAYS	(1) (4)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	720 L	CLASSROOMS 13-18 & LIBRARY (920)	(1) (4)	N
M	DRYWALL WITH JOINT COMPOUND	154	ASSUMED POSITIVE	200 S	COMPUTER LAB (922)	(1) (4)	N
M	PLASTER	156	ASSUMED POSITIVE	1,800 S	RESTROOMS (921 & 923)	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	700 S	LIBRARY (920)	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit I

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	DRYWALL	97	ASSUMED POSITIVE	400 S	BOTH RESTROOMS (924 & 925) AND WORK ROOM (926)	(1) (4)	N
M	12" VINYL FLOOR TILE (CREAM) & ADHESIVE	98	ASSUMED POSITIVE	4,000 S	CLASSROOMS 19-23 AND WORK ROOM (926)	(1) (4)	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	99	ASSUMED POSITIVE	4,000 S	CLASSROOMS 19-23	(1) (4)	N
M	12" ACT - WALLS FISSURE PATTERN	120	ASSUMED POSITIVE	200 S	CLASSROOMS 19-23	(1) (4)	N
M	12" ACT - CEILING 1/8" HOLE PATTERN	121	ASSUMED POSITIVE	900 S	CLASSROOMS 19-23	(1) (4)	N
M	COVE BASE	122	ASSUMED POSITIVE	600 L	CLASSROOMS 19-23	(1) (4)	N
M	SHEET VINYL FLOORING (GRAY) & ADHESIVE	157	ASSUMED POSITIVE	175 S	BOTH RESTROOMS (925 & 924)	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit J

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	DRYWALL	100	ASSUMED POSITIVE	100 S	BOTH RESTROOMS (928 & 930) AT SKYLIGHT	(1) (5) MIS-IDENTIFIED AT RESTROOM WALLS, WALLS HAVE ALWAYS BEEN PLASTER	N
S	PLASTER	123	ASSUMED POSITIVE	3,000 S	CUSTODIAL ROOM, BOILER ROOM (927 & 929), BOTH RESTROOMS (928 & 930) AT WALLS	(1) (5) WALLS FORMERLY DESCRIBED AS DRYWALL, WALLS HAVE ALWAYS BEEN PLASTER	N
S	STUCCO	152	ASSUMED POSITIVE	300 S	COVERED WALKWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District: Chico Unified School District

Inspector:

School: Rosedale Elementary School

Building: Unit K

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	PLASTER	1	1-5%	350 S	CUSTODIAN ROOM	(1) (4)	N
M	DRYWALL	97	ASSUMED POSITIVE	300 S	READING OFFICE (FKA LOUNGE) (931)	(1) (4)	N
M	12" VINYL FLOOR TILE & ADHESIVE	98	ASSUMED POSITIVE	4,000 S	CLASSROOMS 24-28	(1) (4)	N
M	2' X 4' CEILING PANELS	99	ASSUMED POSITIVE	4,000 S	CLASSROOMS 24-28	(1) (4)	N
M	12" ACOUSTIC CEILING TILE - WALLS	124	ASSUMED POSITIVE	200 S	CLASSROOMS 24-28	(1) (4)	N
M	12" ACOUSTIC CEILING TILE - CEILINGS	125	ASSUMED POSITIVE	900 S	CLASSROOMS 24-28	(1) (4)	N
M	COVE BASE	126	ASSUMED POSITIVE	600 S	CLASSROOMS 24-28	(1) (4)	N
M	STUCCO	152	ASSUMED POSITIVE	100 S	COVERED WALKWAY	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Rosedale ES\Rosedale 6 Month.doc

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS