



ENTEK CONSULTING GROUP, INC.

4200 Rocklin Road, Suite 7 Rocklin, CA 95677

Telephone (916) 632-6800

Fax (916) 632-6812

April 12, 2006

Mr. Leroy Christopherson
Safety and Loss Control
Chico Unified School District
2455 Carmichael Drive
Chico, CA 95928

RE: Initial AHERA Inspection for Community Day School

Dear Mr. Christopherson:

Enclosed is the data obtained from the initial AHERA inspection conducted by Entek Consulting Group, Inc. (Entek, Inc.) on March 29, 2006. The documents include a current list of buildings (Form B) covering all buildings known to contain asbestos containing building materials (ACBM), Functional Space Notes, Homogeneous Material Records (HMR), Building and Space Check List, Material List, and Laboratory Results. The school inspected was Community Day School.

Please review the Homogeneous Materials Records to familiarize yourself with the status of asbestos containing materials and identified suspect asbestos materials. It is the District's responsibility to assure that the school's site copy of the Management Plan is up to date and consistent with the District's Management Plan for that site. This is very important, and if not done, can cause the District to be penalized during an EPA site visit or investigation.

Entek, Inc. wants to remind you that materials containing "trace" amounts of asbestos must be considered in the event of renovations or demolitions. Although building materials containing trace amounts of asbestos (<1%) are not regulated under EPA, Cal/OSHA does regulate work practices when disturbing materials containing 0.1% asbestos or greater.

When you provide your annual notification to parents and staff, include information regarding this initial inspection. Enclosed is a suggested format for your notification letter. Please note that you must include in your Management Plans a description of the steps you take to notify. It is also important that your Management Plans be updated after any and all actions conducted which impact asbestos containing materials.

It is the District's responsibility to obtain letters of certification from the architect, construction superintendent, or manufacturer of new building materials, indicating there is no asbestos in the new buildings (constructed after October 12, 1988) or new building materials. A copy of these certification letters must be included in your Management Plans, both at the school site and at the LEA Designees office site. It is still required of School Districts to send a copy of these certification letters to the US EPA AHERA unit; Region IX in San Francisco.



Mr. Leroy Christopherson, Safety and Loss Control
Chico Unified School District
April 12, 2006
Page Two

It is not necessary to send a copy of the inspection to the OPSC or EPA. However, the report should be included in your Management Plan. Thank you for your cooperation. If you have any questions, please feel free to contact me at (916) 632-6800.

Sincerely,

A handwritten signature in black ink, reading "Douglas R. Colley". The signature is fluid and cursive, with a large loop at the end.

Douglas R. Colley
Vice President of Operations
DOSH #92-0222

Enclosures

Z:\Shannon\CLIENTS\Chico USD\Community Day School\06-133\FINAL LETTER.wpd

TABLE OF CONTENTS

INTRODUCTION

- I. Inspection Protocol
 - A. Bulk Sample Results - Asbestos
 - B. Recommendations regarding Asbestos Removal/Notification Prior to Renovation
 - C. Disclaimer
- II. Glossary of Terms
 - A. AHERA Glossary
 - B. HMS, Inc. Abbreviations

INSPECTION DATA

- I. Homogeneous Materials Record/Functional Space Notes
- II. Maps
- III. Laboratory Reports
- IV. Laboratory Accreditation
- V. Inspector Accreditation

OPSC MANAGEMENT PLAN (DISTRICT POLICY)

- I. Form A General Data
- II. Form B List of Buildings and ACBM
- III. Form C Building Inspections-Exclusion Certifications
- IV. Form D Physical and Hazard Assessments
- IV. Form D HMS, Inc. Assessments of Friable Material
- IV. Form D Operations and Maintenance Plan
- IV. Form D Asbestos Training - Form E-2
- IV. Form D Asbestos Training Personnel Record - Form E-3
- IV. Form D Short-Term Worker Notification Under AHERA
- IV. Form D Periodic Cleaning Schedule
- IV. Form D Major Fiber Release Report - AHERA
- IV. Form D Minor Fiber Release Report - AHERA
- IV. Form D LEA Designee & Location of Plan - Form E-5
- IV. Form D Locations of Asbestos - Form E-4
- IV. Form D Maintenance and Operations Information
- V. Form E Periodic Surveillance Plan
- V. Form E Six Month Surveillance Form
- VI. Form F Reinspection Plan
- VII. Form G Parent/Employee Notification Plan
- VII. Form G Notification Form
- VIII. Form H Resource Needed
- IX. Management Planner Accreditation



ADDITIONAL INFORMATION AND FORMS

- I. Health Effects of Asbestos
- II. Detection, Identification, and Assessment of ACM
- III. Options for Controlling ACBM
- IV. Responsibilities of LEA Designee
 - A. Recordkeeping Requirements
 - B. Building Certification Letters
 - C. New Materials
- V. How to Plan an Abatement Exercise and Calculate Costs
- VI. Analysis of Final Clearance Air Samples - PCM vs. TEM
- VII. Vinyl Floor Tile Information
 - A. EPA Interim Guidelines for Stripping
 - B. EPA Policy Clarification for AHERA (VAT)
 - C. Asbestos Issues - VAT: How Safe to Maintain?
 - D. HMS, Inc.'s Report "VAT Removal"
 - E. Two Technical Reports of Asbestos Fiber
- VIII. Renovation/Demolition
 - A. Federal Register Vol. 55 No. 224
- IX. Other Regulatory Issues

SIX MONTH SURVEILLANCES

THREE-YEAR REINSPECTIONS

TRAINING RECORDS

MAINTENANCE RECORDS

RESPONSE ACTIONS



INSPECTION DOCUMENTS

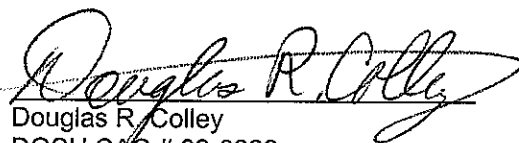
LOCAL EDUCATION AGENCY (LEA): Chico Unified School District
SCHOOL SITE: Community Day School

DATE OF INSPECTION: March 29, 2006
INSPECTOR(S): Richard A. Beall & Douglas R. Colley

ACCREDITATION:

Richard A. Beall
EPA Asbestos Building Inspector/Management Planner
COEH - #CA-002-08
EPA Asbestos Contractor Supervisor
COEH - #CA-002-04
EPA Asbestos Project Designer
COEH - #CA-002-10

Douglas R. Colley
EPA Asbestos Building Inspector/Management Planner
CAL, INC. - #AC-38517
EPA Asbestos Contractor Supervisor
CAL, INC. - #AC-35752
EPA Asbestos Project Designer
CAL, INC. - #AC-36187


Douglas R. Colley
DOSH CAC # 92-0222

FUNCTIONAL SPACE NOTES

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: Building A - Admin & Classrooms Room: 100 - Conference Room						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive <i>Comment: North wall only, below windows.</i>	MISC	None Detected	6	6A	12 ln	
Walls: Drywall & Joint Compound #1 (Old) <i>Comment: North, South, & West Walls</i>	MISC	None Detected	2	2A	810 sq	
Walls: Drywall & Joint Compound #2 (New) <i>Comment: Applied over drywall & joint compound. Material Comment: Installed 2006</i>	MISC	None Detected	3		270 sq	
Walls: Knockdown Texture Coat #1 (Old) <i>Comment: Applied over drywall & joint compound.</i>	SURF	None Detected	1	1A	810 sq	
Walls: Knockdown Texture Coat #2 (New) <i>Comment: East wall only. Material Comment: Installed 2006 and has finer rough surface.</i>	SURF	None Detected	5	5A	270 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4		504 sq	
Building: Building A - Admin & Classrooms Room: 101 - Office						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive <i>Comment: North, East, & South walls.</i>	MISC	None Detected	6		39 ln	
Walls: Drywall & Joint Compound #1 (Old) <i>Comment: North, East & South walls.</i>	MISC	None Detected	2		468 sq	
Walls: Drywall & Joint Compound #2 (New) <i>Comment: West wall only. Material Comment: Installed 2006</i>	MISC	None Detected	3		156 sq	
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		624 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4		168 sq	
Building: Building A - Admin & Classrooms Room: 102 - Shelly						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		46 ln	
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		552 sq	
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		552 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4	4A	130 sq	

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matri #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: <u>Building A - Admin & Classrooms</u> Room: <u>103 - SOA</u>						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		90 ln	
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		1080 sq	
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		1080 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4		476 sq	
Building: <u>Building A - Admin & Classrooms</u> Room: <u>104 - SRO/Probation</u>						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6	6B	51 ln	
<i>Comment: East half of north wall, entire east and south wall.</i>						
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		594 sq	
<i>Comment: East half of north wall, entire east and south walls.</i>						
Walls: Drywall & Joint Compound #2 (New)	MISC	None Detected	3	3A	198 sq	
<i>Comment: Entire west wall and west half of north wall. Material Comment: Installed 2006</i>						
Walls: Knockdown Texture Coat #1 (Old)	SURF	None Detected	1	1B	356 sq	
<i>Comment: Entire south wall.</i>						
Walls: Knockdown Texture Coat #2 (New)	SURF	None Detected	5		198 sq	
<i>Comment: Entire west wall and west half of north wall. Material Comment: Installed 2006 and has finer rough surface.</i>						
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		238 sq	
<i>Comment: Entire east wall and east half of north wall.</i>						
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4		200 sq	
Building: <u>Building A - Admin & Classrooms</u> Room: <u>105 - Assembly Room</u>						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		200 ln	
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		3000 sq	
Walls: Skip Trowel Texture Coat	SURF	None Detected	7	1C, 7C	3000 sq	
Ceiling: Fiberglass Insulation w/poly liner	NON	Non-Suspect				
<i>Comment: Ceiling is the underside of roof substrate.</i>						

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: <u>Building A - Admin & Classrooms</u>							
Building Comment: <u>Renovations Completed 2006</u>							
Materials	Material Class	Percent Asbestos	Hmngs Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No	
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>105 - Hall (West)</u>					
Floor: Concrete	NON	Non-Suspect					
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		468 sq		
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4		144 sq		
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>106 - Classroom</u>					
Floor: Concrete	NON	Non-Suspect					
Floor: Floor Leveling Compound (Gray) <i>Comment: At entry of north door.</i>	MISC	None Detected	8	8A	10 sq		
Floor: Flooring Adhesive (Yellow)	MISC	None Detected	9	9A	714 sq		
Baseboard: Basecove Adhesive	MISC	None Detected	6	6C	110 ln		
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2	2B	1100 sq		
Walls: Knockdown Texture Coat #1 (Old)	SURF	None Detected	1	1D	1100 sq		
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4	4B	714 sq		
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>107 - Hall (East)</u>					
Floor: Concrete	NON	Non-Suspect					
Floor: Flooring Adhesive (Yellow)	MISC	None Detected	9	9B	160 sq		
Baseboard: Basecove Adhesive	MISC	None Detected	6		17 ln		
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		420 sq		
Walls: Knockdown Texture Coat #1 (Old)	SURF	None Detected	1		420 sq		
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4		160 sq		
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>108 - Counselor Office</u>					
Floor: Concrete	NON	Non-Suspect					
Walls: Drywall & Joint Compound #2 (New) <i>Comment: Installed 2006</i>	MISC	None Detected	3	3B	504 sq		
Walls: Knockdown Texture Coat #1 (Old)	SURF	None Detected	1		504 sq		
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC	None Detected	4		104 sq		

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
-----------	----------------	------------------	---------------	---------------	--------------------	-----------------

Building: <u>Building A - Admin & Classrooms</u>	Room: <u>109 - SDC</u>
Floor: Concrete	NON Non-Suspect
Floor: Flooring Adhesive (Yellow)	MISC None Detected 9 252 sq
Baseboard: Basecove Adhesive	MISC None Detected 6 13 ln
<i>Comment: North and west walls only.</i>	
Walls: Drywall & Joint Compound #1 (Old)	MISC None Detected 2 2C 640 sq
Walls: Knockdown Texture Coat #2 (New)	SURF None Detected 5 5C 640 sq
<i>Comment: Installed 2006 and has finer rough surface.</i>	
Ceiling: 2' X 4' Lay-in Ceiling Panels	MISC None Detected 4 252 sq

Building: <u>Building A - Admin & Classrooms</u>	Room: <u>110 - Womens Restroom</u>
Floor: Linoleum Sheeting (Mottled White)	MISC None Detected 10 10A 49 sq
Baseboard: Basecove Adhesive	MISC None Detected 6 28 ln
Walls: Drywall & Joint Compound #1 (Old)	MISC None Detected 2 168 sq
<i>Comment: North, East, and West walls only.</i>	
Walls: Drywall & Joint Compound (Original)	MISC <1 - 2 % Ch 27 56 sq No
<i>Comment: South wall only. Material Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>	
Walls: Skip Trowel Texture Coat	SURF None Detected 7 224 sq
Ceiling: Drywall & Joint Compound #1 (Old)	MISC None Detected 2 49 sq
Ceiling: Skip Trowel Texture Coat	SURF None Detected 7 49 sq

Building: <u>Building A - Admin & Classrooms</u>	Room: <u>111 - Mens Restroom</u>
Floor: Concrete	NON Non-Suspect
Baseboard: Basecove Adhesive	MISC None Detected 6 28 ln
Walls: Drywall & Joint Compound #1 (Old)	MISC None Detected 2 168 sq
<i>Comment: North, East, and West walls only.</i>	
Walls: Drywall & Joint Compound (Original)	MISC <1 - 2 % Ch 27 56 sq No
<i>Comment: South wall only. Material Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>	
Walls: Skip Trowel Texture Coat	SURF None Detected 7 224 sq
Ceiling: Drywall & Joint Compound #1 (Old)	MISC None Detected 2 49 sq
Ceiling: Skip Trowel Texture Coat	SURF None Detected 7 49 sq

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>112 - SDC</u>				
Floor: Concrete	NON	Non-Suspect				
Floor: Flooring Adhesive (Yellow)	MISC	None Detected	9		324 sq	
Baseboard: Basecove Adhesive	MISC	None Detected	6		24 ln	
<i>Comment: South and west walls only.</i>						
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2	2D	540 sq	
Walls: Drywall & Joint Compound #2 (New)	MISC	None Detected	3		180 sq	
<i>Comment: North and west walls under and above window cut outs. Material Comment: Installed 2006</i>						
Walls: Knockdown Texture Coat #1 (Old)	SURF	None Detected	1	1E	540 sq	
Walls: Knockdown Texture Coat #2 (New)	SURF	None Detected	5	5B	180 sq	
<i>Comment: North and west walls under and above window cut outs. Material Comment: Installed 2006 and has finer rough surface.</i>						
Ceiling: 2' X 4' Lay-In Ceiling Panels	MISC	None Detected	4	4C	324 sq	

Building: <u>Building A - Admin & Classrooms</u>		Room: <u>113 - Uni Restroom</u>				
Floor: Linoleum Sheeting (Gray w/Blue Specs)	MISC	None Detected	11		60 sq	
Baseboard: Linoleum Sheeting (Gray w/Blue Specs)	MISC	None Detected	11		32 ln	
Walls: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		256 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Walls: Marlite Panels (Marble Pattern)	NON	Non-Suspect				
<i>Comment: Applied on all wall surfaces.</i>						
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		256 sq	
Ceiling: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		60 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Ceiling: Skip Trowel Texture Coat	SURF	None Detected	7		60 sq	

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgn's Matri #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: <u>Building A - Admin & Classrooms</u> Room: <u>114 - Electrical Room</u>						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Mastic (Brown)	MISC	<1 - 1 % Tr	12	12A	18 ln	No
<i>Comment: North, west and south walls only. Material count of the sample was performed.</i>						
Walls: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		224 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		224 sq	
Ceiling: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		45 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Ceiling: Skip Trowel Texture Coat	SURF	None Detected	7		45 sq	
Building: <u>Building A - Admin & Classrooms</u> Room: <u>115 - Storage Room</u>						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		74 ln	
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		1110 sq	
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		1110 sq	
Ceiling: Fiberglass Insulation w/poly liner	NON	Non-Suspect				
<i>Comment: Ceiling is the underside of roof substrate.</i>						
Building: <u>Building A - Admin & Classrooms</u> Room: <u>116 - Storage Closet</u>						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		20 ln	
Walls: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		140 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		140 sq	
Ceiling: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		24 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Ceiling: Skip Trowel Texture Coat	SURF	None Detected	7		24 sq	

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
-----------	----------------	------------------	---------------	---------------	--------------------	-----------------

Building: <u>Building A - Admin & Classrooms</u>		Room: <u>117 - Utility Room</u>				
Floor:	Linoleum Sheeting (Gray w/Blue Specs)	MISC	None Detected	11	50 sq	
Baseboard:	Linoleum Sheeting (Gray w/Blue Specs)	MISC	None Detected	11	30 ln	
Walls:	Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27	210 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Walls:	Marlite Panels (Marble Pattern)	NON	Non-Suspect			
<i>Comment: Applied on all wall surfaces.</i>						
Walls:	Skip Trowel Texture Coat	SURF	None Detected	7	210 sq	
Ceiling:	Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27	50 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Ceiling:	Skip Trowel Texture Coat	SURF	None Detected	7	50 sq	

Building: <u>Building A - Admin & Classrooms</u>		Room: <u>118 - Kitchen</u>				
Floor:	Concrete	NON	Non-Suspect			
Baseboard:	Linoleum Sheeting (Gray w/Blue Specs)	MISC	None Detected	11	100 ln	
Walls:	Drywall & Joint Compound #1 (Old)	MISC	None Detected	2	1500 sq	
Walls:	Skip Trowel Texture Coat	SURF	None Detected	7	1500 sq	
Ceiling:	Fiberglass Insulation w/poly liner	NON	Non-Suspect			
<i>Comment: Ceiling is the underside of roof substrate.</i>						

Building: <u>Building A - Admin & Classrooms</u>		Room: <u>119 - Hall</u>				
Floor:	Concrete	NON	Non-Suspect			
Walls:	Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27	450 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Ceiling:	Wood	NON	Non-Suspect			

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgs Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: Building A - Admin & Classrooms Room: 120 - Hall						
Floor: Linoleum Sheeting (Gray w/Blue Specs)	MISC	None Detected	11	11A	32 sq	
Baseboard: Basecove Adhesive	MISC	None Detected	6		8 ln	
Walls: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		168 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Walls: Marlite Panels (Gray)	NON	Non-Suspect				
<i>Comment: North half of east wall.</i>						
Walls: Skip Trowel Texture Coat	SURF	None Detected	7		168 sq	
Ceiling: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		32 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Ceiling: Skip Trowel Texture Coat	SURF	None Detected	7		32 sq	
Building: Building A - Admin & Classrooms Room: 121 - Storage Room						
Floor: Carpet Glue (Yellow)	MISC	None Detected	15		20 sq	
Floor: Concrete	NON	Non-Suspect				
Walls: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		576 sq	No
<i>Comment: No texture on walls. Material Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Ceiling: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		144 sq	No
<i>Comment: No texture on ceiling. Material Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Building: Building A - Admin & Classrooms Room: 122 - Storage Room						
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		34 ln	
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2	2E	357 sq	
<i>Comment: East, west, and south walls.</i>						
Walls: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		153 sq	No
<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Walls: Skip Trowel Texture Coat	SURF	None Detected	7	7A, 7B	1110 sq	
Ceiling: Fiberglass Insulation w/poly liner	NON	Non-Suspect				
<i>Comment: Ceiling is the underside of roof substrate.</i>						

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms
Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgn's Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>123 - Classroom</u>				
Floor: Carpet Glue (Yellow)	MISC	None Detected	15	15A	576 sq	
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		50 ln	
<i>Comment: South and west and west most north wall.</i>						
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		902 sq	
<i>Comment: All walls not associated with Storage Room 121.</i>						
Walls: Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		250 sq	No
<i>Comment: Walls associated with Storage Room 121 only. Material Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Walls: Knockdown Texture Coat #1 (Old)	SURF	None Detected	1		1152 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panel (New)	MISC	None Detected	16	16A	576 sq	
<i>Comment: Installed 2006</i>						

Building: <u>Building A - Admin & Classrooms</u>		Room: <u>124 - Classroom</u>				
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		76 ln	
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		912 sq	
Walls: Knockdown Texture Coat #1 (Old)	SURF	None Detected	1	1F	912 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panel (New)	MISC	None Detected	16		352 sq	
<i>Comment: Installed 2006</i>						

Building: <u>Building A - Admin & Classrooms</u>		Room: <u>125 - Classroom</u>				
Floor: Concrete	NON	Non-Suspect				
Baseboard: Basecove Adhesive	MISC	None Detected	6		84 ln	
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		1008 sq	
Walls: Knockdown Texture Coat #1 (Old)	SURF	None Detected	1	1G	1008 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panel (New)	MISC	None Detected	16		440 sq	
<i>Comment: Installed 2006</i>						

Building: <u>Building A - Admin & Classrooms</u>		Room: <u>126 - Elec/Mech Room</u>				
Floor: Concrete	NON	Non-Suspect				
Walls: Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		216 sq	
Walls: Wood Panel	NON	Non-Suspect				
Ceiling: Wood Panel	NON	Non-Suspect				

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials		Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>127 - Storage Room</u>					
Floor:	Linoleum Sheeting (Mottled Beige)	MISC	None Detected	17	17A	81 sq	
Baseboard:	Linoleum Sheeting (Mottled Beige)	MISC	None Detected	17		36 ln	
Walls:	Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		288 sq	
Walls:	Knockdown Texture Coat #1 (Old)	SURF	None Detected	1		288 sq	
Ceiling:	Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		81 sq	
Ceiling:	Knockdown Texture Coat #1 (Old)	SURF	None Detected	1		81 sq	
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>128 - Toilet</u>					
Floor:	Linoleum Sheeting (Mottled Beige)	MISC	None Detected	17		81 sq	
Baseboard:	Linoleum Sheeting (Mottled Beige)	MISC	None Detected	17		36 ln	
Walls:	Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		288 sq	
Walls:	Knockdown Texture Coat #1 (Old)	SURF	None Detected	1		288 sq	
Ceiling:	Drywall & Joint Compound #1 (Old)	MISC	None Detected	2		81 sq	
Ceiling:	Knockdown Texture Coat #1 (Old)	SURF	None Detected	1		81 sq	
Building: <u>Building A - Admin & Classrooms</u>		Room: <u>300 - Mechanical Room Mezzanine</u>					
Floor:	12" Vinyl Floor Tile & Mastic (Yellow)	MISC	1 % Ch	13	13A	256 sq	No
	<i>Comment: Applied over wood flooring and under Beige Tiles. Material Comment: Brown with striations</i>						
Floor:	12" Vinyl Floor Tile (Beige) & Adhesive	MISC	None Detected	14	14A	256 sq	
	<i>Comment: Applied over 12" Brown Floor Tile. Material Comment: Beige in color</i>						
Floor:	Wood	NON	Non-Suspect				
Baseboard:	Basecove Mastic (Brown)	MISC	<1 - 1 % Tr	12		64 ln	No
	<i>Comment: Sample result indicated <1% Fibrous Tremolite but no point count of the sample was performed.</i>						
Walls:	Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27	02F	448 sq	No
	<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Walls:	Skip Trowel Texture Coat	SURF	None Detected	7		448 sq	
Ceiling:	Drywall & Joint Compound (Original)	MISC	<1 - 2 % Ch	27		256 sq	No
	<i>Comment: 1-2% Asbestos found in joint compound only. <1% as a composite with drywall. Sample was not point counted.</i>						
Ceiling:	Skip Trowel Texture Coat	SURF	None Detected	7		256 sq	

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matri #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
-----------	----------------	------------------	---------------	---------------	--------------------	-----------------

Building: Building A - Admin & Classrooms

Room: 301 - Electrical Room Mezzanine

Floor: Wood NON Non-Suspect

Walls: Wood Panel NON Non-Suspect

Ceiling: Fiberglass Insulation w/poly liner NON Non-Suspect

Comment: Ceiling is underside of roof deck.

Building: Building A - Admin & Classrooms

Room: Attic

Floor: Fiberglass Batting Insulation NON Non-Suspect

Comment: Fiberglass batting is layed on top of all 2' X 4' Lay-in Ceiling Panels throughout building.

Walls: Drywall & Joint Compound #1 (Old) MISC None Detected 2

684 sq

Ceiling: Fiberglass Insulation w/poly liner NON Non-Suspect

Comment: Attached to underside of roof substrate.

Pipes: Metal NON Non-Suspect

Comment: All pipes are metal or plastic with no insulations applied.

Ducts: Metal NON Non-Suspect

Comment: All ducts are bare with no insulation.

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building B - Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matri #	Sampled Here?	Footage Friable? Sq/Ln/Jnts Yes/No
Building: Building B - Classrooms	Room: 200 - Classroom				
Floor: Concrete	NON	Non-Suspect			
Floor: Floor Level Compound (B - White) <i>Comment: Remnant scattered various locations of floor.</i>	MISC	None Detected	24	24A	7 sq
Floor: Flooring Adhesive (B - Yellow) <i>Comment: Remnant left from flooring material removal.</i>	MISC	None Detected	25	25A	34 sq
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		104 ln
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18		1040 sq
Walls: Knockdown Texture (B)	SURF	None Detected	19	19A, 19D	1040 sq
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20		672 sq

Building: Building B - Classrooms	Room: 201 - Office				
Floor: Concrete	NON	Non-Suspect			
Floor: Floor Level Compound (B - White) <i>Comment: Remnant scattered various locations of floor.</i>	MISC	None Detected	24		1 sq
Floor: Flooring Adhesive (B - Yellow) <i>Comment: Remnant left from flooring material removal.</i>	MISC	None Detected	25		10 sq
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		44 ln
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18	18A	440 sq
Walls: Knockdown Texture (B)	SURF	None Detected	19		440 sq
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20		120 sq

Building: Building B - Classrooms	Room: 202 - Inst. Aide Work Room				
Floor: Concrete	NON	Non-Suspect			
Floor: Floor Level Compound (B - White) <i>Comment: Remnant scattered various locations of floor.</i>	MISC	None Detected	24		1 sq
Floor: Flooring Adhesive (B - Yellow) <i>Comment: Remnant left from flooring material removal.</i>	MISC	None Detected	25		10 sq
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		44 ln
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18		440 sq
Walls: Knockdown Texture (B)	SURF	None Detected	19		440 sq
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20		120 sq

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building B - Classrooms

Building Comment: *Renovations Completed 2006*

Materials	Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
-----------	----------------	------------------	---------------	---------------	--------------------	-----------------

Building: <u>Building B - Classrooms</u>		Room: <u>203A - Toilet Hallway</u>				
Floor:	Concrete	NON	Non-Suspect			
Baseboard:	Basecove Mastic (B)	MISC	None Detected	21		42 ln
Walls:	Drywall & Joint Compound (B)	MISC	None Detected	18		336 sq
Walls:	Knockdown Texture (B)	SURF	None Detected	19		336 sq
Ceiling:	Drywall & Joint Compound (B)	MISC	None Detected	18		90 sq
Ceiling:	Knockdown Texture (B)	SURF	None Detected	19		90 sq

Building: <u>Building B - Classrooms</u>		Room: <u>203B - Toilet (North)</u>				
Floor:	Floor Level Compound (B - White)	MISC	None Detected	24		1 sq
<i>Comment: Assumed to be scattered over floor in various areas.</i>						
Floor:	Linoleum Sheeting (B - Leaf Pattern)	MISC	None Detected	22	22A	49 sq
Baseboard:	Linoleum Sheeting (B - Leaf Pattern)	MISC	None Detected	22		28 ln
Walls:	Drywall & Joint Compound (B)	MISC	None Detected	18		224 sq
Walls:	Knockdown Texture (B)	SURF	None Detected	19		224 sq
Ceiling:	Drywall & Joint Compound (B)	MISC	None Detected	18		49 sq
Ceiling:	Knockdown Texture (B)	SURF	None Detected	19		49 sq

Building: <u>Building B - Classrooms</u>		Room: <u>203C - Toilet (South)</u>				
Floor:	Floor Level Compound (B - White)	MISC	None Detected	24		1 sq
<i>Comment: Assumed to be scattered over floor in various areas.</i>						
Floor:	Linoleum Sheeting (B - Leaf Pattern)	MISC	None Detected	22		49 sq
Baseboard:	Linoleum Sheeting (B - Leaf Pattern)	MISC	None Detected	22		28 ln
Walls:	Drywall & Joint Compound (B)	MISC	None Detected	18		224 sq
Walls:	Knockdown Texture (B)	SURF	None Detected	19		224 sq
Ceiling:	Drywall & Joint Compound (B)	MISC	None Detected	18		49 sq
Ceiling:	Knockdown Texture (B)	SURF	None Detected	19		49 sq

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building B - Classrooms
Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: <u>Building B - Classrooms</u>		Room: <u>204 - Toilet</u>				
Floor: Concrete	NON	Non-Suspect				
<i>Comment: In sink area only.</i>						
Floor: Linoleum Sheeting (B - Beige w/specs)	MISC	None Detected	26		72 sq	
<i>Comment: Located in stalls only.</i>						
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		30 ln	
<i>Comment: Observed in sink area only.</i>						
Baseboard: Linoleum Sheeting (B - Beige w/specs)	MISC	None Detected	26		24 ln	
<i>Comment: Located in stalls only.</i>						
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18		540 sq	
Walls: Knockdown Texture (B)	SURF	None Detected	19		540 sq	
Ceiling: Drywall & Joint Compound (B)	MISC	None Detected	18		180 sq	
Ceiling: Knockdown Texture (B)	SURF	None Detected	19		180 sq	

Building: <u>Building B - Classrooms</u>		Room: <u>205 - Hall</u>				
Floor: Concrete	NON	Non-Suspect				
Floor: Flooring Adhesive (B - Yellow)	MISC	None Detected	25		5 sq	
<i>Comment: Remnant left from flooring material removal.</i>						
Floor: Linoleum Sheeting (B - Beige w/specs)	MISC	None Detected	26	26A	10 sq	
<i>Comment: Located under walls of room.</i>						
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		56 ln	
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18	18D	560 sq	
Walls: Knockdown Texture (B)	SURF	None Detected	19	19C	560 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20	20B	160 sq	

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building B - Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matri #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: Building B - Classrooms	Room: 206 - Day Room					
Floor: Concrete	NON	Non-Suspect				
Floor: Flooring Adhesive (B - Yellow)	MISC	None Detected	25		5 sq	
<i>Comment: Remnant left from flooring material removal.</i>						
Floor: Linoleum Sheeting (B - Remnant)	MISC	None Detected	23	23A	20 sq	
<i>Comment: Under walls and existing cabinetry on west wall.</i>						
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		66 ln	
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18	18C	660 sq	
Walls: Knockdown Texture (B)	SURF	None Detected	19	19B	660 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20		260 sq	

Building: Building B - Classrooms	Room: 207 - Conference Room					
Floor: Concrete	NON	Non-Suspect				
Floor: Floor Level Compound (B - White)	MISC	None Detected	24		1 sq	
<i>Comment: Remnant scattered various locations of floor.</i>						
Floor: Flooring Adhesive (B - Yellow)	MISC	None Detected	25		10 sq	
<i>Comment: Remnant left from flooring material removal.</i>						
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		50 ln	
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18	18B	500 sq	
Walls: Knockdown Texture (B)	SURF	None Detected	19		500 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20		156 sq	

Building: Building B - Classrooms	Room: 208 - Classroom					
Floor: Concrete	NON	Non-Suspect				
Floor: Flooring Adhesive (B - Yellow)	MISC	None Detected	25		5 sq	
<i>Comment: Remnant left from flooring material removal.</i>						
Floor: Linoleum Sheeting (B - Beige w/specs)	MISC	None Detected	26		10 sq	
<i>Comment: Located under walls of room.</i>						
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		96 ln	
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18	18E	960 sq	
Walls: Knockdown Texture (B)	SURF	None Detected	19	19E	960 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20		560 sq	

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building B - Classrooms

Building Comment: Renovations Completed 2006

Materials	Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
Building: Building B - Classrooms		Room: 209 - Special Ed/Conference Room				
Floor: Concrete	NON	Non-Suspect				
Floor: Flooring Adhesive (B - Yellow) <i>Comment: Remnant left from flooring material removal.</i>	MISC	None Detected	25		5 sq	
Floor: Linoleum Sheeting (B - Beige w/specs) <i>Comment: Located under walls of room.</i>	MISC	None Detected	26		10 sq	
Baseboard: Basecove Mastic (B)	MISC	None Detected	21	21B	64 ln	
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18		640 sq	
Walls: Knockdown Texture (B)	SURF	None Detected	19	19F	640 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20		240 sq	

Building: Building B - Classrooms		Room: 210 - Classroom				
Floor: Carpet <i>Comment: Located under walls of room.</i>	NON	Non-Suspect				
Floor: Concrete	NON	Non-Suspect				
Floor: Flooring Adhesive (B - Yellow) <i>Comment: Remnant left from flooring material removal.</i>	MISC	None Detected	25		5 sq	
Baseboard: Basecove Mastic (B)	MISC	None Detected	21	21A	102 ln	
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18	18G	1020 sq	
Walls: Knockdown Texture (B)	SURF	None Detected	19	19H, 19I	1020 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20		620 sq	

Building: Building B - Classrooms		Room: 211 - Classroom				
Floor: Carpet <i>Comment: Located under walls of room.</i>	NON	Non-Suspect				
Floor: Concrete	NON	Non-Suspect				
Floor: Flooring Adhesive (B - Yellow) <i>Comment: Remnant left from flooring material removal.</i>	MISC	None Detected	25		5 sq	
Baseboard: Basecove Mastic (B)	MISC	None Detected	21		102 ln	
Walls: Drywall & Joint Compound (B)	MISC	None Detected	18	18F	1020 sq	
Walls: Knockdown Texture (B)	SURF	None Detected	19	19G	1020 sq	
Ceiling: 2' X 4' Lay-in Ceiling Panels (B)	MISC	None Detected	20	20A	620 sq	

Functional Space Notes

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

HMS Project Number: 06-133

Date of Inspection: March 29, 2006

Building: Building B - Classrooms

Building Comment: *Renovations Completed 2006*

Materials

Material Class	Percent Asbestos	Hmgns Matrl #	Sampled Here?	Footage Sq/Ln/Jnts	Friable? Yes/No
----------------	------------------	---------------	---------------	--------------------	-----------------

Building: Building B - Classrooms

Room: Attic

Floor: Fiberglass Batting Insulation NON Non-Suspect

Comment: Batting is laid on top of Lay-in ceiling panels.

Walls: Drywall & Joint Compound (B) MISC None Detected 18

1120 sq

Ceiling: Metal NON Non-Suspect

Ducts: Fiberglass (Foil Backed) Ducts NON Non-Suspect

Pipes: Metal NON Non-Suspect

Comment: No insulation on pipes observed.

HOMOGENEOUS MATERIALS RECORDS

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District
 Building: Building A - Admin & Classrooms
 Building Comment: Renovations Completed 2006

Site: Community Day School

Project #: 06-133
 Inspection Date: 3/29/2006

Material	Class	HMR	Sample Number(s)	Location	% Asbestos	Footage	Friable
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	100 - Conference Room - Walls	None Detected	810 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	104 - SRO/Probation - Walls Entire south wall.	None Detected	356 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	106 - Classroom - Walls	None Detected	1100 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	107 - Hall (East) - Walls	None Detected	420 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	108 - Counselor Office - Walls	None Detected	504 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	112 - SDC - Walls	None Detected	540 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	123 - Classroom - Walls	None Detected	1152 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	124 - Classroom - Walls	None Detected	912 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	125 - Classroom - Walls	None Detected	1008 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	127 - Storage Room - Walls/Ceiling	None Detected	369 Square	NO
Knockdown Texture Coat #1 (Old)	SURF	1	ECG-06-133- 1A, 1B, 1C, 1D, 1E, 1F, 1G	128 - Toilet - Walls/Ceiling	None Detected	369 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	100 - Conference Room - Walls North, South, & West Walls	None Detected	810 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	101 - Office - Walls North, East & South walls.	None Detected	468 Square	NO

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Site: Community Day School

Project #: 06-133

Inspection Date: 3/29/2006

Material	Class	HMR	Sample Number(s)	Location	% Asbestos	Footage	Friable
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	102 - Shelly - Walls	None Detected	552 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	103 - SOA - Walls	None Detected	1080 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	104 - SRO/Probation - Walls East half of north wall, entire east and south walls.	None Detected	594 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	105 - Assembly Room - Walls	None Detected	3000 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	105 - Hall (West) - Walls	None Detected	468 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	106 - Classroom - Walls	None Detected	1100 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	107 - Hall (East) - Walls	None Detected	420 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	109 - SDC - Walls	None Detected	640 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	110 - Womens Restroom - Walls/Ceiling North, East, and West walls only.	None Detected	217 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	111 - Mens Restroom - Walls/Ceiling North, East, and West walls only.	None Detected	217 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	112 - SDC - Walls	None Detected	540 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	115 - Storage Room - Walls	None Detected	1110 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133- 2A, 2B, 2C, 2D, 2E	118 - Kitchen - Walls	None Detected	1500 Square	NO

Date Printed: 4/12/2006

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District Site: Community Day School Project #: 06-133

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Inspection Date: 3/29/2006

Material	Class	HMR	Sample Number(s)	Location	% Asbestos	Footage	Friable
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133-2A, 2B, 2C, 2D, 2E	122 - Storage Room - Walls East, west, and south walls.	None Detected	357 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133-2A, 2B, 2C, 2D, 2E	123 - Classroom - Walls All walls not associated with Storage Room 121.	None Detected	902 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133-2A, 2B, 2C, 2D, 2E	124 - Classroom - Walls	None Detected	912 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133-2A, 2B, 2C, 2D, 2E	125 - Classroom - Walls	None Detected	1008 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133-2A, 2B, 2C, 2D, 2E	126 - Elec/Mech Room - Walls	None Detected	216 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133-2A, 2B, 2C, 2D, 2E	127 - Storage Room - Walls/Ceiling	None Detected	369 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133-2A, 2B, 2C, 2D, 2E	128 - Toilet - Walls/Ceiling	None Detected	369 Square	NO
Drywall & Joint Compound #1 (Old)	MISC	2	ECG-06-133-2A, 2B, 2C, 2D, 2E	Attic - Walls	None Detected	684 Square	NO
Drywall & Joint Compound #2 (New)	MISC	3	ECG-06-133-3A, 3B	100 - Conference Room - Walls Applied over drywall & joint compound.	None Detected	270 Square	NO
Drywall & Joint Compound #2 (New)	MISC	3	ECG-06-133-3A, 3B	101 - Office - Walls West wall only.	None Detected	156 Square	NO
Drywall & Joint Compound #2 (New)	MISC	3	ECG-06-133-3A, 3B	104 - SRO/Probation - Walls Entire west wall and west half of north wall.	None Detected	198 Square	NO
Drywall & Joint Compound #2 (New)	MISC	3	ECG-06-133-3A, 3B	108 - Counselor Office - Walls	None Detected	504 Square	NO

Homogeneous Material Records

Entek Consulting Group, Inc.

Project #: 06-133
Inspection Date: 3/29/2006

Client: Chico Unified School District
Building: Building A - Admin & Classrooms
Building Comment: Renovations Completed 2006

Site: Community Day School

Material	Glass	HMR	Sample Number(s)	Location	% Asbestos	Footage	Frangible
Drywall & Joint Compound #2 (New)	MISC	3	ECG-06-133-3A, 3B	112 - SDC - Walls North and west walls under and above window cut outs.	None Detected	180 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	100 - Conference Room - Ceiling	None Detected	504 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	101 - Office - Ceiling	None Detected	168 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	102 - Shelly - Ceiling	None Detected	130 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	103 - SOA - Ceiling	None Detected	476 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	104 - SRO/Probation - Ceiling	None Detected	200 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	105 - Hall (West) - Ceiling	None Detected	144 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	106 - Classroom - Ceiling	None Detected	714 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	107 - Hall (East) - Ceiling	None Detected	160 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	108 - Counselor Office - Ceiling	None Detected	104 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	109 - SDC - Ceiling	None Detected	252 Square	NO
2' X 4' Lay-in Ceiling Panels	MISC	4	ECG-06-133-4A, 4B, 4C	112 - SDC - Ceiling	None Detected	324 Square	NO
Knockdown Texture Coat #2 (New)	SURF	5	ECG-06-133-5A, 5B, 5C	100 - Conference Room - Walls East wall only.	None Detected	270 Square	NO

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

Project #: 06-133

Building: Building A - Admin & Classrooms

Inspection Date: 3/29/2006

Building Comment: Renovations Completed 2006

Material	Class	HMR	Sample Number(s)	Location	% Asbestos	Footage	Friable
Knockdown Texture Coat #2 (New)	SURF	5	ECG-06-133-5A, 5B, 5C	104 - SRO/Probation - Walls Entire west wall and west half of north wall.	None Detected	198 Square	NO
Knockdown Texture Coat #2 (New)	SURF	5	ECG-06-133-5A, 5B, 5C	109 - SDC - Walls	None Detected	640 Square	NO
Knockdown Texture Coat #2 (New)	SURF	5	ECG-06-133-5A, 5B, 5C	112 - SDC - Walls North and west walls under and above window cut outs.	None Detected	180 Square	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	100 - Conference Room - Baseboard North wall only, below windows.	None Detected	12 Linear	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	101 - Office - Baseboard North, East, & South walls.	None Detected	39 Linear	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	102 - Shelly - Baseboard	None Detected	46 Linear	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	103 - SOA - Baseboard	None Detected	90 Linear	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	104 - SRO/Probation - Baseboard East half of north wall, entire east and south wall.	None Detected	51 Linear	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	105 - Assembly Room - Baseboard	None Detected	200 Linear	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	106 - Classroom - Baseboard	None Detected	110 Linear	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	107 - Hall (East) - Baseboard	None Detected	17 Linear	NO
Basecove Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	109 - SDC - Baseboard North and west walls only.	None Detected	13 Linear	NO

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

Project #: 06-133

Building: Building A - Admin & Classrooms

Inspection Date: 3/29/2006

Building Comment: Renovations Completed 2006

Material	Glass	HMR	Sample Number(s)	Location	% Asbestos	Footage	Frangible
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	110 - Womens Restroom - Baseboard	None Detected	28 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	111 - Mens Restroom - Baseboard	None Detected	28 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	112 - SDC - Baseboard South and west walls only.	None Detected	24 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	115 - Storage Room - Baseboard	None Detected	74 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	116 - Storage Closet - Baseboard	None Detected	20 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	120 - Hall - Baseboard	None Detected	8 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	122 - Storage Room - Baseboard	None Detected	34 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	123 - Classroom - Baseboard South and west and west most north wall.	None Detected	50 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	124 - Classroom - Baseboard	None Detected	76 Linear	NO
Basecoat Adhesive	MISC	6	ECG-06-133-6A, 6B, 6C	125 - Classroom - Baseboard	None Detected	84 Linear	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	101 - Office - Walls	None Detected	624 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	102 - Shelly - Walls	None Detected	552 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	103 - SOA - Walls	None Detected	1080 Square	NO

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Site: Community Day School

Project #: 06-133

Inspection Date: 3/29/2006

Material	Class	HMR	Sample Number(s)	Location	% Asbestos	Footage	Friable
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	104 - SRO/Probation - Walls	None Detected	238 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	Entire east wall and east half of north wall. 105 - Assembly Room - Walls	None Detected	3000 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	110 - Womens Restroom - Walls/Ceiling	None Detected	273 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	111 - Mens Restroom - Walls/Ceiling	None Detected	273 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	113 - Uni Restroom - Walls/Ceiling	None Detected	316 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	114 - Electrical Room - Walls/Ceiling	None Detected	269 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	115 - Storage Room - Walls	None Detected	1110 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	116 - Storage Closet - Walls/Ceiling	None Detected	164 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	117 - Utility Room - Walls/Ceiling	None Detected	260 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	118 - Kitchen - Walls	None Detected	1500 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	120 - Hall - Walls/Ceiling	None Detected	200 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	122 - Storage Room - Walls	None Detected	1110 Square	NO
Skip Trowel Texture Coat	SURF	7	ECG-06-133-7A, 7B, 7C	300 - Mechanical Room Mezzanine - Walls/Ceiling	None Detected	704 Square	NO
Floor Leveling Compound (Gray)	MISC	8	ECG-06-133-8A	106 - Classroom - Floor At entry of north door.	None Detected	10 Square	NO

Date Printed: 4/12/2006

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

Project #: 06-133

Building: Building A - Admin & Classrooms

Inspection Date: 3/29/2006

Building Comment: Renovations Completed 2006

Material	Glass	HMR	Sample Number(s)	Location	% Asbestos	Footage	Frangible
Flooring Adhesive (Yellow)	MISC	9	ECG-06-133-9A, 9B	106 - Classroom - Floor	None Detected	714 Square	NO
Flooring Adhesive (Yellow)	MISC	9	ECG-06-133-9A, 9B	107 - Hall (East) - Floor	None Detected	160 Square	NO
Flooring Adhesive (Yellow)	MISC	9	ECG-06-133-9A, 9B	109 - SDC - Floor	None Detected	252 Square	NO
Flooring Adhesive (Yellow)	MISC	9	ECG-06-133-9A, 9B	112 - SDC - Floor	None Detected	324 Square	NO
Linoleum Sheeting (Mottled White)	MISC	10	ECG-06-133-10A	110 - Womens Restroom - Floor	None Detected	49 Square	NO
Linoleum Sheeting (Gray w/Blue Specs)	MISC	11	ECG-06-133-11A	113 - Uni Restroom - Floor/Baseboard	None Detected	92 Square	NO
Linoleum Sheeting (Gray w/Blue Specs)	MISC	11	ECG-06-133-11A	117 - Utility Room - Floor/Baseboard	None Detected	80 Square	NO
Linoleum Sheeting (Gray w/Blue Specs)	MISC	11	ECG-06-133-11A	118 - Kitchen - Baseboard	None Detected	100 Linear	NO
Linoleum Sheeting (Gray w/Blue Specs)	MISC	11	ECG-06-133-11A	120 - Hall - Floor	None Detected	32 Square	NO
Basecove Mastic (Brown)	MISC	12	ECG-06-133-12A	114 - Electrical Room - Baseboard	<1 - 1 %	18 Linear	NO
Basecove Mastic (Brown)	MISC	12	ECG-06-133-12A	300 - Mechanical Room Mezzanine - Baseboard	<1 - 1 %	64 Linear	NO
12" Vinyl Floor Tile & Mastic (Yellow)	MISC	13	ECG-06-133-13A	300 - Mechanical Room Mezzanine - Floor	1 %	256 Square	NO
12" Vinyl Floor Tile (Beige) & Adhesive	MISC	14	ECG-06-133-14A	Applied over wood flooring and under Beige Tiles. 300 - Mechanical Room Mezzanine - Floor	None Detected	256 Square	NO

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District

Site: Community Day School

Project #: 06-133

Building: Building A - Admin & Classrooms

Inspection Date: 3/29/2006

Building Comment: Renovations Completed 2006

Material	Class	HMR	Sample Number(s)	Location	% Asbestos	Footage	Frangible
Carpet Glue (Yellow)	MISC	15	ECG-06-133-15A	121 - Storage Room - Floor	None Detected	20 Square	NO
Carpet Glue (Yellow)	MISC	15	ECG-06-133-15A	123 - Classroom - Floor	None Detected	576 Square	NO
2' X 4' Lay-in Ceiling Panel (New)	MISC	16	ECG-06-133-16A	123 - Classroom - Ceiling	None Detected	576 Square	NO
2' X 4' Lay-in Ceiling Panel (New)	MISC	16	ECG-06-133-16A	124 - Classroom - Ceiling	None Detected	352 Square	NO
2' X 4' Lay-in Ceiling Panel (New)	MISC	16	ECG-06-133-16A	125 - Classroom - Ceiling	None Detected	440 Square	NO
Linoleum Sheetting (Mottled Beige)	MISC	17	ECG-06-133-17A	127 - Storage Room - Floor/Baseboard	None Detected	117 Square	NO
Linoleum Sheetting (Mottled Beige)	MISC	17	ECG-06-133-17A	128 - Toilet - Floor/Baseboard	None Detected	117 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	110 - Womens Restroom - Walls South wall only.	<1 - 2 %	56 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	111 - Mens Restroom - Walls South wall only.	<1 - 2 %	56 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	113 - Uni Restroom - Walls/Ceiling	<1 - 2 %	316 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	114 - Electrical Room - Walls/Ceiling	<1 - 2 %	269 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	116 - Storage Closet - Walls/Ceiling	<1 - 2 %	164 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	117 - Utility Room - Walls/Ceiling	<1 - 2 %	260 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	119 - Hall - Walls	<1 - 2 %	450 Square	NO

Date Printed: 4/12/2006

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District

Building: Building A - Admin & Classrooms

Building Comment: Renovations Completed 2006

Site: Community Day School

Project #: 06-133

Inspection Date: 3/29/2006

Material	Glass	HMR	Sample Number(s)	Location	% Asbestos	Footage	Frangible
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	120 - Hall - Walls/Ceiling	<1 - 2 %	200 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	121 - Storage Room - Walls/Ceiling	<1 - 2 %	720 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	No texture on walls. 122 - Storage Room - Walls	<1 - 2 %	153 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	123 - Classroom - Walls	<1 - 2 %	250 Square	NO
Drywall & Joint Compound (Original)	MISC	27	ECG-06-133-02F	Walls associated with Storage Room 121 only. 300 - Mechanical Room Mezzanine - Walls/Ceiling	<1 - 2 %	704 Square	NO
Concrete	NON	0	NOT SAMPLED	Various Locations	Non-Suspect		
Fiberglass Batting Insulation	NON	0	NOT SAMPLED	Attic - Floor	Non-Suspect	8800 Square	NO
Fiberglass Insulation w/poly liner	NON	0	NOT SAMPLED	Fiberglass batting is layed on top of all 2' X 4' Lay-in Ceiling Panels throughout building. Various Locations	Non-Suspect		
Marlite Panels (Gray)	NON	0	NOT SAMPLED	Ceiling is the underside of roof substrate. 120 - Hall - Walls	Non-Suspect	16 Square	NO
Marlite Panels (Marble Pattern)	NON	0	NOT SAMPLED	North half of east wall. Various Locations	Non-Suspect		
Metal	NON	0	NOT SAMPLED	Applied on all wall surfaces. Various Locations	Non-Suspect		
				All pipes are metal or plastic with no insulations applied.	Non-Suspect		

Date Printed: 4/12/2006

Homogeneous Material Records

Entek Consulting Group, Inc.

Client: Chico Unified School District
 Building: Building A - Admin & Classrooms
 Building Comment: Renovations Completed 2006

Site: Community Day School

Project #: 06-133
 Inspection Date: 3/29/2006

Material	Class	HMR	Sample Number(s)	Location	% Asbestos	Footage	Friable
Wood	NON	0	NOT SAMPLED	Various Locations	Non-Suspect		
Wood Panel	NON	0	NOT SAMPLED	Various Locations	Non-Suspect		