



Forensic Analytical
Analytical Report

San Francisco • 3777 Depot Road, Suite 409, Hayward, CA 94545 • Phone 510/887-8828 • Fax 510/887-4218
Los Angeles • 2959 Pacific Commerce Drive, Rancho Dominguez, CA 90221 • Phone 310/763-2374 • Fax 310 763-8084

Bulk Material Analysis
Method: 40 CFR 763, Subpart F, Appendix A (AHERA)

Client:
Chico Unified School District
Mr. Ron Jones
2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: 253614
Date Received: 05/08/96

P.O. Num:
Job ID: 96-4623
Site: Marigold - Units 1, 3 & 5

Sample Number	Lab Number	Total Asbestos	Total Fibrous Non-Asbestos	(Breakdown by type)
Gross Description/Comments				
I-008 Multilayered fibrous roofing material. Bulk complex sample.	19633581	Non-Det.%	45-50%	Cellulose (20-25%) Fibrous Glass (20-25%)
I-009 Multilayered fibrous roofing material. Bulk complex sample.	19633582	Non-Det.%	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)
I-010 Multilayered fibrous roofing material. Bulk complex sample.	19633583	Non-Det.%	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)
I-011 Multilayered fibrous roofing material. Bulk complex sample.	19633584	Non-Det.%	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)
I-012 Multilayered fibrous roofing material. Bulk complex sample.	19633585	Non-Det.%	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)
I-013 Multilayered fibrous roofing material. Bulk complex sample.	19633586	Non-Det.%	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)
I-014 Multilayered fibrous roofing material. Bulk complex sample.	19633587	Non-Det.%	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)
3-001 Multilayered fibrous roofing material. Bulk complex sample.	19633588	Non-Det.%	25-30%	Cellulose (5-10%) Fibrous Glass (15-20%)
3-002 Multilayered fibrous roofing material. Bulk complex sample.	19633589	Non-Det.%	20-25%	Cellulose (1-5%) Fibrous Glass (15-20%)


David Kahane, C.I.H., Laboratory Director, Hayward Laboratory

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full with approval from Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Samples submitted to Forensic Analytical are retained for a period of six months and then disposed of according to all state and federal guidelines.



Forensic Analytical
Analytical Report

San Francisco • 3777 Depot Road, Suite 409, Hayward, CA 94545 • Phone 510/887-8828 • Fax 510/887-4218
Los Angeles • 2959 Pacific Commerce Drive, Rancho Dominguez, CA 90221 • Phone 310/763-2374 • Fax 310/763-8684

Bulk Material Analysis
Method: 40 CFR 763, Subpart F, Appendix A (AHERA)

Client:
Chico Unified School District
Mr. Ron Jones
2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: 253614
Date Received: 05/08/96

P.O. Num:
Job ID: 96-4623
Site: Marigold - Units 1, 3 & 5

Sample Number	Lab Number	Total Asbestos	Total Fibrous Non-Asbestos	(Breakdown by type)
Gross Description/Comments				
3-003 Multilayered fibrous roofing material. Bulk complex sample.	19633590	Non-Det. %	15-20%	Cellulose (Trace%) Fibrous Glass (15-20%)
5-004 Multilayered fibrous roofing material. Bulk complex sample.	19633591	Non-Det. %	20-25%	Cellulose (1-5%) Fibrous Glass (15-20%)
5-005 Multilayered fibrous roofing material. Bulk complex sample.	19633592	Non-Det. %	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)
5-006 Multilayered fibrous roofing material. Bulk complex sample.	19633593	Non-Det. %	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)
5-007 Multilayered fibrous roofing material. Bulk complex sample.	19633594	Non-Det. %	20-25%	Cellulose (Trace%) Fibrous Glass (20-25%)

David Kahane, C.I.H., Laboratory Director, Hayward Laboratory

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full with approval from Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Samples submitted to Forensic Analytical are retained for a period of six months and then disposed of according to all state and federal guidelines.



Forensic Analytical

BULK SAMPLE REQUEST FORM

CLIENT NAME & ADDRESS: 2921 Chico Unified School District 2455 Carmichael Drive Chico, CA 95928		PHONE:	DATE: 5-7-96
		Circle the Method and Turn Around Time	Results Needed: Friday Noon
		____ hr/12hr/24hr/48hr/Ext	
		PLM <u>Standard</u> / Point Count	Gravimetry Prep
CONTACT: Ron Jones		TEM: QUAL. / QUANT. / WATER	
P.O.# 96-4623	JOB #	AA/Flame AA/Furnace ICP	
SITE: Marigold Unit 1		METALS:	

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
1-008	5-6-96	Roof over unit 1 - NW corner
1-009	"	Roof over Unit 1 - ^{North} Center by Ridge
1-010	"	Roof over Unit 1 - N.E. side
1-011	"	Roof over Unit 1 - by Restrooms
1-012	"	Roof over Unit 1 - by Restrooms
1-013	"	Roof over Unit 1 - South Ridge
1-014	"	Roof over Unit 1 - S.W. Side
		Please analyse all samples by layer

Sampled by: Ron Jones	Date: 5-6-96 Time: 10:30
Relinquished by: Ron Jones	Received By: UPS
Date/Time: 5-7-96 10:30 AM	Date/Time: Sealed Condition (circle one) YES / NO
Relinquished by:	Received By: <u>ST/CA</u>
Date/Time:	Date/Time: Sealed Condition (circle one) YES / NO



Forensic Analytical

BULK SAMPLE REQUEST FORM


CLIENT NAME & ADDRESS: 2921 Chico Unified School District 2455 Carmichael Drive Chico, CA 95928	PHONE:	DATE: 5-7-96
	Circle the Method and Turn Around Time	Results Needed: Friday Noon
	____ hr/12hr/24hr/48hr/Ext	
	PLM <u>Standard</u> / Point Count	Gravimetry Prep
CONTACT: Ron Jones		TEM: QUAL. / QUANT. / WATER
P.O.# 96-4623	JOB #	AA/Flame AA/Furnace ICP
SITE: Marigold-Units 3 & 5		METALS:

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
3-001	5-6-96	Roof over Unit 3-South Ridge
3-002	"	Roof over Unit 3-West side
3-003	"	Roof over Unit 3-S.W. Corner
5-004	"	Roof over Unit 5-North side
5-005	"	Roof over Unit 5-Center Ridge
5-006	"	Roof over Unit 5-Office Area
5-007	"	Roof over Unit 5-S.E. Corner
		Please analyse all samples by layer

Sampled by: Ron Jones	Date: 5-6-96 Time: 10:00
Relinquished by: Ron Jones	Received By: UPS
Date/Time: 5-7-96 10:30AM	Date/Time:
	Sealed Condition (circle one) YES / NO
Relinquished by:	Received By: <i>[Signature]</i>
Date/Time:	Date/Time: 5/8/96
	Sealed Condition (circle one) YES / NO

Roofing Samples 5-6-96

MARIGOLD SCHOOL, 1995-96

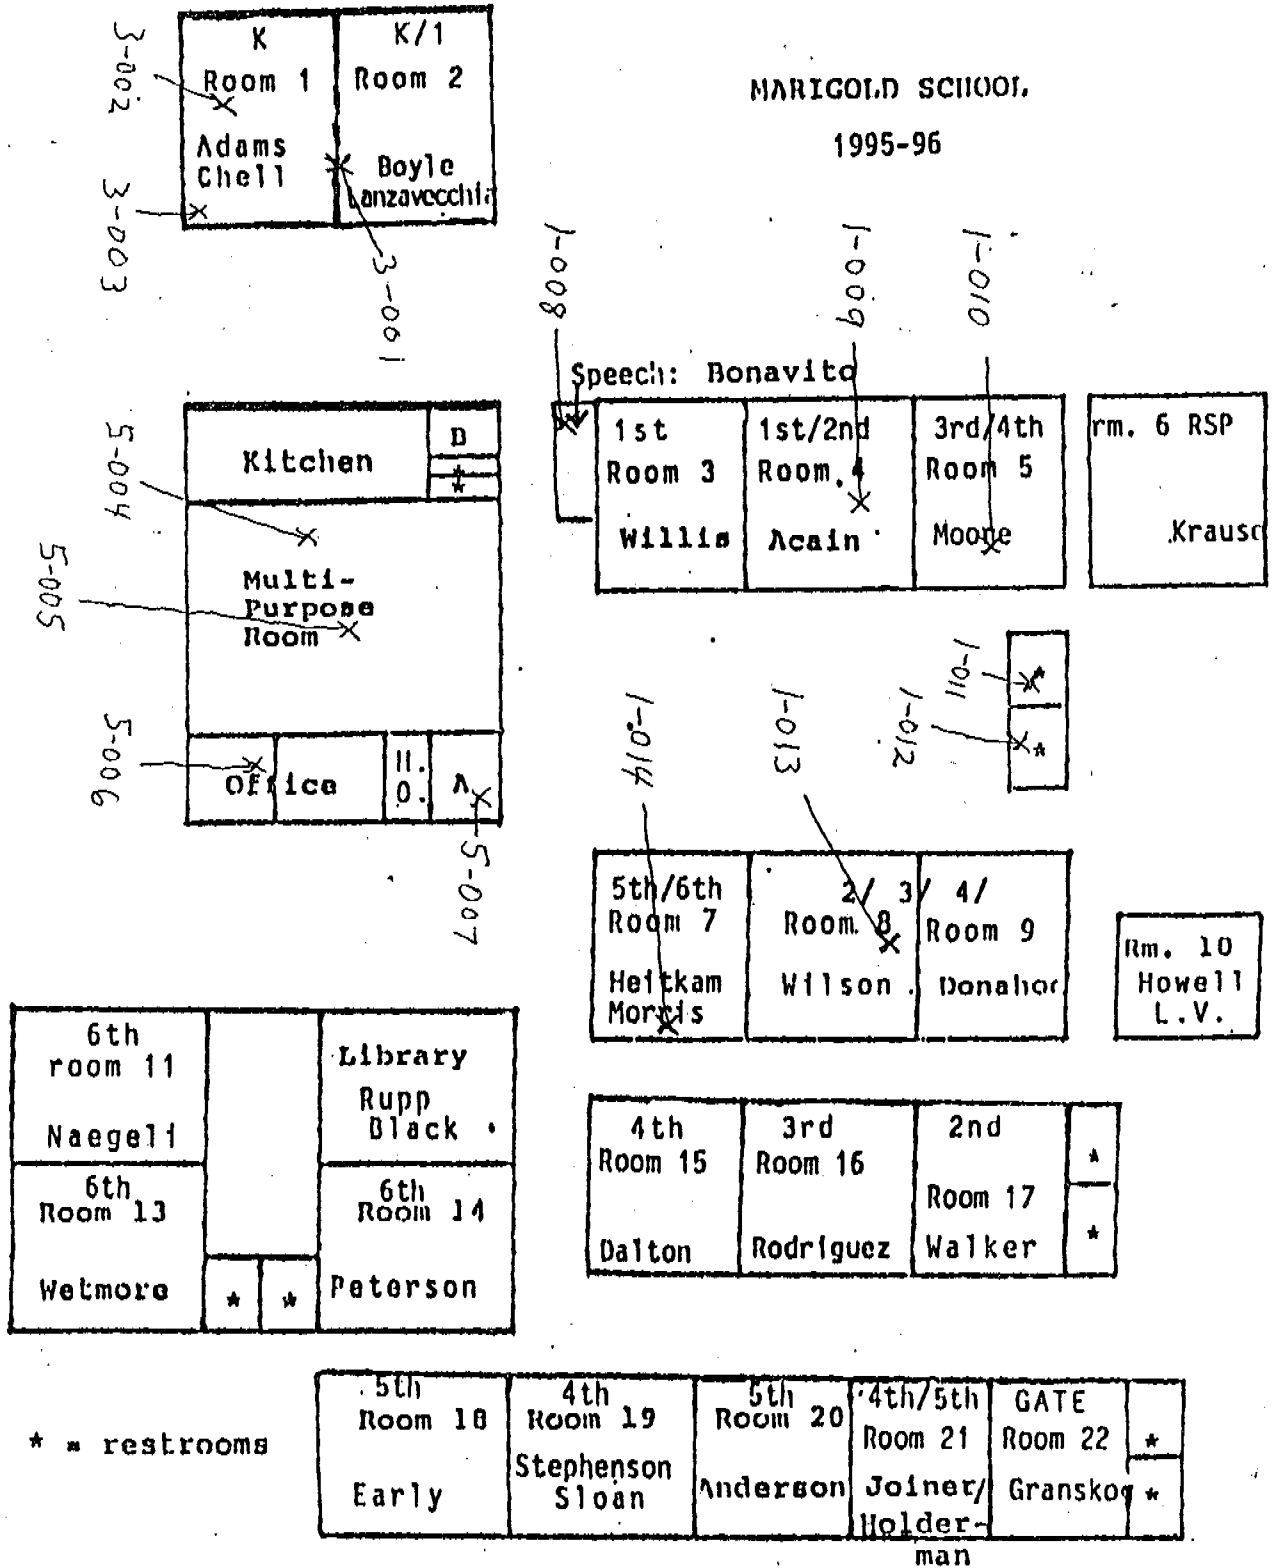



Forensic Analytical
Analytical Report

San Francisco • 3777 Depot Road, Suite 409, Hayward, CA 94545 • Phone 510/887-8828 • Fax 510/887-4218
Los Angeles • 2959 Pacific Commerce Drive, Rancho Dominguez, CA 90221 • Phone 310/763-2374 • Fax 310/763-8684

Bulk Material Analysis
Method: 40 CFR 763, Subpart F, Appendix A (AHERA)

Client:
Chico Unified School District
Mr. Ron Jones
2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: 253718
Date Received: 05/10/96

P.O. Num: 96-4623
Job ID:
Site: Marigold

Sample Number	Lab Number	Total Asbestos	Total Fibrous Non-Asbestos	(Breakdown by type)
Gross Description/Comments				
MAR-3-001C Tan fibrous tile with white paint.	19634092	Non-Det. %	80-85%	Cellulose (30-35%) Fibrous Glass (45-50%)
MAR-5-002C Off-white and white plaster.	19634093	Non-Det. %	Trace%	Cellulose (Trace%)
5-003C Tan fibrous tile and white paint.	19634094	Non-Det. %	75-80%	Cellulose (25-30%) Fibrous Glass (45-50%)
MAR-5-004C Tan fibrous tile and white paint.	19634095	Non-Det. %	75-80%	Cellulose (25-30%) Fibrous Glass (45-50%)
MAR-1-005C Brown fibrous tile and white paint.	19634096	Non-Det. %	90-95%	Cellulose (90-95%) Wollastonite (Trace%)
MAR-1-006C Orange and white plaster.	19634097	Non-Det. %	Trace%	Cellulose (Trace%) Fibrous Glass (Trace%)
MAR-1-007C Brown fibrous tile and white paint.	19634098	Non-Det. %	90-95%	Cellulose (90-95%) Wollastonite (Trace%)

David Kahane

David Kahane, C.I.H., Laboratory Director, Hayward Laboratory

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full with approval from Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Samples submitted to Forensic Analytical are retained for a period of six months and then disposed of according to all state and federal guidelines.



BULK SAMPLE REQUEST FORM

CLIENT NAME & ADDRESS: 2921 Chico Unified School District 2455 Carmichael Drive Chico, CA 95928		PHONE: 916-891-3194	DATE: 5-8-96
		Circle the Method and Turn Around Time	Results Needed: MON-NOON
		____ hr/12hr/24hr/48hr/Ext	5-13-96 FAX
		PLM: <u>Standard</u> / Point Count	Gravimetry Prep
CONTACT: Ron Jones		TEM: QUAL. / QUANT. / WATER	
P.O.# 96-4623	JOB #	AA/Flame AA/Furnace ICP	
SITE: Marigold		METALS:	

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
Mar-3-001C	5-8-96	Room 2 FCP
Mar-5-002C	"	Kitchen Ceiling Plaster
Mar-5-003C	"	Workroom FCP
Mar-5-004C	"	Principal's Office FCP
Mar-1-005C	"	Boys RR ACT
Mar-1-006C	"	Custodial Closet ceiling Plaster
Mar-1-007C	"	Room 7 ACT

Sampled by: Ron Jones	Date: 5-8-96 Time: 1:30 PM
Relinquished by: R Jones	Received By: <u>5/10/96</u>
Date/Time: 5-8-96	Date/Time: <u>5/10/96</u>
	Sealed Condition (circle one) YES / NO
Relinquished by: <u>1</u>	Received By:
Date/Time:	Date/Time:
	Sealed Condition (circle one) YES / NO

Unit 3

K Room 1 Adams Chell	K/1 Room 2 Boyle Lanzavetta
-------------------------------	--------------------------------------

MARIGOLD SCHOOL.

1995-96

3-001c

5-002c

Unit 5

Kitchen		D
Multi-Purpose Room		
Office	H.O.	A

Speech: Bonavito

1st Room 3 Willis	1st/2nd Room 4 Acain	3rd/4th Room 5 Moore	Rm. 6 RSP Krause
-------------------------	----------------------------	----------------------------	---------------------

↑

Unit 1

↓

*
*
*
*

1-005c

1-006c

5-003c

5-004c

1-007c

5th/6th Room 7 Heitkam Morris	2/3/4/ Room 8 Wilson	Room 9 Donahoe
--	----------------------------	-------------------

Rm. 10 Howell L.V.

6th room 11 Naegeli		Library Rupp Black
6th Room 13 Wetmore		6th Room 14 Peterson

4th Room 15 Dalton	3rd Room 16 Rodriguez	2nd Room 17 Walker	*
--------------------------	-----------------------------	--------------------------	---

* = restrooms

5th Room 18 Early	4th Room 19 Stephenson Sloan	5th Room 20 Anderson	4th/5th Room 21 Joiner/ Holder-	GATE Room 22 Granskog	*
-------------------------	---------------------------------------	----------------------------	--	-----------------------------	---

man



Forensic Analytical
Analytical Report

San Francisco • 3777 Depot Road, Suite 409, Hayward, CA 94545 • Phone 510/887-8828 • Fax 510/887-4218
Los Angeles • 2950 Pacific Commerce Drive, Rancho Dominguez, CA 90221 • Phone 310/763-2324 • Fax 310/763-8053

Bulk Material Analysis
Method: 40 CFR 763, Subpart F, Appendix A (AHERA)

Client:
Chico Unified School District
Mr. Ron Jones
2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: 256861
Date Received: 07/26/96

P.O. Num: 97-404
Job ID:
Site: Marigold Building 1 - Boiler Room

Sample Number	Lab Number	Total Asbestos	Total Fibrous Non-Asbestos	(Breakdown by type)
MAR-1-008W Off-white plaster.	19651846	Non-Det. %	Trace %	Cellulose (Trace %)
MAR-1-009C Off-white plaster.	19651847	Non-Det. %	Trace %	Cellulose (Trace %)

David Kahane

David Kahane, C.I.H., Laboratory Director, Hayward Laboratory

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full with approval from Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Samples submitted to Forensic Analytical are retained for a period of six months and then disposed of according to all state and federal guidelines.



BULK SAMPLE REQUEST FORM

CLIENT NAME & ADDRESS:

PHONE: 919-891-3194
FAX 916-891-3190

DATE: 7-25-96

2921 Chico Unified School District
2455 Carmichael Drive
Chico, CA 95928Circle the Method and
Turn Around Time

Results Needed:

2 hr/12hr/24hr/48hr/Ext3:00pm
7-26-96
BY FAXPLM: Standard / Point Count

Gravimetry Prep

CONTACT: RON JONES

TEM: QUAL. / QUANT. / WATER

P.O.# 97-404

JOB #

AA/Flame AA/Furnace ICP

SITE: MARIGOLD BUILDING 1 BOILER ROOM

METALS:

SAMPLE NUMBER

DATE
COLLECTED

SAMPLE LOCATION/DESCRIPTION

MAR-1-008W

7-25-96

WALL PLASTER Left of Boiler in Bldg 1

MAR-1-009C

7-25-96

CEILING PLASTER Near Door in Boiler Room/ Bldg 1

Sampled by: Ronald D. Jones *RDJ*

Date: 7-25-96

Time: 2:00pm

Relinquished by: Ronald D. Jones *RDJ*

Received By: FED EX

Date/Time: 7-25-96 4:30pm

Date/Time:

Sealed Condition (circle one) YES / NO

Relinquished by:

Received By:

Date/Time:

Date/Time:

Sealed Condition (circle one) YES / NO



Forensic Analytical
Analytical Report

San Francisco • 3777 Depot Road, Suite 409, Hayward, CA 94545 • Phone 510-887-8828 • Fax 510-887-4018
Los Angeles • 2959 Pacific Commerce Drive, Rancho Dominguez, CA 90221 • Phone 310-763-2374 • Fax 310-763-8931

Bulk Material Analysis
Method: 40 CFR 763, Subpart F, Appendix A (AHERA)

Client:
Chico Unified School District
Mr. Ron Jones
2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: 257029
Date Received: 07/31/96

P.O. Num: 97-404
Job ID:
Site: Marigold

Sample Number	Lab Number	Total Asbestos	Total Fibrous Non-Asbestos	(Breakdown by type)
Gross Description/Comments				
Mar-1-010C Brown fibrous material.	19652730	Non-Det. %	100%	Cellulose (100%)
Mar-1-011C Brown fibrous material.	19652731	Non-Det. %	100%	Cellulose (100%)
5-012C Off-white sheetrock with brown fibrous material.	19652732	Non-Det. %	20-25%	Cellulose (15-20%) Fibrous Glass (1-5%)

David Kahane, C.I.H., Laboratory Director, Hayward Laboratory

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full with approval from Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Samples submitted to Forensic Analytical are retained for a period of six months and then disposed of according to all state and federal guidelines.



Forensic Analytical

BULK SAMPLE REQUEST FORM

CLIENT NAME & ADDRESS:

2921 Chico Unified School District
2455 Carmichael Drive
Chico, CA 95928

PHONE: 916-891-3194
FAX 916-891-3190

DATE: 7-30-96

Circle the Method and
Turn Around Time

Results Needed:
7-31-96

2 hr/12hr/24hr/48hr/Ext

3:00pm FAX

PLM: Standard / Point Count

Gravimetry Prep

CONTACT: Ron Jones

TEM: QUAL. / QUANT. / WATER

P.O.# 97-404

JOB #

AA/Flame AA/Furnace ICP

SITE: Marigold

METALS:

SAMPLE NUMBER

DATE
COLLECTED

SAMPLE LOCATION/DESCRIPTION

Mar-1-010C

7-30-96

Ceiling Tile and underlaying material in Room 5 (unit 1)

Mar-1-011C

7-30-96

Ceiling tile and underlaying material in boys RR (unit 1)

Mar-5-012C

7-30-96

Sheetrock above ceiling tile in MP Room (Unit 5)

Please analyse above samples by layer, and report
accordingly.

Sampled by: Ron Jones *RJ*

Date: 7-30-96

Time: 11:15am

Relinquished by: Ron Jones

Received By: *[Signature]*

Date/Time: 7-30-96 4:00pm

Date/Time: *7/31/96*

Sealed Condition (circle one) YES / NO

Relinquished by:

Received By:

Date/Time:

Date/Time:

Sealed Condition (circle one) YES / NO



Forensic Analytical
Analytical Report

San Francisco • 3777 Depot Road, Suite 409, Hayward, CA 94545 • Phone 510/887-8828 • Fax 510/887-4213
Los Angeles • 2959 Pacific Commerce Drive, Rancho Dominguez, CA 90221 • Phone 310/763-2374 • Fax 310/763-8664

Bulk Material Analysis
Method: 40 CFR 763, Subpart F, Appendix A (AHERA)

Client:
Chico Unified School District
Mr. Ron Jones
2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: 257141
Date Received: 08/02/96

P.O. Num: 97-404
Job ID:
Site: Marigold Multipurpose Room

Sample Number	Lab Number	Total Asbestos	Total Fibrous Non-Asbestos	(Breakdown by type)
MAR-5-013C Brown mastic.	19653298	Non-Det.%	Trace%	Cellulose (Trace%)

David Kahane

David Kahane, C.I.H., Laboratory Director, Hayward Laboratory

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full with approval from Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Samples submitted to Forensic Analytical are retained for a period of six months and then disposed of according to all state and federal guidelines.



BULK SAMPLE REQUEST FORM

METALS:

Ceiling Tile Adhesive in MP Room

Sealed Condition (circle one) YES / NO

**BUTTE
COUNTY**
**OFFICE OF
EDUCATION**

JERRY McGUIRE
SUPERINTENDENT

MEMORANDUM

To: Site Supervisor
From: Kirby L. White 
Date: 8 January 1996
Subject: AHERA 6 Month Surveillance

Kirby L. White
Maintenance/Operations
Facilities Planner
916-538-2084
FAX 916-538-7218

E-mail:
kwhite@ben.
bcoe.butte.k12.ca.us
Board of
Education

Brenda J. Brimhall
Frank Gladen
Bessie Hironimus
Erwin M. Howlett
L. Charles Larsen
James F. Lindsey
Betty Vassar

Business Services
1859 Bird Street
Oroville, CA 95965
(916) 538-7227
FAX: (916) 538-7218
An Equal Opportunity
Employer

Please find attached the AHERA 6 month surveillance form for your site.
Review this surveillance and retain it in your site AHERA files.

Should you have any questions, please do not hesitate to contact me.
Thank you.

jm
MO76956.doc

cc: AHERA Master File

Attachment

BUTTE COUNTY OFFICE OF EDUCATION INSPECTOR: 10/16/2010
 MARIGOLD PORTABLE ROOM 10 DATE OF INSPECTION: 12/28/09
 2446 MARIGOLD AVENUE CHICO CA.

LOCATION	MATERIAL	MATERIAL CLASSIFICATION	HOMOGENEOUS MATERIAL #	PERCENTAGE ASBESTOS ASSUMED	AMOUNT SQ. FT./11 FT. 960 SQ. FT.	CONDITION: CODE & COMMENT (UNDER CARPETING)	FRIABLE YES NO
THROUGHOUT	12" VINYL FLOOR TILE	MISC	99				X

CONDITION CODE:
 General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or More)
 Change in Condition: (4) No (5) Yes, (if Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (explain under comments)

NT

SIX-MONTH SURVEILLANCE

Page 1 of 2

DISTRICT Chico Unified School District DATE December 20, 1996SCHOOL Marigold Elementary INSPECTOR Rob Peters R.P.

BLDG.	HOMOG. MAT.#	ASBESTOS MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
1	Tran panl	Assumed	Both boilers in Main B/R	1-4
1	9" VFT	1-5%	Room 12 & rest of wing	1-4
1	PW Str	60-65%	B/R Room	1-4
3	9" VFT	1-5%	Room 17 & rest of unit	1-4
3	Tran panl	Assumed	Above glass panels	1-4
4	Tran panl	Assumed	Above windows	1-4
4	9" VFT	1-5%	Lib/staff & classrooms	1-4 Carpeted
5	9" VFT	1-5%	Kit, MPR, AV store, Fac. RR	1-4
5	Cold box ceiling	30-35%	Cold Box	1-4
5	Plaster	Assumed	Kitchen & Restroom	1-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)

CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)

ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED

MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)
SIX-MONTH SURVEILLANCE Page 2 of 2

DISTRICT Chico Unified School District DATE December 20, 1996

SCHOOL Marigold Elementary INSPECTOR Rob Peters

HOMOG.		ASBESTOS		LOCATION		CONDITION: CODE & COMMENTS
BLDG.	MAT.#	MATERIAL				
All	Drywall	1-5 skim coat		All Non-Plaster Walls and Ceilings	1-4	
Port	12" VFTs	Assumed		All Non-Certified Portables	1-4	
Port	Linoleum	Assumed		Restroom Portables	1-4	
Port	Drywall	Assumed		All Non-Certified Portables (behind tagboard)	1-4	

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

Page 1 of 2

DISTRICT Chico Unified School District DATE July 5, 1996

SCHOOL Marigold Elementary INSPECTOR Rob Peters V.P.

BLDG.	HOMOG. MAT.#	ASBESTOS MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
1	Tran panl	Assumed	Both boilers in Main B/R	1-4
1	9" VFT	1-5%	Room 12 & rest of wing	1-4
1	PW Str	60-65%	B/R Room	1-4
3	9" VFT	1-5%	Room 17 & rest of unit	1-4
3	Tran panl	Assumed	Above glass panels	1-4
4	Tran panl	Assumed	Above windows	1-4
4	9" VFT	1-5%	Lib/staff & classrooms	1-4 Carpeted
5	9" VFT	1-5%	Kit, MPR, AV store, Fac. RR	1-4
5	Cold box ceiling	30-35%	Cold Box	1-4
5	Plaster	Assumed	Kitchen & Restroom	1-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)

CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)

ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED

MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

Page 1 of 2

DISTRICT Chico Unified School DistrictDATE January 4, 1996SCHOOL Marigold ElementaryINSPECTOR Ron JonesBLDG. HOMOG. ASBESTOS
MAT.# MATERIAL

LOCATION

CONDITION: CODE & COMMENTS

1	Tran panl	Assumed	Both boilers in Main B/R	1-4	
1	9" VFT	1-5%	Room 12 & rest of wing	1-4	
1	PW Str	60-65%	B/R Room	1-4	
3	9" VFT	1-5%	Room 17 & rest of unit	1-4	
3	Tran panl	Assumed	Above glass panels	1-4	
4	Tran panl	Assumed	Above windows	1-4	
4	9" VFT	1-5%	Lib/staff & classrooms	1-4 Carpeted	
5	9" VFT	1-5%	Kit, MPR, AV store, Fac. RR	1-4	
5	Cold box ceiling	30-35%	Cold Box	1-4	
5	Plaster	Assumed	Kitchen & Restroom	1-4	

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)

CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)

ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED

MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

Page 2 of 2

DISTRICT Chico Unified School District DATE January 4, 1996

SCHOOL Marigold Elementary INSPECTOR Ron Jones

BLDG. ASBESTOS MATERIAL LOCATION CONDITION: CODE & COMMENTS

All	Drywall	1-5 skim coat	All Non-Plaster Walls and Ceilings	1-4	
Port	12" VFTs	Assumed	All Non-Certified Portables	1-4	
Port	Linoleum	Assumed	Restroom Portables	1-4	
Port	Drywall	Assumed	All Non-Certified Portables (behind tagboard)	1-4	

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)

CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)

ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED

MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)