

HMS, Inc.
HAZARD MANAGEMENT SERVICES, INC.

4200 Rocklin Rd., Ste. 11A
Rocklin, CA 95677-2860
(916) 632-6800 • (916) 632-6841 Fax

May 21, 2004

Mr. Kip Hansen
Chico Unified School District
1163 E. Seventh Street
Chico, CA 95928

RE: Fifth Triennial AHERA Three-Year Reinspection

Dear Mr. Hansen:

Enclosed is the data obtained from the fifth AHERA three-year reinspections Hazard Management Services, Inc. (HMS, Inc.) conducted between April 14 and May 4, 2004. The documents included with this letter are the "Three-Year Reinspection Homogeneous ACBM Material Records" covering all buildings known from the original inspection to contain ACBM. The sites enclosed are Bidwell Junior High, Citrus Elementary, the Corporate Yard, the District Office, Fair View High, Marigold Elementary, and Rosedale Elementary Schools.

You should review the updated Homogeneous Materials Reports to familiarize yourself with the current status of asbestos containing materials and identified suspect asbestos materials. It is the District's responsibility to assure that the school's site copy of the Management Plan is up to date and consistent with the District's Management Plan for that site. This is very important and if not done can cause the District to be penalized during an EPA site visit or investigation.

HMS, Inc. wants to remind you that materials containing "trace" amounts of asbestos must be considered in the event of renovations or demolitions. Although building materials containing trace amounts of asbestos (<1%) are not regulated under EPA, Cal/OSHA does regulate work practices with materials containing 0.1% asbestos. The original AHERA inspection contains information regarding materials with trace amounts of asbestos.

When you provide your annual notification to parents and staff, include information regarding this three-year reinspection. Enclosed is a suggested format for your notification letter. Please note that you must include in your Management Plans a description of the steps you take to notify. It is also important that your Management Plans be updated after any and all actions conducted which impact asbestos containing materials.


Please remember that HMS, Inc. did not inspect new buildings or portable classrooms which were placed on the District sites since the original EPA AHERA inspection. It is the District's responsibility to obtain letters of certification from the Architect, Construction Superintendent, or manufacturer of new building materials, indicating there is no asbestos in the new buildings (constructed after October 12, 1988) or new building materials. A copy of these certification letters must be included in your management plans, both at the school site and at the LEA Designees office site. It is still required of School Districts to send a copy of these certification letters to the US EPA AHERA unit; Region IX in San Francisco.

HMS, Inc.

Mr. Kip Hansen
Chico Unified School District
May 21, 2004
Page Two

It is not necessary to send a copy of the three-year reinspection to the OPSC or EPA. However, the report should be included in your Management Plan. I want to thank you for your cooperation. If you have any questions, please feel free to contact me at (916) 632-6800.

Sincerely,

Handwritten signature of John Angi in cursive, with the initials "JB" in parentheses at the end.

John Angi
Certified Asbestos Consultant
CAC #03-3330

Enclosures

D:\Shannon s Doc\REINSPT\ChicoUSD\2004\Final.Ltr.#2.wpd

RECORD OF FRIABLE AND NONFRIABLE ACM
(FORM B)

Inspection Date(s) April 14, 2004

THREE-YEAR REINSPECTION

CDS CODE
04-61424-6003032

SCHOOL
Marigold Elementary School

SCHOOL PHONE NUMBER
(530) 891-3121

ADDRESS
2446 Marigold Avenue

(NUMBER)

(STREET)

(CITY)
Chico, CA

(ZIP)
95926

-IMPORTANT-

Each building and functional space with friable ACBM or friable assumed ACBM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACBM OR FRIABLE ASSUMED ACBM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE <small>(Indicate Address if Different From Above)</small>	CHECK ONE			CHECK ONE			
		SUR-FACING	TSI	MISC	ACBM		ASSUMED ACBM	
					FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
1.	BUILDING 1		X	X		X		X
2.	BUILDING 3			X		X		X
3.	BUILDING 4			X		X		X
4.	BUILDING 5	X		X		X		X
5.	PORTABLES 18A-22			X				X
6.	PORTABLES 23 & 24 DISTRICT MUST CERTIFY							
7.	ROOMS 15, 16, & 17 WERE NOT INCLUDED IN THE ORIGINAL INSPECTION PERFORMED BY HMS, INC IN 1988.							
8.								
9.								
10.								
11.								
12.								
13.								
14.								
15.								
16.								
17.								

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of inspection: April 14, 2004

District: Chico Unified School District

Inspector: John Angi

School: Marigold Elementary School

Building: 1

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	9" VFT BROWN	8	1-5%	5,728 S	CLASSROOMS 3-5 & 7-9	(2) MINOR DAMAGE.	N
T	PIPE WRAP STRAIGHT	10	60-65%	150 S	BOILER ROOM	(1) (4)	N
M	12" VFT	95	ASSUMED	160 S	CLASSROOMS 6A & 6B	(1) (4)	N
M	2' X 4' FCP	96	ASSUMED	1,800 S	CLASSROOMS 6A, 6B, & 10	(1) (4)	N
M	12" ACT	97	ASSUMED	850 S	GIRL'S & BOY'S RESTROOMS	(2) MINOR WATER DAMAGE ON ACT'S IN BOY'S & GIRL'S RESTROOMS.	N
M	12" ACT	98	ASSUMED	5,728 S	CLASSROOMS 3-5 & 7-9	(1) (4)	N
M	TRANSITE PANELS	99	ASSUMED	50 S	MAIN BOILER ROOM AT BOILERS	(1) (4) UNABLE TO LOCATE THE MATERIAL.	N
M	PLASTER	101	ASSUMED	600 S	BOY'S & GIRL'S RESTROOMS	(1)	N

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: April 14, 2004

Inspector: John Angi

District: Chico Unified School District

Building: 3

School: Marigold Elementary School

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Frangible Yes/No
M	9" VFT	2	1-5%	2,800 S	CLASSROOMS 1 & 2	(1) (4)	N
M	2' X 4' FCP	94	ASSUMED	1,800 S	CLASSROOMS 1 & 2	(1) (4)	N
M	TRANSITE PANELS	99	ASSUMED	300 S	ABOVE GLASS PANELS	(1) (4)	N

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: April 14, 2004

District: Chico Unified School District

Inspector: John Angi

School: Marigold Elementary School

Building: 4

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	9" VFT	2	1-5%	4,500 S	ALL ROOMS	(11) THE 9" VFT COULD BE UNDER THE CARPET IN CLASSROOMS 11, 13, & 14.	N
M	2' X 4' FCP	92	ASSUMED	4,500 S	ALL ROOMS	(1) (4)	N
M	12" VFT	93	ASSUMED	900 S	LIBRARY	(1) (12) 9" VFT WAS CONCEALED BY CARPET AND 12" VFT WAS REPLACED WITH 12" VFT WHITE WITH BLUE.	N
M	TRANSITE PANELS	99	ASSUMED	300 S	ABOVE WINDOWS	(1) (4) APPROXIMATELY 18 PANELS.	N
M	12" VFT WHITE W/BLUE	150	ASSUMED	305 S	STAFF LOUNGE	(1)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: April 14, 2004

Inspector: John Angi

District: Chico Unified School District

School: Marigold Elementary School Building: 5

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	9" VFT CREAM	2	1-5%	3,160 S	KITCHEN, MULTI PURPOSE ROOM, STORAGE, PIP ROOM, AND HEALTH OFFICE	(1) (4)	N
M	COLD BOX CEILING	6	30-35%	20 S	COLD BOX	(1) (4)	N
S	PLASTER	75	ASSUMED	1,000 S	KITCHEN AND RESTROOMS	(1) (4)	N
M	12" ACT	90	ASSUMED	2,500 S	MULTI-PURPOSE ROOM	(1) (4)	N
M	2' X 4' FCP	91	ASSUMED	5,000 S	PRINCIPALS OFFICE, OFFICE, PIP ROOM, CLASSROOM A (FKA LIBRARY), AND HEALTH OFFICE	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: April 14, 2004

District: Chico Unified School District

Inspector: John Angi

School: Marigold Elementary School

Building: Portables 18A-22

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Fiabile Yes/No
M	12" VFT	80	ASSUMED	2,400 S	PORTABLES 18A-22	(1) (4)	N
M	DRYWALL	81	ASSUMED	10,000 S	PORTABLES 18A-22	(1) (4)	N
M	2' X 4' FCP	89	ASSUMED	8,000 S	PORTABLES 18A-22	(1) (4)	N
M	LINOLEUM	100	ASSUMED	500 S	RESTROOM PORTABLES	(1) (4)	N
						NOTE: THE DISTRICT MUST OBTAIN CERTIFICATION LETTERS ON ANY PORTABLES MANUFACTURED AFTER OCTOBER 12, 1988.	

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: April 14, 2004

District: Chico Unified School District

Inspector: John Angi

School: Marigold Elementary School

Building: Portables 23 & 24

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VFT BLUE	102	ASSUMED	180 S	PORTABLES 23 & 24	(1)	N
M	TAGBOARD	103	ASSUMED	960 S	PORTABLES 23 & 24	(1)	N
M	2' X 4' FCP'S (FIBERGLASS)	104	ASSUMED	900 S	PORTABLES 23 & 24	(1)	N
M	CARPET	105	ASSUMED	780 S	PORTABLES 23 & 24	(1)	N
						NOTE: THE DISTRICT MUST OBTAIN CERTIFICATION LETTERS ON ANY PORTABLES MANUFACTURED AFTER OCTOBER 12, 1988.	

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 (4) No (5) Yes (If Yes, explain under comments)
Change in Condition: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Abated: (11) Inaccessible, no inspection data (12) Other (Explain under comments)
Miscellaneous: (13) Non-Asbestos/Not Inspected


CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

Building 3 EMERGENCY EVACUATION ROUTES

MARIGOLD
ELEMENTARY SCHOOL
2003/2004

Building 1

NEW THIS
SUMMER
2003

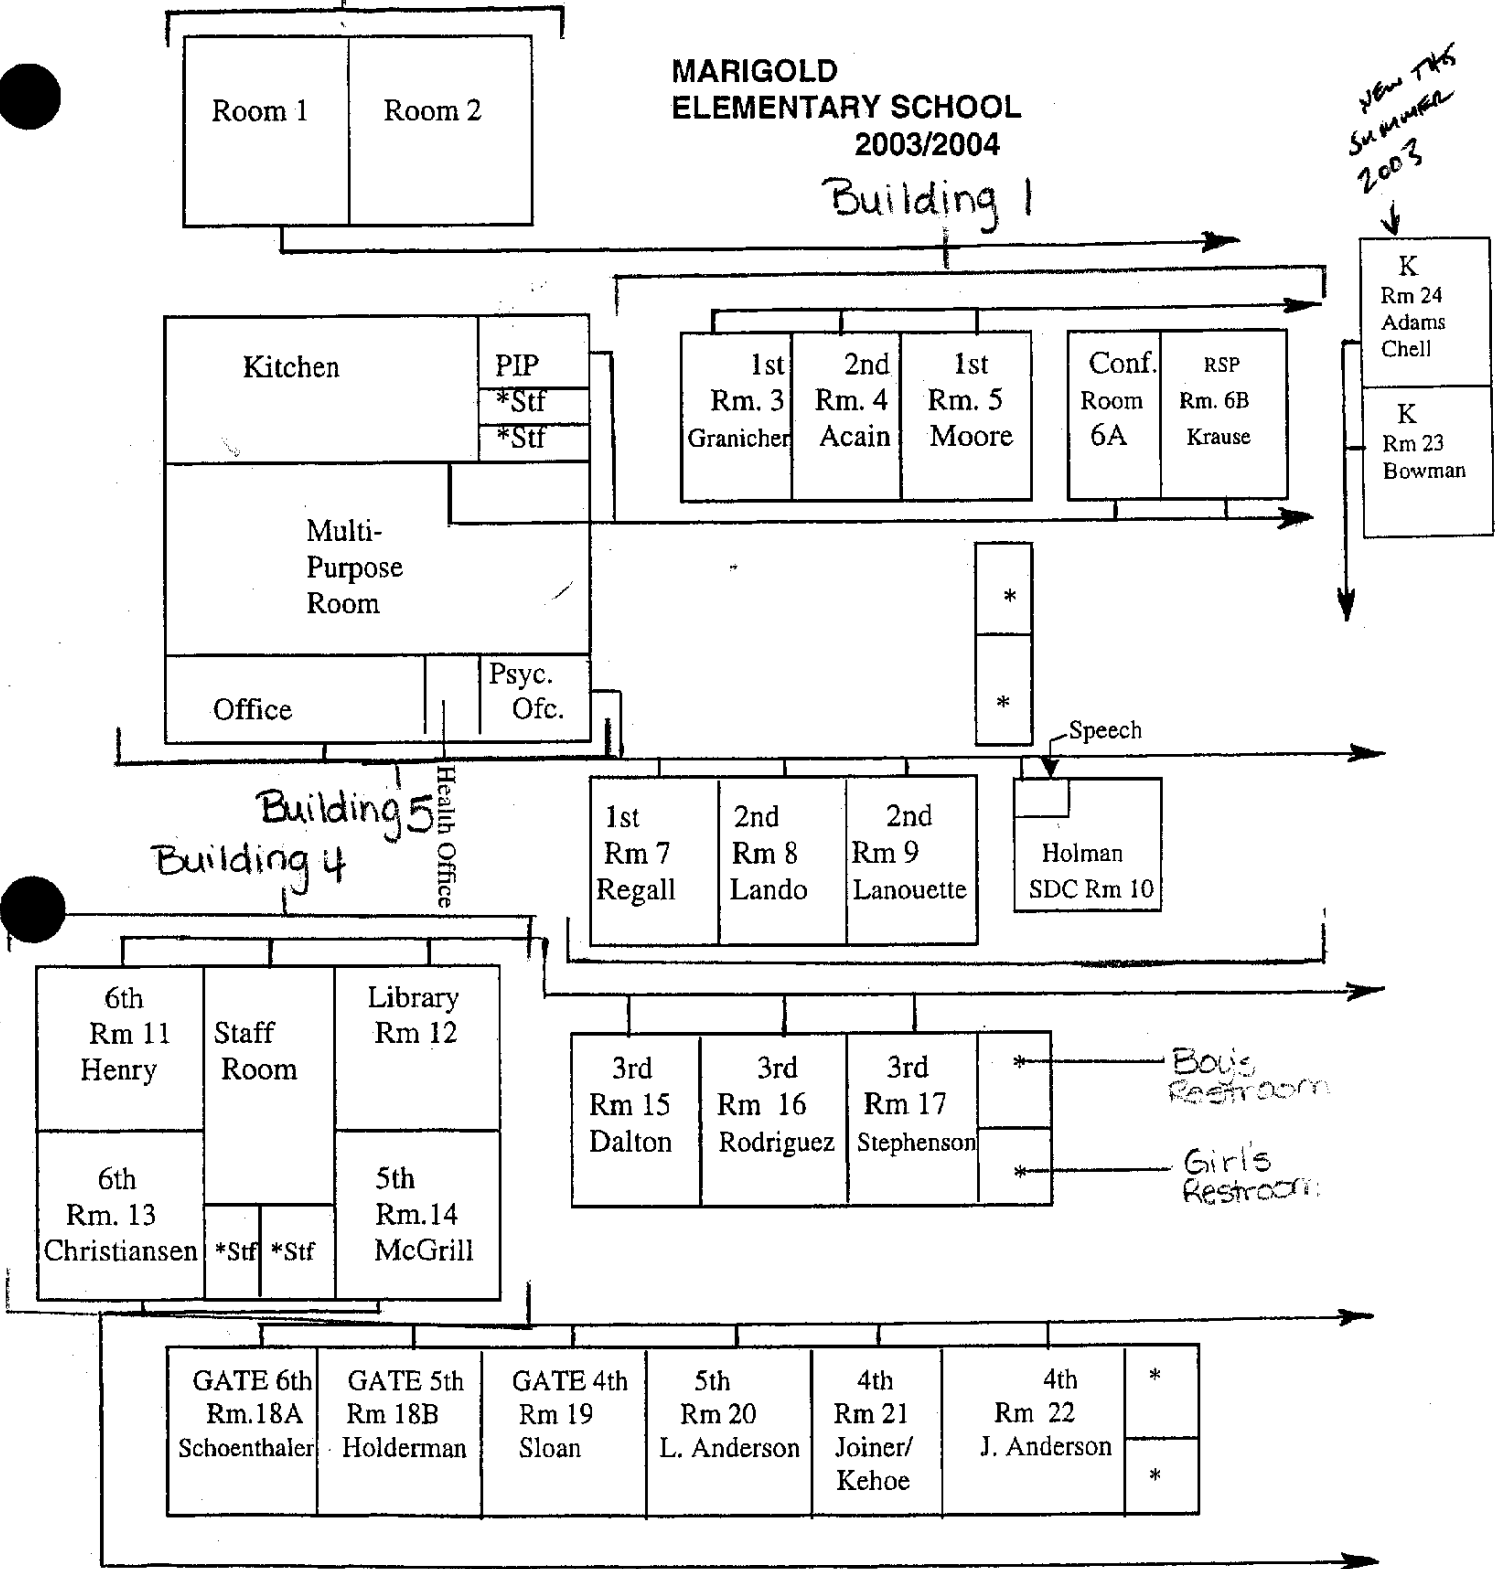

*= restrooms

DM
041404

16" x 16" - 26 TOTAL

6
11
17

DEPARTMENT OF INDUSTRIAL RELATIONS
DIVISION OF OCCUPATIONAL SAFETY AND HEALTH
ASBESTOS CONSULTANT and TRAINER APPROVAL UNIT

Park Towne Circle, Suite 1
Sacramento, CA 95825
Tel: (916) 574-2993 Fax: (916) 483-0572



304013330C

251

Hazard Management Services, Inc.
John A. Angi
4200 Rocklin Road, #11A
Rocklin, CA 95677

4/30/2003

Dear Certified Asbestos Consultant or Technician:

Congratulations, you have passed your certification examination!

Enclosed is your certification card. **To maintain your certification, please abide by the rules printed on the back of the certification card.**

Your certification is valid for a period of one year. If you wish to renew your certification, you must apply for renewal at least 60 days before the expiration date shown on your card. [8 CCR 341.15(h)(1)].

Please hold and do not send copies of your required AHERA refresher renewal certificates to the Division until you apply for renewal of your certification.

Please inform the Division of any changes in your mailing address or work address within 15 days.

Sincerely,

Rick Axe
Senior Industrial Hygienist

RA/ms

Attachment

cc: File

State of California
Division of Occupational Safety and Health
Certified Asbestos Consultant

John A. Angi
Name

Certification No. 03-3330

Expires on 4/23/2004

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq. of the Business and Professions Code



Hazard Management Services, Inc.

This is to confirm that

John A. Angi

has attended the eight-hour

***AHERA Refresher Course for Asbestos Inspectors and
Management Planners***

and has completed the requisite training for asbestos accreditation under TSCA Title II

September 10, 2003

Certificate number: 14

Valid until: September 10, 2004

Cal/OSHA approval number: CA-025-06/CA-025-08



Tom Wangerin, MS, CAC
AHERA Training Director
Hazard Management Services, Inc.
367 Civic Drive, Suite 7
Pleasant Hill, CA 94523-1936
925-363-3442