

Shasta Elementary

**RECORD OF FRIABLE AND NON-FRIABLE ACM
(FORM B)**

Inspection Date(s) August 6, 2013

THREE-YEAR REINSPECTION

CDS CODE
04-61424-6003099

SCHOOL
Shasta Elementary School

SCHOOL PHONE NUMBER
(530) 891-3141

ADDRESS
169 Leora Court

(NUMBER)

(STREET)

(CITY)
Chico, CA

(ZIP)
95973

-IMPORTANT-

Each building and functional space with friable ACBM or friable assumed ACBM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACBM OR FRIABLE ASSUMED ACBM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE <small>(Indicate Address if Different From Above)</small>	CHECK ONE			CHECK ONE			
		SUR-FACING	TSI	MISC	ACBM		ASSUMED ACBM	
					FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
1.	A - MPR - CERTIFICATION LETTER ON FILE DATED 11-1-01							
2.	B - CLASSROOMS 3, 6, & 7			X		X		X
3.	C - CLASSROOMS 4, 5, & 8-10	X		X		X		X
4.	D - PORTABLES 13, 13A, & 14			X				X
5.	E - CLASSROOM 15			X				X
6.	F - CLASSROOM 16			X				X
7.	G - CLASSROOM 17			X				X
8.	H - CLASSROOMS 19-21 - CERTIFICATION LETTER ON FILE DATED 9-24-97							
9.	I - CLASSROOMS 22 & 23 CERTIFICATION LETTER DATED 8-19-98							
10.	J - CLASSROOM 24 - CERTIFICATION LETTER DATED 8-19-98							
11.	K - CLASSROOM 18 CERTIFICATION LETTER DATED 9-24-97							
12.	L - CLASSROOMS 11 & 12 - CERTIFICATION LETTER ON FILE							
13.	M - ROOMS 920 & 921 - CERTIFICATION LETTER ON FILE							

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta Form B.wpd

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 6, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Shasta Elementary School

Building: B - Classrooms 3, 6, & 7

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS	1	NONE DETECTED	4,500 S	LIBRARY (922) AND CLASSROOMS 3, 6, AND 7	(13) REPRESENTED BY SAMPLE HMS-SHA-01 COLLECTED IN 1988.	N/A
M	12" VINYL FLOOR TILE BEIGE	2	TRACE	2,500 S	ENTIRE WING	(1) (4)	N
M	DRYWALL	80	ASSUMED POSITIVE	1,500 S	ENTIRE WING	(11) COVERED WITH TAGBOARD.	N
M	CEMENTITIOUS TRANSITE PANEL	99	ASSUMED POSITIVE	100 S	OUTSIDE BUILDING ABOVE DOORS AT COVERED WALKWAYS	(1) (4)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	500 L	LIBRARY, CLASSROOMS 3, 6 & 7	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	5,000 S	LIBRARY, CLASSROOMS 3, 6 & 7	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 6, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Shasta Elementary School

Building: C - Classrooms 4, 5, & 8-10

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2 X 4 CEILING PANELS FISSURE PATTERN	1	NONE DETECTED	7,000 S	OFFICE (915) AND CLASSROOMS 4, 5, 8, 9 AND 10	(13) SAMPLE HMS-SHA-01 COLLECTED IN 1988.	N/A
M	12" VINYL FLOOR TILE(CREAM) & ADHESIVE	2	TRACE	600 S	OFFICE (915) AND PRINCIPAL OFFICE	(1) (4) (11) CARPET OVER TILE IN PRINCIPAL OFFICE.	N
S	PLASTER	86	ASSUMED POSITIVE	250 S	MEN'S (912) & WOMEN'S (914) RESTROOM CEILINGS	(1) (4)	N
M	CEMENTITIOUS TRANSITE PANELS	99	ASSUMED POSITIVE	200 S	ABOVE DOORS AT COVERED WALKWAYS	(1) (4)	N
M	DRYWALL	112	ASSUMED POSITIVE	5,000 S	THROUGHOUT OFFICES & CLASSROOMS	(11) COVERED WITH TAGBOARD IN ALL CLASSROOMS - NOT INSPECTED	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	700 L	THROUGHOUT OFFICES & CLASSROOMS	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	5,000 S	THROUGHOUT OFFICES & CLASSROOMS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 6, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Shasta Elementary

Building: D - Portables 13, 13A, & 14

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS FIBERGLASS	60	NON-SUSPECT	2,200 S	PORTABLES 13, 13A, AND 14	(13)	N/A
M	12" VINYL FLOOR TILE (WHITE) & ADHESIVE	70	ASSUMED POSITIVE	2,300 S	PORTABLES 13, 13A, AND 14	(11) ASSUMED POSITIVE TO EXIST BENEATH CARPET	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	325 L	PORTABLES 13, 13A, AND 14	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	1,650 S	PORTABLES 13, 13A, AND 14	(1) (4)	N
						ROOM 14 - DESIGNATED MOBILE SYSTEMS IND. 7/01 SERIAL # 20.1083.1 & 2 ROOM 13 - DESIGNATED MOBILE SYSTEMS IND. 7/01 SERIAL # 20.1084 # 3 & # 2 ROOM 13A - DESIGNATED MOBILE SYSTEMS IND. 7/01 SERIAL # 20.1084 # 1	

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 6, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Shasta Elementary School

Building: E - Classroom 15

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	109	ASSUMED POSITIVE	253 S	CLASSROOM 15	(1) (4)	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	110	ASSUMED POSITIVE	900 S	CLASSROOM 15	(1) (4)	N
M	DRYWALL	111	ASSUMED POSITIVE	900 S	CLASSROOM 15	(11) DRYWALL BEHIND TAGBOARD.	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	80 L	CLASSROOM 15	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	375 S	CLASSROOM 15	(1) (4)	N
						BUILT BY HUFFMAN - AUG. 1987 - NO SERIAL #	

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 6, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Shasta Elementary School

Building: F - Classroom 16

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	109	ASSUMED POSITIVE	253 S	CLASSROOM 16	(1) (4)	N
M	2' X 4' CEILING PANELS	110	ASSUMED POSITIVE	900 S	CLASSROOM 16	(1) (4)	N
M	DRYWALL	111	ASSUMED POSITIVE	900 S	CLASSROOM 16	(11) DRYWALL BEHIND TAGBOARD.	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	120 L	CLASSROOM 16	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	900 S	CLASSROOM 16	(1) (4)	N
						BUILT BY: KRUSEMARK - JULY 1988 SERIAL # 8751-16 B & C	

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta HMR.wpd

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: August 6, 2013

District: Chico Unified School District

Inspector: Blake Howes

School: Shasta Elementary School

Building: G - Classroom 17

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	109	ASSUMED POSITIVE	253 S	CLASSROOM 17	(1) (4)	N
M	2' X 4' CEILING PANELS	110	ASSUMED POSITIVE	900 S	CLASSROOM 17	(1) (4)	N
M	DRYWALL	111	ASSUMED POSITIVE	900 S	CLASSROOM 17	(11) DRYWALL BEHIND TAGBOARD	N
M	COVE BASE ADHESIVE	152	ASSUMED POSITIVE	120 L	CLASSROOM 17	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	900 L	CLASSROOM 17	(1) (4)	N
						UNKNOWN MANUFACTURER - UNKNOWN BUILD DATE SERIAL # 8888.10 A & B	


Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

Shasta Elementary School

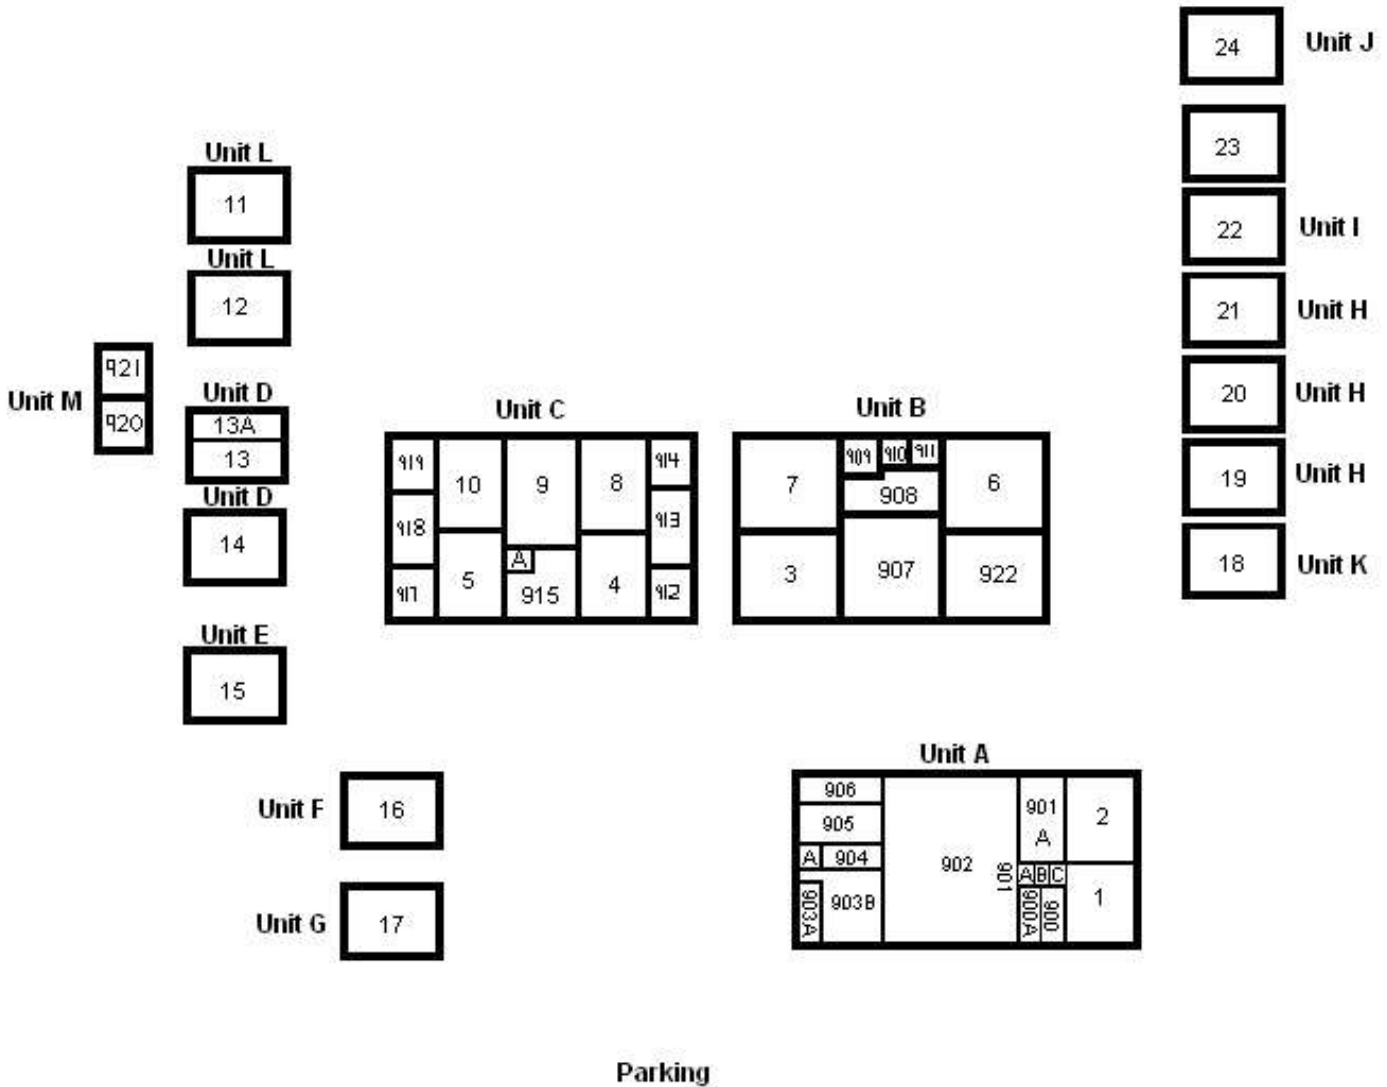

Blake Howes

Chico Unified School District
 Shasta Elementary School
 169 Leora Court
 Chico, CA 95973

Entek Consulting Group, Inc.
 4200 Rocklin Road, Suite 7
 Rocklin, California 95677
 Map Not to Scale

3-Year AHERA Reinspection
 Conducted by Blake Howes
 August 6, 2013
 Project 13-2751

SIX-MONTH SURVEILLANCE

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District:
School:

Chico Unified School District Ins
Shasta Elementary School Bu

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS	1	NONE DETECTED	4,500 S	LIBRARY (922) AND CLASSROOMS 3, 6, AND 7	(13) REPRESENTED BY SAMPLE HMS-SHA-01 COLLECTED IN 1988.	N/A
M	12" VINYL FLOOR TILE BEIGE	2	TRACE	2,500 S	ENTIRE WING	(1) (4)	N
M	DRYWALL	80	ASSUMED POSITIVE	1,500 S	ENTIRE WING	(11) COVERED WITH TAGBOARD.	N
M	CEMENTITIOUS TRANSITE PANEL	99	ASSUMED POSITIVE	100 S	OUTSIDE BUILDING ABOVE DOORS AT COVERED WALKWAYS	(1) (4)	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	500 L	LIBRARY, CLASSROOMS 3, 6 & 7	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	5,000 S	LIBRARY, CLASSROOMS 3, 6 & 7	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District:
School:

Chico Unified School District Ins
Shasta Elementary School Bui

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2 X 4 CEILING PANELS FISSURE PATTERN	1	NONE DETECTED	7,000 S	OFFICE (915) AND CLASSROOMS 4, 5, 8, 9 AND 10	(13) SAMPLE HMS-SHA-01 COLLECTED IN 1988.	N/A
M	12" VINYL FLOOR TILE(CREAM) & ADHESIVE	2	TRACE	600 S	OFFICE (915) AN D PRINCIPAL OFFICE	(1) (4) (11) CARPET OVER TILE IN PRINCIPAL OFFICE.	N
S	PLASTER	86	ASSUMED POSITIVE	250 S	MEN'S (912) & WOMEN'S (914) RESTROOM CEILINGS	(1) (4)	N
M	CEMENTITIOUS TRANSITE PANELS	99	ASSUMED POSITIVE	200 S	ABOVE DOORS AT COVERED WALKWAYS	(1) (4)	N
M	DRYWALL	112	ASSUMED POSITIVE	5,000 S	THROUGHOUT OFFICES & CLASSROOMS	(11) COVERED WITH TAGBOARD IN ALL CLASSROOMS - NOT INSPECTED	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	700 L	THROUGHOUT OFFICES & CLASSROOMS	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	5,000 S	THROUGHOUT OFFICES & CLASSROOMS	(1) (4)	N

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District:
School:

Chico Unified School District Ins
Shasta Elementary Bui

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' CEILING PANELS FIBERGLASS	60	NON-SUSPECT	2,200 S	PORTABLES 13, 13A, AND 14	(13)	N/A
M	12" VINYL FLOOR TILE (WHITE) & ADHESIVE	70	ASSUMED POSITIVE	2,300 S	PORTABLES 13, 13A, AND 14	(11) ASSUMED POSITIVE TO EXIST BENEATH CARPET	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	325 L	PORTABLES 13, 13A, AND 14	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	1,650 S	PORTABLES 13, 13A, AND 14	(1) (4)	N
						ROOM 14 - DESIGNATED MOBILE SYSTEMS IND. 7/01 SERIAL # 20.1083.1 & 2 ROOM 13 - DESIGNATED MOBILE SYSTEMS IND. 7/01 SERIAL # 20.1084 # 3 & # 2 ROOM 13A - DESIGNATED MOBILE SYSTEMS IND. 7/01 SERIAL # 20.1084 # 1	

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District:
School:

Chico Unified School District Ins
Shasta Elementary School Bui

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	109	ASSUMED POSITIVE	253 S	CLASSROOM 15	(1) (4)	N
M	2' X 4' CEILING PANELS FISSURE PATTERN	110	ASSUMED POSITIVE	900 S	CLASSROOM 15	(1) (4)	N
M	DRYWALL	111	ASSUMED POSITIVE	900 S	CLASSROOM 15	(11) DRYWALL BEHIND TAGBOARD.	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	80 L	CLASSROOM 15	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	375 S	CLASSROOM 15	(1) (4)	N
						BUILT BY HUFFMAN - AUG. 1987 - NO SERIAL #	

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District:
School:

Chico Unified School District Ins
Shasta Elementary School Bui

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	109	ASSUMED POSITIVE	253 S	CLASSROOM 16	(1) (4)	N
M	2' X 4' CEILING PANELS	110	ASSUMED POSITIVE	900 S	CLASSROOM 16	(1) (4)	N
M	DRYWALL	111	ASSUMED POSITIVE	900 S	CLASSROOM 16	(11) DRYWALL BEHIND TAGBOARD.	N
M	COVE BASE ADHESIVE	150	ASSUMED POSITIVE	120 L	CLASSROOM 16	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	900 S	CLASSROOM 16	(1) (4)	N
						BUILT BY: KRUSEMARK - JULY 1988 SERIAL # 8751-16 B & C	

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM RECORDS**

Date of Inspection:

District:
School:

Chico Unified School District Ins
Shasta Elementary School Bui

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VINYL FLOOR TILE (TAN) & ADHESIVE	109	ASSUMED POSITIVE	253 S	CLASSROOM 17	(1) (4)	N
M	2' X 4' CEILING PANELS	110	ASSUMED POSITIVE	900 S	CLASSROOM 17	(1) (4)	N
M	DRYWALL	111	ASSUMED POSITIVE	900 S	CLASSROOM 17	(11) DRYWALL BEHIND TAGBOARD	N
M	COVE BASE ADHESIVE	152	ASSUMED POSITIVE	120 L	CLASSROOM 17	(1) (4)	N
M	CARPET ADHESIVE	151	ASSUMED POSITIVE	900 L	CLASSROOM 17	(1) (4)	N
						UNKNOWN MANUFACTURER - UNKNOWN BUILD DATE SERIAL # 8888.10 A & B	

Z:\Clients\Chico USD\13-2751 3 Year Reinspections\Sites\Shasta ES\Shasta 6 month.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS