



Bulk Asbestos Analysis

(EPA Method 600/R-93-116, Visual Area Estimation)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045347
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02
First Reported: 11/27/02

Job ID / Site: Bidwell Unit 600

FASI Job ID: 2921-55

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-5	10198355						
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		

Composite Values of Fibrous Components: **Asbestos:(ND)**
 (Trace%) **Fibrous Glass (45%)**
 Comment: Bulk complex sample. Collected on 11/25/2002

James Flores, Laboratory Supervisor, Hayward Laboratory

Note: Limit of Quantification ('LOQ') = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on this report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced in full, unless approved by Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Forensic Analytical reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. All samples were received in acceptable condition unless otherwise noted.



IT NAME & ADDRESS: 2921 ⁵⁵ Chlco Unified School District 2455 Carmichael Drive Chlco, CA 95928	PHONE: (916) 891- FAX: (916) 891-3190	DATE: 11/25	
	Circle the Method and Turn Around Time 24 hr/12hr/24hr/48hr/Ext		
	PLM: Standard / Point Count		Results Needed: Gravimetry Prep
	TEM: QUAL. / QUANT. / WATER AA/Flame AA/Furnace ICP		
CONTACT: ROB PETERS			
P.O.#	JOB #	METALS:	
SITE: BIDWELL UNIT 600			

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
R-1	11/25	UNIT 600 ROOF EAST UPPER
R-2	11/25	UNIT 600 ROOF EAST
R-3	11/25	UNIT 600 ROOF NORTH
R-4	11/25	UNIT 600 ROOF WEST
R-5	11/25	UNIT 600 ROOF SOUTH

Sampled by: ROB PETERS	Date: 11/25 Time: 11:00AM
Relinquished by:	Received By: Melissa Caven
Date/Time:	Date/Time: 11/25/02 10 AM
Inquished by:	Received By:
Date/Time:	Date/Time:
	Sealed Condition (circle one) YES / NO
	Sealed Condition (circle one) YES / NO



Forensic Analytical
Analytical Report

Preliminary FAX

Bulk Asbestos Analysis

(EPA Method 600/R-93-116)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045347
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02

Job ID / Site: Bidwell Unit 600

FASI Job ID: 2921-55

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-1	10198351						
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (Trace%) Fibrous Glass (45%)
Comment: Bulk complex sample.

R-2	10198352						
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (Trace%) Fibrous Glass (45%)
Comment: Bulk complex sample.

cc: Mary
Kip
Bob M.
Rob
Gardner (3)
file



Forensic Analytical
Analytical Report

Preliminary FAX

Bulk Asbestos Analysis

(EPA Method 600/R-93-116)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045347
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02

Job ID / Site: Bidwell Unit 600

FASI Job ID: 2921-55

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-3	10198353						
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (Trace%) Fibrous Glass (45%)

Comment: Bulk complex sample.

R-4 10198354

Layer: Black Tar	ND
Layer: Black Felt	ND
Layer: Black Tar	ND
Layer: Black Felt	ND
Layer: Black Tar	ND
Layer: Black Felt	ND
Layer: Black Tar	ND
Layer: Black Felt	ND

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (Trace%) Fibrous Glass (45%)

Comment: Bulk complex sample.



Forensic Analytical
Analytical Report

Preliminary FAX

Bulk Asbestos Analysis

(EPA Method 600/R-93-116)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045347
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02

Job ID / Site: Bidwell Unit 600

FASI Job ID: 2921-55

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-5	10198355						
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		

Total Composite Values of Fibrous Components: **Asbestos:(ND)**
Cellulose (Trace%) Fibrous Glass (45%)
Comment: Bulk complex sample.

James Flores, Laboratory Supervisor, Hayward Laboratory

Note: Limit of Quantification (LOQ) = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

All analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written consent from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full, unless approved by Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Forensic Analytical reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. All samples were received in acceptable condition unless otherwise noted.



Forensic Analytical

BULK SAMPLE REQUEST FORM

IT NAME & ADDRESS: 2921 ⁵⁵ Chico Unified School District 2455 Carmichael Drive Chico, CA 95928	PHONE: (916) 891- FAX: (916) 891-3190	DATE: 11/25
	Circle the Method and Turn Around Time	Results Needed:
	24 hr/12hr/24hr/48hr/Ext	
	PLM: Standard / Point Count	Gravimetry Prep

CONTACT: <u>ROB PETERS</u>		TEM: QUAL / QUANT. / WATER	
P.O.#	JOB #	AA/Flame	AA/Furnace ICP
SITE: <u>310622 UNIT 600</u>		METALS:	

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
12-1	11/25	UNIT 600 ROOF EAST UPPER
12-2	11/25	UNIT 600 ROOF EAST
12-3	11/25	UNIT 600 ROOF NORTH
12-4	11/25	UNIT 600 ROOF WEST
12-5	11/25	UNIT 600 ROOF SOUTH

Sampled by: <u>ROB PETERS</u>	Date: <u>11/25</u> Time: <u>11:00AM</u>
Relinquished by:	Received By: <u>Melissa Carter</u>
Date/Time:	Date/Time: <u>11/27/02 10:00 AM</u>
Inquired by:	Sealed Condition (circle one) YES / NO
Date/Time:	Received By:
Date/Time:	Date/Time:
Date/Time:	Sealed Condition (circle one) YES / NO



**Forensic Analytical
Analytical Report**

Preliminary FAX

Bulk Asbestos Analysis

(EPA Method 600/R-93-116)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045348
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02

Job ID / Site: Bidwell Unit 700

FASI Job ID: 2921-54

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-1	10198356						
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)
 Cellulose (Trace%) Fibrous Glass (45%)
 Comment: Bulk complex sample.

R-2	10198357						
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)
 Cellulose (Trace%) Fibrous Glass (45%)
 Comment: Bulk complex sample.

*cc: Mary
Kip
Bob m.
Rob
Smiles (3)
Giles*



Forensic Analytical
Analytical Report

Preliminary FAX

Bulk Asbestos Analysis

(EPA Method 600/R-93-116)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045348
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02

Job ID / Site: Bidwell Unit 700

FASI Job ID: 2921-54

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-3	10198358						
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (Trace%) Fibrous Glass (45%)
Comment: Bulk complex sample.

R-4	10198359						
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (Trace%) Fibrous Glass (45%)
Comment: Bulk complex sample.



Forensic Analytical
Analytical Report

Preliminary FAX

Bulk Asbestos Analysis

(EPA Method 600/R-93-116)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045348
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02

Job ID / Site: Bidwell Unit 700

FASI Job ID: 2921-54

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-5	10198360						
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (Trace%) Fibrous Glass (45%)
Comment: Bulk complex sample.

James Flores, Laboratory Supervisor, Hayward Laboratory

Note: Limit of Quantification (LOQ) = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

All analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written consent from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full, unless approved by Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Forensic Analytical reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. All samples were received in acceptable condition unless otherwise noted.



Forensic Analytical

BULK SAMPLE REQUEST FORM

IT NAME & ADDRESS: 2921-54 Chico Unified School District 2455 Carmichael Drive Chico, CA 95928	PHONE: (916) 891- FAX: (916) 891-3190	DATE: 11/25
	Circle the Method and Turn Around Time 24 hr/12hr/24hr/48hr/Ext	
	PLM: Standard / Point Count	Results Needed:
	TEM: QUAL. / QUANT. / WATER AA/Flame AA/Furnace ICP	
CONTACT: ROBS PETERS	METALS:	
P.O.#	JOB #	
SITE: BIDWELL UNIT 700		

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
12-1	11/25	ROOF UNIT 700 EAST SIDE UPPER
12-2	↓	ROOF UNIT 700 EAST SIDE
12-3	↓	ROOF UNIT 700 NORTH SIDE
12-4	↓	ROOF UNIT 700 WEST SIDE
12-5	↓	ROOF UNIT 700 SOUTHSIDE

Sampled by: ROBS PETERS	Date: 11/25 Time: 9:30am
Reinquished by:	Received By: <i>Melissa Cole</i>
Date/Time:	Date/Time: 11/25/02 Sealed Condition (circle one) YES / NO
Inquished by:	Received By:
Date/Time:	Date/Time: Sealed Condition (circle one) YES / NO

Maintenance and Operations
2455 Carmichael Drive
Chico, CA 95928
Phone: (530) 891-3195
Fax: (530) 891-3190

Chico Unified School District

November 25, 2002

Forensic Analytical Specialties, Inc.
3777 Depot Road, Suite 409
Hayward, CA 94545

Re: Bidwell Junior High School

To Whom It May Concern:

Please test the enclosed samples from the Bidwell Junior High School Unit 600 and Unit 700 Roofs for asbestos. We would like a 24-hour turnaround on the samples. Please fax the results to us as soon as soon as they are available. Our fax number is (530) 891-3190.

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, East Upper
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-1

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, East
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-2

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, North
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-3

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, West
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-4

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, South
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-5

Forensic Analytical
Bidwell Junior High School
November 25, 2002
Page 2

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, East Side - Upper
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-1

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, East Side
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-2

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, North Side
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-3

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, West Side
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-4

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, South Side
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-5

Thank you for your prompt response to this request.

Sincerely,



Rob Peters
Maintenance/Operations Supervisor

RP:dlg
Enclosures



Bulk Asbestos Analysis

(EPA Method 600/R-93-116, Visual Area Estimation)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045348
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02
First Reported: 11/27/02

Job ID / Site: Bidwell Unit 700

FASI Job ID: 2921-54


Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-1	10198356						
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				

Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (Trace%) Fibrous Glass (45%)
Comment: Bulk complex sample. Collected on 11/25/2002

R-2	10198357						
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				
		Layer: Black Tar	ND				
		Layer: Black Felt	ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (Trace%) Fibrous Glass (45%)
Comment: Bulk complex sample. Collected on 11/25/2002

*C: Mary
Kip
Bob m.
Rob
Binkley (3)
Jill*

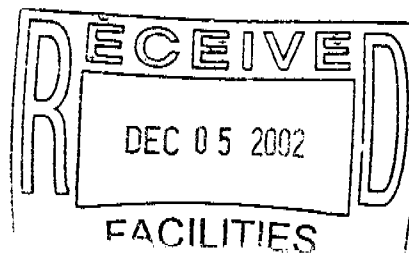



Bulk Asbestos Analysis

(EPA Method 600/R-93-116, Visual Area Estimation)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045348
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02
First Reported: 11/27/02

Job ID / Site: Bidwell Unit 700

FASI Job ID: 2921-54

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-3	10198358						
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		

Total Composite Values of Fibrous Components: **Asbestos:(ND)**
 Cellulose (Trace%) Fibrous Glass (45%)
 Comment: Bulk complex sample. Collected on 11/25/2002

R-4	10198359						
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		

Total Composite Values of Fibrous Components: **Asbestos:(ND)**
 Cellulose (Trace%) Fibrous Glass (45%)
 Comment: Bulk complex sample. Collected on 11/25/2002



Bulk Asbestos Analysis

(EPA Method 600/R-93-116, Visual Area Estimation)

Chico Unified School Dist
Ron Jones

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045348
Date Received: 11/26/02
Date Analyzed: 11/27/02
Date Printed: 11/27/02
First Reported: 11/27/02

Job ID / Site: Bidwell Unit 700

FASI Job ID: 2921-54

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
R-5	10198360						
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		
		Layer: Black Tar			ND		
		Layer: Black Felt			ND		

Composite Values of Fibrous Components: Asbestos:(ND)
 Trace (Trace%) Fibrous Glass (45%)
 Comment: Bulk complex sample. Collected on 11/25/2002

James Flores, Laboratory Supervisor, Hayward Laboratory

Note: Limit of Quantification ('LOQ') = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. Report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced in full, unless approved by Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Forensic Analytical reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. All samples were received in acceptable condition unless otherwise noted.



IT NAME & ADDRESS: 2921-54 Chico Unified School District 2455 Carmichael Drive Chico, CA 95928	PHONE: (916) 891- FAX: (916) 891-3190	DATE: 11/25
	Circle the Method and Turn Around Time 24 hr/12hr/24hr/48hr/Ext	Results Needed:
	PLM: Standard / Point Count	Gravimetry Prep
CONTACT: ROB PETERS.	TEM: QUAL. / QUANT. / WATER	
P.O.#	JOB #	AA/Flame AA/Furnace ICP
SITE: BIDWELL UNIT 700		METALS:

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
12-1	11/25	ROOF UNIT 700 EAST SIDE UPPER
12-2	↓	ROOF UNIT 700 EAST SIDE
12-3		ROOF UNIT 700 NORTH SIDE
12-4		ROOF UNIT 700 WESTSIDE
12-5		ROOF UNIT 700 SOUTHSIDE

Sampled by: ROB PETERS.	Date: 11/25 Time: 9:30am
Relinquished by:	Received By: <i>Melissa Cole</i>
Date/Time:	Date/Time: 11/26/02
Inquished by:	Received By:
Date/Time:	Date/Time:
	Sealed Condition (circle one) YES / NO
	Sealed Condition (circle one) YES / NO

Maintenance and Operations
2455 Carmichael Drive
Chico, CA 95928
Phone: (530) 891-3195
Fax: (530) 891-3190

Chico Unified School District

November 25, 2002

Forensic Analytical Specialties, Inc.
3777 Depot Road, Suite 409
Hayward, CA 94545

Re: Bidwell Junior High School

To Whom It May Concern:

Please test the enclosed samples from the Bidwell Junior High School Unit 600 and Unit 700 Roofs for asbestos. We would like a 24-hour turnaround on the samples. Please fax the results to us as soon as soon as they are available. Our fax number is (530) 891-3190.

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, East Upper
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-1

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, East
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-2

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, North
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-3

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, West
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-4

Site Sampled: Bidwell Junior High School
Location: Unit 600 Roof, South
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-5

Forensic Analytical
Bidwell Junior High School
November 25, 2002
Page 2

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, East Side - Upper
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-1

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, East Side
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-2


Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, North Side
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-3

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, West Side
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-4

Site Sampled: Bidwell Junior High School
Location: Unit 700 Roof, South Side
Date Sampled: November 25, 2002
Number of Samples: One (1) - #R-5

Thank you for your prompt response to this request.

Sincerely,



Rob Peters
Maintenance/Operations Supervisor

RP:dlg
Enclosures

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

10:05 a.m.

School: Bidwell Junior High School

Building: 100

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	CEILING PLASTER	6	1-5 %	UNDETERMINED	ALL ROOMS EXCEPT KITCHEN	(1) (4) ½ - Test ceiling in storage rms in MP	N
T	PIPEWRAP STRAIGHT	8	30-35%	UNDETERMINED	CHAIR STORE ROOM	(1) (4) <i>Same</i>	N
M	FAN VENT INSULATION	94	ASSUMED	UNDETERMINED	FAN ROOMS	(12) COULD NOT FIND THIS ROOM (5) LOCATED IN CHAIR STOREROOM	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS EXCEPT NORTH CHAIR STORE ROOM	(1) (4) <i>Same</i>	N
M	TRANSITE PIPE	99	ASSUMED	UNDETERMINED	KITCHEN AND BOILER ROOMS 1 & 2	(1) (4)	N
M	2 X 4 FCP'S	102	ASSUMED 5% 999-8	UNDETERMINED	ROOM 108	(1)	N
M	DRYWALL	103	ASSUMED	UNDETERMINED	KITCHEN	(1) (4)	N
M	12" VFT	104	ASSUMED	UNDETERMINED	MULTI-PURPOSE ROOM, ROOMS 105, 106, 107, 109, & OFFICE IN ROOM 109	(1) ↓	N

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 200 (AKA 600)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	MUDDED JOINTS	1	1-5%	UNDETERMINED	ROOM 208 NEAR THE SINK	(11) SAME	N
M	PLASTER	5	1-5 %	UNDETERMINED	ALL ROOMS, CLOSET (C), ROOM 204, HALLWAY, ROOM 250, AND GIRLS RESTROOM	(1) (4) WATER STAINS ARE PRESENT. SOME AREAS HAVE 1' X 1' PENETRATIONS WHERE SKY LIGHTS ARE GOING TO BE	N
M	DRYWALL	90	ASSUMED	UNDETERMINED	ROOM 250 & RESTROOM	(1) SAME	N
M	12" VFT	93	ASSUMED	UNDETERMINED	ROOM 208	(1) SAME	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS, HALLWAY 200, ROOM 250, & GIRLS RESTROOM	(1) (4) SAME	N
M	TRANSITE PANEL	98	ASSUMED	UNDETERMINED	METAL SHOP	(4)-(4) (5) WHERE ARE PANELS?	N
M	12" ACT	105	ASSUMED	UNDETERMINED	ROOMS 206, 207, & 209	(1) CHECK PLAN	N

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 300

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	CEILING PLASTER	6	1-5%	UNDETERMINED	ALL CLASSROOMS AND HALLWAY 300	(1) (4) SAME	N
M	2 X 4 FCP'S	106	ASSUMED	UNDETERMINED	ROOMS 308 & 309	(1) CHECK PLAN SAME	N
M	9" VFT	300	ASSUMED	UNDETERMINED	ALL CLASSROOMS, HALLWAY 300, AND GIRLS RESTROOM	(1) SAME	N

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 400 (AKA 700)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	MUDDED JOINTS	1	1-5%	UNDETERMINED	ROOMS 408 & 409	(11) COULD NOT FIND THE JOINTS DURING THE TIME OF INSPECTION.	N/A
T	PIPE WRAP	14	ASSUMED	UNDETERMINED	PE BOILER ROOM & TUNNEL	(1) (4) Same	N
T	TANK WRAP	15	ASSUMED	UNDETERMINED	PE BOILER ROOM	(1) (4)	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL CLASSROOMS	(1) (4)	N
M	TRANSITE PANELS	98	ASSUMED	UNDETERMINED	PANELS IS BOTH LOCKER ROOMS	(1) (4)	N
M	2 X 4 FCP'S	101	ASSUMED	UNDETERMINED	ROOMS 408, 408A, & 409	(1)	N
M	TRANSITE PIPE	107	ASSUMED	UNDETERMINED	CLOSET OF ROOM 405	(1) (4) ▼	N

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 500

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS	(2) CRACKED TILE IN ROOM 502. (1) - 1/2/02	N
M	DRYWALL	100	1%	UNDETERMINED	ALL ROOMS	(1) (4)	N
M	12" ACT	108	ASSUMED	UNDETERMINED	ROOMS 501, 502, OFFICE, AND PRACTICE ROOMS	(1)	N
T	DUCT INSULATION	109	90-95%	UNDETERMINED	DUCT WORK-CEILING AND WALLS	(11) COULD FIND DURING THE TIME OF INSPECTION.	N

Same

School: Bidwell Junior High School

Building: 800

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Y / N
M	9" VFT	95	ASSUMED	UNDETERMINED	LIBRARY	(1) (4)	N
M	12" ACT	109	ASSUMED	UNDETERMINED	LIBRARY, OFFICES, & AUDIO VISUAL	(1)	N
M	PLASTER	110	ASSUMED	UNDETERMINED	THROUGHOUT THE UNIT	(1)	N

Same

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 900

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	PIPE WRAP STRAIGHT	17	15-20%	UNDETERMINED	GYM & STOREROOM	(1) (4)	N
T	PIPE WRAP CORNER	18	5-10%	UNDETERMINED	GYM, BOILER ROOM, & STOREROOM	(1) (4)	N
M	12" ACT	111	ASSUMED	UNDETERMINED	GYM	(1) SOME TILES HAVE BEEN REMOVED. THE MASTIC IS SHOWING	N
						NEED WORK ORDER TO REPLACE TILE	

Same

CONDITION CODE

(5) Tiles Replaced

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 100

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	CEILING PLASTER	6	1-5 %	UNDETERMINED	ALL ROOMS EXCEPT KITCHEN	(1) (4) ½ - Test ceiling in storage rms in MP	N
T	PIPEWRAP STRAIGHT	8	30-35%	UNDETERMINED	CHAIR STORE ROOM	(1) (4)	N
M	FAN VENT INSULATION	94	ASSUMED	UNDETERMINED	FAN ROOMS	(12) COULD NOT FIND THIS ROOM (5) LOCATED IN CHAIR STOREROOM	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS EXCEPT NORTH CHAIR STORE ROOM	(1) (4) Same	N
M	TRANSITE PIPE	99	ASSUMED	UNDETERMINED	KITCHEN AND BOILER ROOMS 1 & 2	(1) (4) ↓	N
M	2 X 4 FCP'S	102	ASSUMED1 5%900-6	UNDETERMINED	ROOM 108	(1) ↓	N
M	DRYWALL	103	ASSUMED	UNDETERMINED	KITCHEN	(1) (4)	N
M	12" VFT	104	ASSUMED	UNDETERMINED	MULTI-PURPOSE ROOM, ROOMS 105, 106, 107, 109, & OFFICE IN ROOM 109	(1)	N

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 200 (AKA 600)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	MUDDED JOINTS	1	1-5%	UNDETERMINED	ROOM 208 NEAR THE SINK	(11)	N
M	PLASTER	5	1-5 %	UNDETERMINED	ALL ROOMS, CLOSET (C), ROOM 204, HALLWAY, ROOM 250, AND GIRLS RESTROOM	(1) (4) WATER STAINS ARE PRESENT. SOME AREAS HAVE 1' X 1' PENETRATIONS WHERE SKY LIGHTS ARE GOING TO BE	N
M	DRYWALL	90	ASSUMED	UNDETERMINED	ROOM 250 & RESTROOM	(1)	N
M	12" VFT	93	ASSUMED	UNDETERMINED	ROOM 208	(1)	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS, HALLWAY 200, ROOM 250, & GIRLS RESTROOM	(1) (4)	N
M	TRANSITE PANEL	98	ASSUMED	UNDETERMINED	METAL SHOP	(1) (4)	N
M	12" ACT	105	ASSUMED	UNDETERMINED	ROOMS 206, 207, & 209	(1) CHECK PLAN	N

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 300

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	CEILING PLASTER	6	1-5%	UNDETERMINED	ALL CLASSROOMS AND HALLWAY 300	(1) (4)	N
M	2 X 4 FCP'S	106	ASSUMED	UNDETERMINED	ROOMS 308 & 309	(1) CHECK PLAN	N
M	9" VFT	300	ASSUMED	UNDETERMINED	ALL CLASSROOMS, HALLWAY 300, AND GIRLS RESTROOM	(1)	N

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 400 (AKA 700)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	MUDDED JOINTS	1	1-5%	UNDETERMINED	ROOMS 408 & 409	(11) COULD NOT FIND THE JOINTS DURING THE TIME OF INSPECTION.	N/A
T	PIPE WRAP	14	ASSUMED	UNDETERMINED	PE BOILER ROOM & TUNNEL	(1) (4)	N
T	TANK WRAP	15	ASSUMED	UNDETERMINED	PE BOILER ROOM	(1) (4)	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL CLASSROOMS	(1) (4)	N
M	TRANSITE PANELS	98	ASSUMED	UNDETERMINED	PANELS IS BOTH LOCKER ROOMS	(1) (4)	N
M	2 X 4 FCP'S	101	ASSUMED	UNDETERMINED	ROOMS 408, 408A, & 409	(1)	N
M	TRANSITE PIPE	107	ASSUMED	UNDETERMINED	CLOSET OF ROOM 405	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACM MATERIAL RECORDS**

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 500

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS	(2) CRACKED TILE IN ROOM 502. (1) - 1/2/02	N
M	DRYWALL	100	1%	UNDETERMINED	ALL ROOMS	(1) (4)	N
M	12" ACT	108	ASSUMED	UNDETERMINED	ROOMS 501, 502, OFFICE, AND PRACTICE ROOMS	(1)	N
T	DUCT INSULATION	109	90-95%	UNDETERMINED	DUCT WORK-CEILING AND WALLS	(11) COULD FIND DURING THE TIME OF INSPECTION.	N

School: Bidwell Junior High School

Building: 800

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Y / N
M	9" VFT	95	ASSUMED	UNDETERMINED	LIBRARY	(1) (4)	N
M	12" ACT	109	ASSUMED	UNDETERMINED	LIBRARY, OFFICES, & AUDIO VISUAL	(1)	N
M	PLASTER	110	ASSUMED	UNDETERMINED	THROUGHOUT THE UNIT	(1)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 900

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	PIPE WRAP STRAIGHT	17	15-20%	UNDETERMINED	GYM & STOREROOM	(1) (4)	N
T	PIPE WRAP CORNER	18	5-10%	UNDETERMINED	GYM, BOILER ROOM, & STOREROOM	(1) (4)	N
M	12" ACT	111	ASSUMED	UNDETERMINED	GYM	(1) SOME TILES HAVE BEEN REMOVED. THE MASTIC IS SHOWING.	N
						NEED WORK ORDER TO REPLACE TILE	

same

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 01/07/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 100

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	CEILING PLASTER	6	1-5 %	UNDETERMINED	ALL ROOMS EXCEPT KITCHEN	(1) (4) ½ - Test ceiling in storage rms in MP	N
T	PIPEWRAP STRAIGHT	8	30-35%	UNDETERMINED	CHAIR STORE ROOM	(1) (4)	N
M	FAN VENT INSULATION	94	ASSUMED	UNDETERMINED	FAN ROOMS	(12) COULD NOT FIND THIS ROOM .	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS EXCEPT NORTH CHAIR STORE ROOM	(1) (4)	N
M	TRANSITE PIPE	99	ASSUMED	UNDETERMINED	KITCHEN AND BOILER ROOMS 1 & 2	(1) (4)	N
M	2 X 4 FCP'S	102	ASSUMED 1 5% 000 S	UNDETERMINED	ROOM 108	(1)	N
M	DRYWALL	103	ASSUMED	UNDETERMINED	KITCHEN	(1)	N
M	12" VFT	104	ASSUMED	UNDETERMINED	MULTI-PURPOSE ROOM, ROOMS 105, 106, 107, 109, & OFFICE IN ROOM 109	(1)	N

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 01/07/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 200 (AKA 600)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	MUDDED JOINTS	1	1-5%	UNDETERMINED	ROOM 208 NEAR THE SINK	(11)	N
M	PLASTER	5	1-5 %	UNDETERMINED	ALL ROOMS, CLOSET (C), ROOM 204, HALLWAY, ROOM 250, AND GIRLS RESTROOM	(1) (4) WATER STAINS ARE PRESENT. SOME AREAS HAVE 1' X 1' PENETRATIONS WHERE SKY LIGHTS ARE GOING TO BE	N
M	DRYWALL	90	ASSUMED	UNDETERMINED	ROOM 250 & RESTROOM	(1)	N
M	12" VFT	93	ASSUMED	UNDETERMINED	ROOM 208	(1)	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS, HALLWAY 200, ROOM 250, & GIRLS RESTROOM	(1) (4)	N
M	TRANSITE PANEL	98	ASSUMED	UNDETERMINED	METAL SHOP	(1) (4)	N
M	12" ACT	105	ASSUMED	UNDETERMINED	ROOMS 206, 207, & 209	(1)	N

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (if Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 01/07/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 300

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	CEILING PLASTER	6	1-5%	UNDETERMINED	ALL CLASSROOMS AND HALLWAY 300	(1) (4)	N
M	2 X 4 FCP'S	106	ASSUMED	UNDETERMINED	ROOMS 308 & 309	(1)	N
M	9" VFT	300	ASSUMED	UNDETERMINED	ALL CLASSROOMS, HALLWAY 300, AND GIRLS RESTROOM	(1)	N

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 01/07/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 400 (AKA 700)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	MUDDED JOINTS	1	1-5%	UNDETERMINED	ROOMS 408 & 409	(11) COULD NOT FIND THE JOINTS DURING THE TIME OF INSPECTION.	N/A
T	PIPE WRAP	14	ASSUMED	UNDETERMINED	PE BOILER ROOM & TUNNEL	(1) (4)	N
T	TANK WRAP	15	ASSUMED	UNDETERMINED	PE BOILER ROOM	(1) (4)	N
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL CLASSROOMS	(1) (4)	N
M	TRANSITE PANELS	98	ASSUMED	UNDETERMINED	PANELS IS BOTH LOCKER ROOMS	(1) (4)	N
M	2 X 4 FCP'S	101	ASSUMED	UNDETERMINED	ROOMS 408, 408A, & 409	(1)	N
M	TRANSITE PIPE	107	ASSUMED	UNDETERMINED	CLOSET OF ROOM 405	(1) (4)	N

CONDITION CODE

- General Condition:** (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**SIX MONTH SURVEILLANCE
HOMOGENEOUS ACBM MATERIAL RECORDS**

Date of Inspection: 01/07/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Bidwell Junior High School

Building: 500

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	9" VFT	95	ASSUMED	UNDETERMINED	ALL ROOMS	(2) CRACKED TILE IN ROOM 502. (1) - 1/2/02	N
M	DRYWALL	100	1%	UNDETERMINED	ALL ROOMS	(1) (4)	N
M	12" ACT	108	ASSUMED	UNDETERMINED	ROOMS 501, 502, OFFICE, AND PRACTICE ROOMS	(1)	N
T	DUCT INSULATION	109	90-95%	UNDETERMINED	DUCT WORK-CEILING AND WALLS	(11) COULD FIND DURING THE TIME OF INSPECTION.	N

School: Bidwell Junior High School

Building: 800

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Y / N
M	9" VFT	95	ASSUMED	UNDETERMINED	LIBRARY	(1) (4)	N
M	12" ACT	109	ASSUMED	UNDETERMINED	LIBRARY, OFFICES, & AUDIO VISUAL	(1)	N
M	PLASTER	110	ASSUMED	UNDETERMINED	THROUGHOUT THE UNIT	(1)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, No inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS