

SHORT-TERM WORKER NOTIFICATION UNDER AHERA

40 CFR PART 763.84(d) Requires that the local education agency shall ensure that short-term workers (e.g. telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Date:

Contractor organization: EAGLE ELECTRIC AND ELECTRONIC SECURITY

Address: 2300 PARK AVE., CHICO, CA. 95928

Description of work to be performed:

INSTALLATION OF TWO ELECTRICAL OUTLETS IN TEACHERS WORK ROOM AT ROSEDALE SCHOOL.

Location(s) of work:

Unit "C" - TEACHER'S WORK ROOM - ROSEDALE ELEMENTARY

Type, amount and location of ACBM in work area:

NON-FRIABLE, TROWELED ON CEILING, IN TEACHER'S WORK ROOM  
1-5% ASBESTOS/CHALYSOTILE

It is the explicit condition of the performance of this work that no asbestos be disturbed.

Paul B. [Signature]  
LEA Designee

Keith T. Kelley  
(Worker/Contractor Signature)

1-22-90  
Date

[Signature]  
(Worker/Contractor Signature)

1-22-90  
Date

[Signature]  
(Worker/Contractor Signature)


1-23-90  
Date

\_\_\_\_\_  
(Worker/Contractor Signature)

\_\_\_\_\_  
Date

\_\_\_\_\_  
(Worker/Contractor Signature)

\_\_\_\_\_  
Date

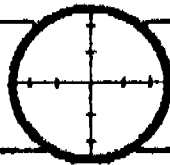

# PRECISION MICRO-ANALYSIS

SPECIALISTS IN ASBESTOS-RELATED ANALYSIS

**Bulk Sample Analysis (PLM) Report for:**

Robert Peters  
Chico Unified School District  
2455 Carmichael Drive  
Chico, CA 95969

Phone:(916)891-3095

**Report # 90141012**

Date Collected:05/18/90

Date Received:05/21/90

Date Analyzed:05/21/90

Job:Rosedale School

Sample Number	Sample Location	Sample Description	Analytical Results
1	Rosedale roof (lower deck) Unit B	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers
Lab #90-30055			
2	Rosedale roof (lower deck) Unit B	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers 5-10% Synthetic fibers
Lab #90-30056			
3	Rosedale roof (lower deck) Unit B	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers 1-5% Synthetic fibers
Lab #90-30057			
4	Rosedale roof (lower deck) Unit C	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers 5-10% Synthetic fibers
Lab #90-30058			
5	Rosedale roof (lower deck) Unit C	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers
Lab #90-30059			
6	Rosedale roof (lower deck) Unit C	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers
Lab #90-30060			


Total Number of Samples: 9

Page 1

Supervisor \_\_\_\_\_

Analyst \_\_\_\_\_

Note: The test result findings of this report are made to the methodologies and parameters described on the reverse side of this page

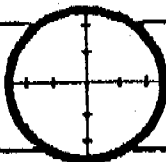

# PRECISION MICRO-ANALYSIS

SPECIALISTS IN ASBESTOS-RELATED ANALYSIS

**Bulk Sample Analysis (PLM) Report for:**

**Report # 90141012**

Robert Peters  
Chico Unified School District  
2455 Carmichael Drive  
Chico, CA 95969

Date Collected: 05/18/90  
Date Received: 05/21/90  
Date Analyzed: 05/21/90

Job: Rosedale School

Phone: (916)891-3095

Sample Number	Sample Location	Sample Description	Analytical Results
7	Rosedale roof (lower deck) Unit E	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers 1-5% Synthetic fibers
Lab #90-30061			
8	Rosedale roof (lower deck) Unit E	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers 1-5% Synthetic fibers
Lab #90-30062			
9	Rosedale roof (lower deck) Unit E	Black fibrous roofing material	No asbestos detected 80-85% Cellulose fibers 1-5% Synthetic fibers
Lab #90-30063			

Total Number of Samples: 9

Page 2

Supervisor \_\_\_\_\_

Analyst \_\_\_\_\_

Note: The test result findings of this report are made to the methodologies and parameters described on the reverse side of this page

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE Dec. 6, 1990

SCHOOL Rosedale Elementary INSPECTOR Robert Peters R.P.

BLDG. \_\_\_\_\_ HOMOG. \_\_\_\_\_ ASBESTOS \_\_\_\_\_  
 MAT.# \_\_\_\_\_ MATERIAL \_\_\_\_\_ LOCATION \_\_\_\_\_  
 CONDITION: CODE & COMMENTS

A	Ceill Plas	1-5	Room 2, both RR	(7) Removed
A	Mud Jnts	70-75	Room 3, Boiler Room	(7) Removed
B	Ceill Plas	1-5	Room 9 & 7, Lounge & RR	(7) Removed
B	9" VFT Bg	1-5	Room 1 (5 classrooms)	(7) Removed
C	9" VFT Bg	1-5	Room 1 (5 classrooms)	(7) Removed
D	Ceill Plas	1-5	Unit D all rooms except Kitchen area	(7) Removed
D	9" VFT Gn	5-10	Rm 11,19,15,17,16,18,20	(5)-(2) 11 tiles under dishw
D	9" VFT Gn	5-10	Rm 20,19,10,11,12,13	(7) Removed
D	PW Debris	65-70	Rm 19 access to radiator	(7) Removed
D	PW Str 4"	1-5	Rm 17 storage (MP)	(7) Removed
D	PW Cnr	1-5	Rm 17 storage (MP)	(7) Removed

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)  
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)  
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED  
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)



SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE July 10, 1990

SCHOOL Rosedale Elementary INSPECTOR Robert Peters *R.S.*

BLDG.	HOMOG. MAT.#	ASBESTOS MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
A	Ceill Plas	1-5	Room 2, both RR	(7) Removed
A	Mud Jnts	70-75	Room 3, Boiler Room	(7) Removed
B	Ceill Plas	1-5	Room 9 & 7, Lounge & RR	(7) Removed
B	9" VFT Bg	1-5	Room 1 (5 classrooms)	(7) Removed
C	9" VFT Bg	1-5	Room 1 (5 classrooms)	(7) Removed
D	Ceill Plas	1-5	Unit D all rooms except Kitchen area	(7) Removed (1) Good - paint peeling
D	9" VFT Gn	5-10	Rm 11, 19, 15, 17, 16, 18, 20	(1) Good
D	9" VFT Gn	5-10	Rm 20, 19, 10, 11, 12, 13	(7) Removed
D	PW Debris	65-70	Rm 19 access to radiator	(7) Removed
D	PW Str 4"	1-5	Rm 17 storage (MP)	(7) Removed
D	PW Cnr	1-5	Rm 17 storage (MP)	(7) Removed

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)  
CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)  
ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED  
MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)



SHORT-TERM WORKER NOTIFICATION UNDER AHERA

40 CFR PART 763.84(d) Requires that the local education agency shall ensure that short-term workers (e.g. telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Date: 1/22/90

Contractor organization: EAGLE ELECTRIC AND ELECTRONIC SECURITY

Address: 2300 PARK AVE., CHICO, CA. 95928

Description of work to be performed:

INSTALLATION OF TWO ELECTRICAL OUTLETS IN TEACHERS WORK ROOM AT ROSEDALE SCHOOL.

Location(s) of work:

Unit "C" - TEACHER'S WORK ROOMS - ROSEDALE ELEMENTARY

Type, amount and location of ACBM in work area:

NON-FRIABLE, TROWELED ON CEILING, IN TEACHER'S WORK ROOMS  
1-5% ASBESTOS/CHALYSOTILE

It is the explicit condition of the performance of this work that no asbestos be disturbed.

Paul B. [Signature]  
LEA Designee

Keith T. Kelley  
(Worker/Contractor Signature)

1-22-90  
Date

George [Signature]  
(Worker/Contractor Signature)

1-22-90  
Date

[Signature]  
(Worker/Contractor Signature)

1-23-90  
Date

\_\_\_\_\_  
(Worker/Contractor Signature)

\_\_\_\_\_  
Date

\_\_\_\_\_  
(Worker/Contractor Signature)

\_\_\_\_\_  
Date