

HMS, Inc.
HAZARD MANAGEMENT SERVICES, INC.

4200 Rocklin Rd., Ste. 11A
Rocklin, CA 95677-2860
(916) 632-6800 • (916) 632-6841 Fax

May 26, 2004

Mr. Kip Hansen
Chico Unified School District
1163 E. Seventh Street
Chico, CA 95928

RE: Fifth Triennial AHERA Three-Year Reinspection

Dear Mr. Hansen:

Enclosed is the data obtained from the fifth AHERA three-year reinspections Hazard Management Services, Inc. (HMS, Inc.) conducted between April 14 and May 4, 2004. The documents included with this letter are the "Three-Year Reinspection Homogeneous ACBM Material Records" covering all buildings known from the original inspection to contain ACBM. The sites enclosed are Chico Junior High, Chico Senior High, Hooker Oak Elementary, Pleasant Valley High, and Sierra View Elementary Schools.

You should review the updated Homogeneous Materials Reports to familiarize yourself with the current status of asbestos containing materials and identified suspect asbestos materials. It is the District's responsibility to assure that the school's site copy of the Management Plan is up to date and consistent with the District's Management Plan for that site. This is very important and if not done can cause the District to be penalized during an EPA site visit or investigation.

HMS, Inc. wants to remind you that materials containing "trace" amounts of asbestos must be considered in the event of renovations or demolitions. Although building materials containing trace amounts of asbestos (<1%) are not regulated under EPA, Cal/OSHA does regulate work practices with materials containing 0.1% asbestos. The original AHERA inspection contains information regarding materials with trace amounts of asbestos.

When you provide your annual notification to parents and staff, include information regarding this three-year reinspection. Enclosed is a suggested format for your notification letter. Please note that you must include in your Management Plans a description of the steps you take to notify. It is also important that your Management Plans be updated after any and all actions conducted which impact asbestos containing materials.

Please remember that HMS, Inc. did not inspect new buildings or portable classrooms which were placed on the District sites since the original EPA AHERA inspection. It is the District's responsibility to obtain letters of certification from the Architect, Construction Superintendent, or manufacturer of new building materials, indicating there is no asbestos in the new buildings (constructed after October 12, 1988) or new building materials. A copy of these certification letters must be included in your management plans, both at the school site and at the LEA Designees office site. It is still required of School Districts to send a copy of these certification letters to the US EPA AHERA unit; Region IX in San Francisco.

Mr. Kip Hansen
Chico Unified School District
May 26, 2004
Page Two

HMS, Inc. was unable to confirm new information found in the updated inspection reports provided by the District, which reported the removal of materials and sampling of materials performed by the District.

Since HMS, Inc. was not provided with the supporting documentation pertaining to the removal and sampling completed by the District, any and all changes from the last 3 year reinspections as to the removal of previously identified "assumed" or asbestos containing materials, or sample result changes are the sole responsibility of the District. By submitting this finalized report, HMS, Inc. is neither confirming or denying these changes.

It is not necessary to send a copy of the three-year reinspection to the OPSC or EPA. However, the report should be included in your Management Plan. I want to thank you for your cooperation. If you have any questions, please feel free to contact me at (916) 632-6800.

Sincerely,



John Angi
Certified Asbestos Consultant
CAC #03-3330

Enclosures

RECORD OF FRIABLE AND NONFRIABLE ACM
(FORM B)

Inspection Date(s) May 4, 2004

THREE-YEAR REINSPECTION

SCHOOL Chico Senior High School					CDS CODE 04-61424-0431676
ADDRESS (NUMBER) (STREET) (CITY) (ZIP) 901 The Esplanade Chico, CA 95926					SCHOOL PHONE NUMBER (530) 891-3026

-IMPORTANT-

Each building and functional space with friable ACBM or friable assumed ACBM listed on this form requires completion of FORM C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACBM OR FRIABLE ASSUMED ACBM). Indicate location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE (Indicate Address if Different From Above)	CHECK ONE			CHECK ONE			
		SUR- FACING	TSI	MISC	ACBM		ASSUMED ACBM	
					FRIABLE	NON- FRIABLE	FRIABLE	NON- FRIABLE
1.	A		X	X		X		X
2.	A (UNIT 200) UPSTAIRS			X		X		
3.	B (UNIT 100)			X		X		X
4.	C (UNIT 300)			X		X		X
5.	D & H (UNIT 700 MUSIC & HOME EC)	X	X	X		X		X
6.	L (UNIT 400 LIBRARY)		X	X		X		X
7.	F (UNIT 500)		X	X		X		X
8.	S (UNIT 600 SCIENCE)		X	X		X		X
9.	LH-800	X	X	X		X		X
10.	900 GYM		X			X		
11.	IT-1000		X	X		X		X
12.	AG-1100	X		X		X		X
13.	20 PORTABLE CLASSROOMS AND 2 PORTABLE RESTROOMS ON WEST CAMPUS DISTRICT MUST CERTIFY							
14.								
15.								
16.								
17.								

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: A

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
M	2' X 4' FCP	1	NONE DETECTED	5,735 S	ADMINISTRATION AREA	(13) SAMPLE HMS-CHS-01 COLLECTED ON 3-28-88.	N/A
M	12" VFT BEIGE	2	TRACE	5,700 S	RECEPTION AREA	(1) (4)	N
M	12" ACT	3	NONE DETECTED	3,550 S	PRINCIPLES OFFICE, COMPTROLLER, DW, AND CLASSROOMS 102-107	(13) SAMPLE HMS-CHS-03 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	7	5-10%	20 JOINTS	DARK ROOM ATTIC (CLASSROOM 111)	(1) (4)	N
T	MESH WRAP	8	12-20%	1/2 L	DARK ROOM ATTIC (CLASSROOM 111)	(11) INACCESSIBLE.	N
M	TRANSITE PANELS	95	ASSUMED	1,300 S	ALONG WALKWAYS, JANITORS CLOSETS, RESTROOMS, AND STAIRWELLS	(1) (5) PANELS PAINTED WHITE 11/19/03.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: A (Unit 200) Upstairs

Material Class	Material	Homo. Mat. #	% Asb.	FT ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
M	12" VFT BEIGE	2	TRACE	5,800 S	UPSTAIRS CLASSROOMS	(1) (4)	N
M	2' X 4' FCP	6	NONE DETECTED	10,000 S	UPSTAIRS CLASSROOMS	(13) SAMPLE HMS-CHS-06 COLLECTED ON 3-28-88.	N/A

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: B (Unit 100)

Material Class	Material	Homo. Mat. #	% Asb.	FT ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
M	2' X 4' FCP	13	NONE DETECTED	10,000 S	ALL CLASSROOMS	(13) SAMPLE HMS-CHS-13 COLLECTED ON 3-28-88.	N/A
M	12" VFT	14	1-5%	9,430 S	ALL CLASSROOMS	(7) REMOVED AND REPLACED WITH 12" VFT TAN IN JUNE, 2003.	N/A
M	TRANSITE PANELS	95	ASSUMED	1,300 S	ALONG WALKWAYS, JANITORS CLOSETS, RESTROOMS, AND STAIRWAYS	(1) (5) PANELS PAINTED WHITE 11/19/03.	N
M	12" VFT TAN	152	ASSUMED	9,430 S	THROUGHOUT	(1) DISTRICT MUST CERTIFY.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: C (Unit 300)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frangible Yes/No
M	12" VFT	14	1-5%	9,513 S	ALL CLASSROOMS	(1) (4) ABATED IN JUNE, 2003 ACCORDING TO CHICO USD RECORDS.	N
M	TRANSITE PANELS	95	ASSUMED	1,300 S	EXTERIOR OF BUILDING	(1) (5) PANELS PAINTED WHITE 11/19/03.	N
M	12" VFT TAN	150	ASSUMED	9,513 S	ALL CLASSROOMS	(1) DISTRICT MUST CERTIFY.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: D & H (Unit 700 Music & Home EC)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frangible Yes/No
T	BOILER INSULATION	37	25-35%	48 S	HOME EC & BOILER ROOM	(7)	N/A
S	TROWELED ON CEILING	38	1-5%	300 S	INSTRUMENT STORAGE ROOM & BAND ROOM OFFICE	(1) (4)	N
M	9" VFT YELLOW	39	5-10%	1,410 S	MUSIC WING HALL, CHORAL ROOM UNDER RISERS, BAND ROOM OFFICE, & CHORAL ROOM STORAGE	(1) (4) 9" VFT UNDER CARPET IN BAND ROOM OFFICE.	N
M	TRANSITE PEG BOARD	41	15-20%	1,000 S	BAND PRACTICE ROOM & CUSTODIAL ROOM	(7) REMOVED ON JUNE, 2003.	N/A
T	PIPEWRAP STRAIGHT	80	75-80%	58 L	HOME EC STORAGE CLOSET	(7) REMOVED ON JUNE, 2003.	N/A
T	PIPEWRAP STRAIGHT	81	75-80%	120 L	2 ND HOME EC STORAGE CLOSET	(7) REMOVED ON JUNE, 2003.	N/A
T	PIPEWRAP CORNER	82	75-80%	>1 EACH	HOME EC STORAGE CLOSET	(7) REMOVED ON JUNE, 2003.	N/A
M	FIRE DOOR	83	25-35%	1 EACH	HOME EC HEATER ROOM	(7) REMOVED ON JUNE, 2003.	N/A

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chicago Unified School District

Inspector: John Angi

School: Chicago Senior High School

Building: D & H (Unit 700 Music & Home EC)
(Continued)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Fiabile Yes/No
T	PIPEWRAP STRAIGHT	84	5-10%	58 L	HOME EC HEATER ROOM	(7)	N/A
M	HOLDING TANK	94	ASSUMED	72 S	HOME EC HEATER ROOM	(7) REMOVED ON JUNE, 2003.	N/A
T	PIPEWRAP AIRCELL	97	ASSUMED	70 L	UNDER CHORAL RISERS	(7)	N/A
M	TRANSITE PIPE	98	ASSUMED	8 L	HOME EC HEATER ROOM	(7)	N/A
M	12" VFT GREY	100	ASSUMED	810 S	MUSIC WING HALL	(7) REMOVED ON JUNE, 2003 AND REPLACED WITH 12" VFT TAN	N/A
M	12" VFT TAN	150	ASSUMED	1,200 S	MUSIC WING HALL	(1) DISTRICT MUST CERTIFY.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chicago Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: L (Unit 400 Library)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
M	12" VFT	14	1-5%	1,000 S	LIBRARY ENTRY & OFFICE AREA	(7) REMOVED AND REPLACED WITH 12" MOTTLED VFT.	N/A
M	2' X 4' FCP	17	NONE DETECTED	11,155 S	ALL ROOMS	(13) SAMPLE HMS-CHS-17 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	19	5-10%	20 JOINTS	LIBRARY ATTIC	(1) (6) REPAIRED.	N
M	12" VFT MOTTLED	151	ASSUMED	850 S	LIBRARY ENTRANCE/OFFICE	(1) DISTRICT MUST CERTIFY.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR INSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: F (Unit 500)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
I	MUD JOINTS	52	5-10%	125 JOINTS	FINE ARTS	(1) (4)	N
M	2' X 4' FCP	59	NONE DETECTED	4,500 S	ALL CLASSROOMS	(13) SAMPLE HMS-CHS-59 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	60	5-10%	12 L	CLASSROOM F-1	(1) (4)	N
M	9" VFT	61	TRACE	4,500 S	ALL CLASSROOMS	(1) (4)	N
M	TRANSITE PANELS	95	ASSUMED	150 S	2 KILNS	(1) (4)	N
M	KILN BRICK, TAN	151	NONE DETECTED	10.5 S	INSIDE OLDER TRANSITE PANELS ENCASED KILN	(13) SAMPLE HMS-R1303-01A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK, WHITE	152	NONE DETECTED	10.5 S	LARGER OLDER TRANSITE PANEL ENCASED KILN	(13) SAMPLE HMS-R1303-02A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK, WHITE	153	NONE DETECTED	10.5 S	METAL ENCASED CRESS ELECTRIC KILN MODEL A-22-H	(13) SAMPLE HMS-R1303-03A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK	154	NONE DETECTED	10.5 S	SMALL KILN APPROXIMATELY 2' HIGH BY 14" SQUARE WITH B-19 ON SIDE	(13) SAMPLE HMS-R1303-04A COLLECTED ON 4-13-04.	N/A
M	KILN BRICK	155	NONE DETECTED	10.5 S	3' SQUARE KILN	(13) SAMPLE HMS-R1303-05A COLLECTED ON 4-13-04.	N/A
S	STUCCO	156	<1% CHRYSOITILE	220 S	EXTERIOR WALL AT SOUTH SIDE OF CERAMICS LAB ROOM 505	(1) SAMPLE HMS-R1303-06A COLLECTED ON 4-13-04.	N
M	VINYL COVERED TAGBOARD	157	NONE DETECTED	800 S	CERAMICS LAB ROOM 505D	(13) SAMPLE HMS-R1303-07A COLLECTED ON 4-13-04.	N/A

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: S (Unit 600 Science)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
M	2' X 4' FCP	22	NONE DETECTED	8,000 S	ALL ROOMS	(13) SAMPLE HMS-CHS-22 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	23	5-10%	40 JOINTS	ALL ROOMS	(1) (4)	N
M	9" VFT	24	1-5%	8,100 S	ALL ROOMS	(1) (4)	N
T	PIPE WRAP STRAIGHT	26	65-70%	12 L	ROOM 5 (STORE ROOM)	(12) UNABLE TO LOCATE.	N
M	BLACK COUNTER TOPS	99	ASSUMED	UNDETERMINED	IN ALL SCIENCE ROOMS	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chlico Unified School District

Inspector: John Angi

School: Chlico Senior High School

Building: LH-800

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Frangible Yes/No
T	PIPEWRAP STRAIGHT	45	35-40%	3 L	CUSTODIAL ROOM	(1) (4)	N
T	MUD JOINTS	52	5-10%	10 EACH	UNDER STAGE	(1) (4)	N
M	9" VFT GREY	55	1-5%	6,800 S	KITCHEN & MPR	(1) (6) REPAIRED.	N
S	TROWELED ON CEILING	57	1-5%	900 S	ALL ROOMS	(1) (6) PAINTED.	N
M	TRANSITE PANELS	95	ASSUMED	364 S	SNACK BAR, STAGE, AND CAFE	(1) (4)	N
M	9" VFT	101	ASSUMED	250 S	UNDER STAGE	(2) SOME BROKEN TILES.	N
T	MUD JOINTS	102	5-10%	10 EACH	TEACHER'S LOUNGE RESTROOMS	(1) (4)	N
M	TRANSITE PIPE	103	ASSUMED	12 L	WATER HEATER ROOM (2 PIPES)	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: 900 GYM

Material Class	Material	Homo. Mat. #	% Asb.	FT ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	WALLS & CEILING PLASTER	46	NONE DETECTED	2,000 S	ALL ROOMS EXCEPT BOILER	(13) SAMPLE HMS-CHS-46A-C COLLECTED ON 3-28-88. ADDITIONAL SAMPLES HMS-93103-03A-C COLLECTED ON 7-8-93.	N/A
T	PIPEWRAP STRAIGHT	50	50-55%	2,700 S	GIRL'S & BOY'S LOCKER ROOM AND BOILER ROOM CRAWL SPACE	(10) ISOLATED & RESTRICTED	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chico Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: IT-1000

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	PIPEWRAP STRAIGHT	45	35-40%	700 L	AUTO SHOP, LOFT, AND WOOD SHOP	(1) (4)	N
T	BREECHING INSULATION	90	15-20% AMOSITE	100 S	WOOD FINISHING ROOM	(1) (4) REPRESENTED BY SAMPLES HMS-R1303-09A & B COLLECTED ON 4-13-04.	N
M	9" VFT TAN	152	ASSUMED	1,800 S	HALLWAYS AND CLASSROOMS IT2 & IT6	(1) SOME BROKEN TILES.	N
M	DRYWALL & JOINT COMPOUND	158	<1% CHRYSOTILE (COMPOSITE)	400 S	NORTH & SOUTH WALL OF PROJECT AND HAM ROOMS OFF ELECTRONICS, SOUTH WEST CORNER WALL OF NORTH OFFICE BY RESTROOMS, OFFICE BY TOILET ROOM TO MECHANICAL DRAWING, AND FINISH ROOM	(1) (4) SAMPLES HMS-R1303-10A-E COLLECTED ON 4-13-04. DRYWALL - NONE DETECTED, JOINT COMPOUND - 1-2% CHRYSOTILE, AND COMPOSITE - <1% CHRYSOTILE.	N
M	WHITE DOOR INSULATION	159	10-15% CHRYSOTILE 10-15% AMOSITE	40 S	PROJECT AND HAM ROOM	(1) (4) SAMPLE HMS-R1303-11A COLLECTED ON 4-13-04.	N
S	UPPER WALL PLASTER	165	NONE DETECTED	UNDETERMINED	TOILET ROOM	(13) SAMPLES HMS-R1303-08A-C COLLECTED ON 4-13-04.	N/A

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR INSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004
Inspector: John Angi
Building: AG-1100

District: Chico Unified School District

School: Chico Senior High School

Material Class	Material	Homo Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
S	WALL PLASTER	46	1-5%	950 S	AG CLASSROOM 2 (SPACE 3)	(1) (4)	N
M	TRANSITE PANELS	48	15-20%	200 S	AG SHOP WELD BOOTHS & TABLES	(1) (4)	N
M	12" VFT MOTTLED & YELLOW MASTIC	89	NONE DETECTED	400 S	CLASSROOM 2	(13) REPRESENTED BY SAMPLE HMS-R1303-12A COLLECTED ON 4-13-04.	N
M	TRANSITE PIPES	96	ASSUMED	12 L	AG SHOP (2 PIPES)	(1) (4)	N
M	WALL PLASTER	160	NONE DETECTED	150 S	SOUTH WEST CORNER AREA BY DOOR OF TOILET ROOM OF CLASSROOM 1	(13) SAMPLE HMS-R1303-15A COLLECTED ON 4-13-04.	N/A
S	STUCCO	161	NONE DETECTED	UNDETERMINED	EXTERIOR SOUTH ENTRY DOOR AND EAST WALL BY COKE MACHINE	(13) SAMPLES HMS-R1303-16A & B COLLECTED ON 4-13-04.	N/A
M	LINOLEUM LIKE COUNTER TOP W/ASPHALT LIKE BACKING - GREEN	162	NONE DETECTED	UNDETERMINED	AG-2 - CLASSROOM 3	(13) SAMPLE HMS-R1303-17A COLLECTED ON 4-13-04.	N/A
M	BROWN COLORED GLOSS LIKE FLOOR FINISH	163	NONE DETECTED	UNDETERMINED	HALLWAY BY CLASSROOM 2	(13) SAMPLE HMS-R1303-13A COLLECTED ON 4-13-04.	N/A
M	GREEN COLORED GLOSS LIKE FLOOR FINISH	164	NONE DETECTED	UNDETERMINED	TOILET ROOM OFF AG SHOP CLASSROOM 1	(13) SAMPLE HMS-R1303-14A COLLECTED ON 4-13-04.	N/A

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 4, 2004

District: Chicago Unified School District

Inspector: John Angi

School: Chico Senior High School

Building: 20 Portable Classrooms and 2 Portable Restrooms on West Campus

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Frangible Yes/No
					20 PORTABLE CLASSROOMS AND 2 PORTABLE RESTROOMS	DISTRICT CERTIFICATION REQUIRED.	


CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS



A circular seal with a ribbon banner across the bottom. The banner reads "Blue Ribbon School 1997-1998". The top of the seal features the text "A National Achievement". The center of the seal contains a stylized eagle or crest.

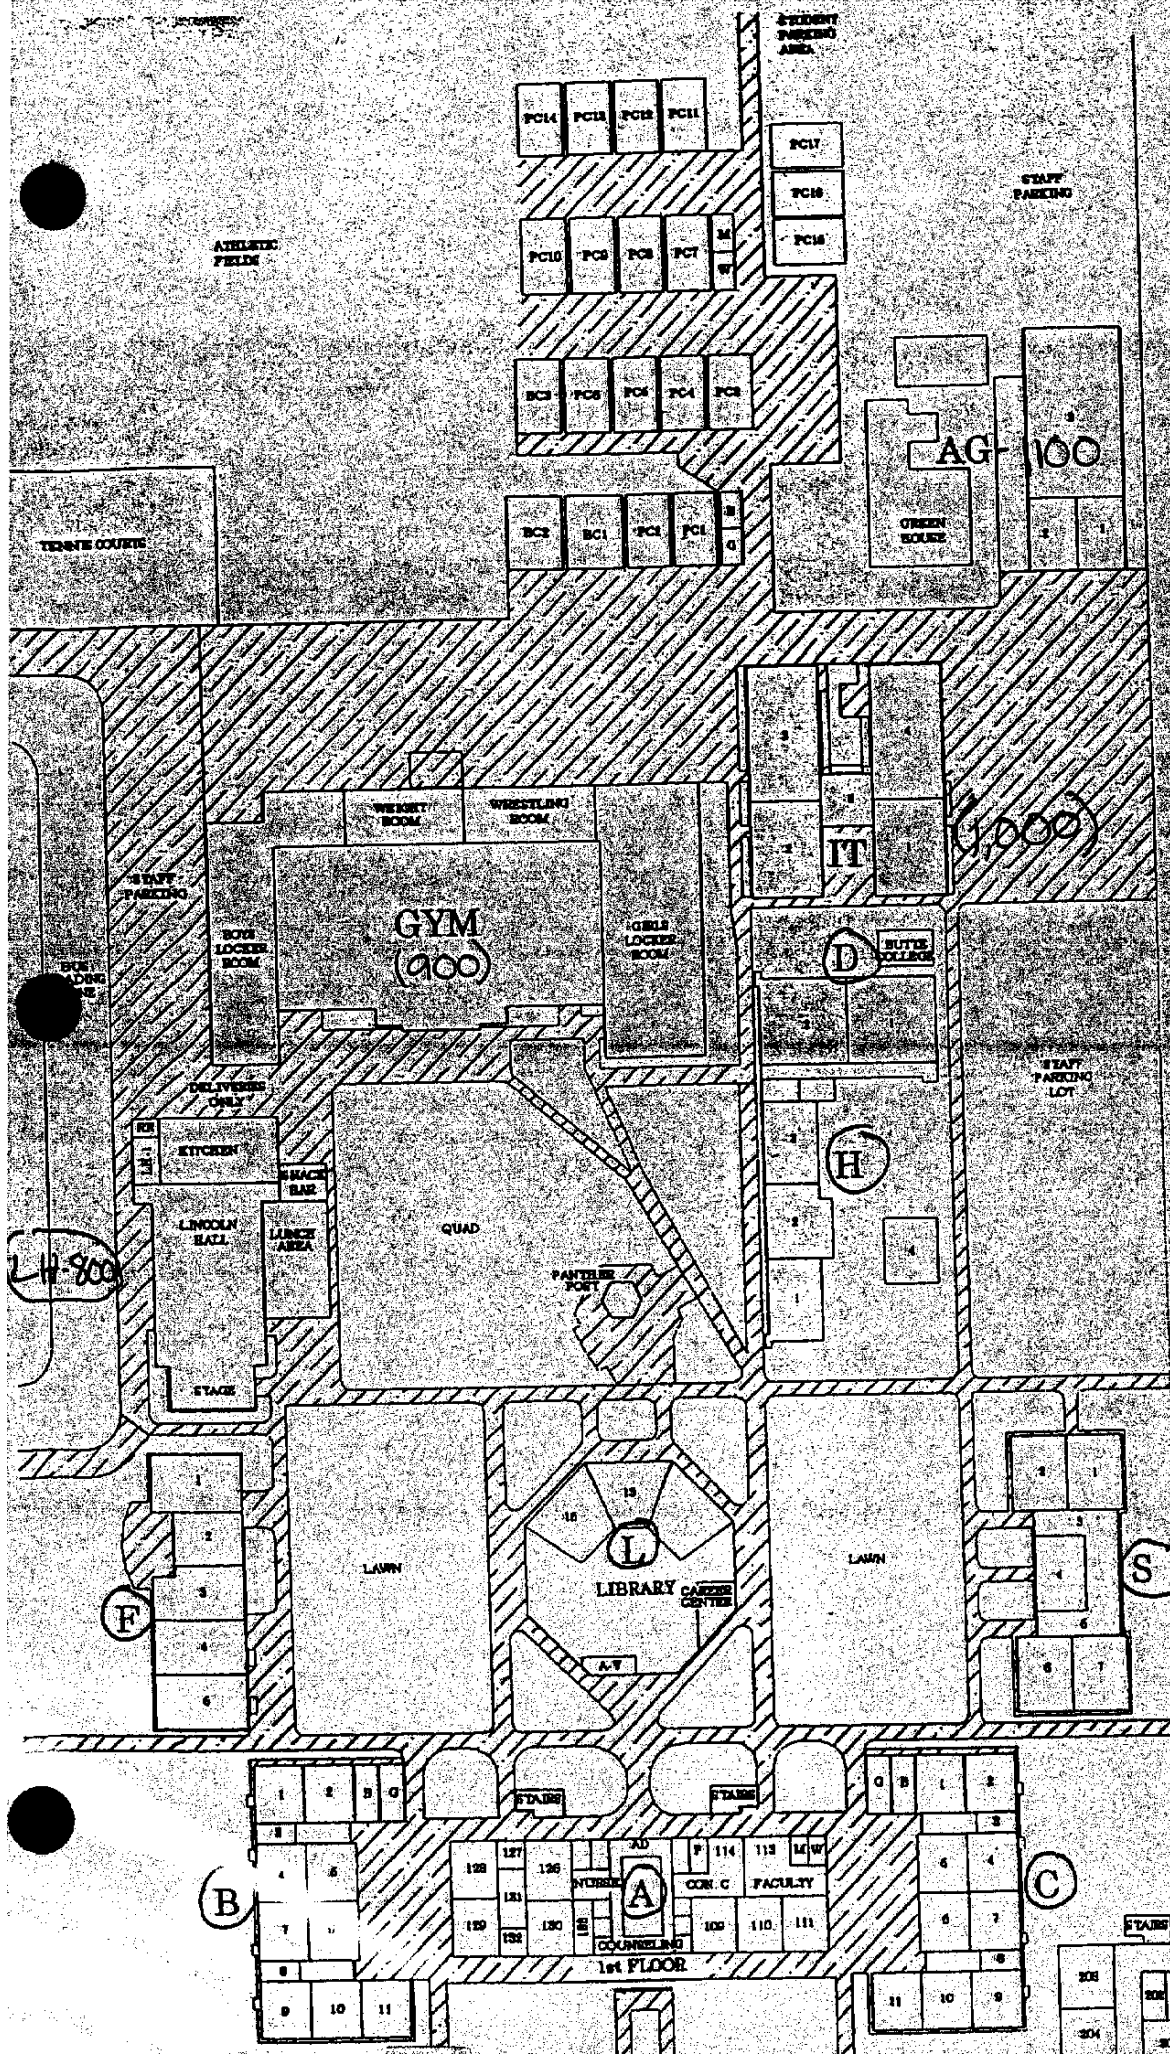

State of California
Division of Occupational Safety and Health

Certified Asbestos Consultant

John A. Angi



Name

03-3330

Certification No.

4/23/2005

Expires on

This certification was issued by the Division of
Occupational Safety and Health as authorized by
Section 7180 et seq. of the Business and
Professions Code.

Hazard Management Services, Inc.

This is to confirm that

John A. Angi

has attended the eight-hour

***AHERA Refresher Course for Asbestos Inspectors and
Management Planners***

and has completed the requisite training for asbestos accreditation under TSCA Title II

September 10, 2003

Certificate number: 14

Valid until: September 10, 2004

Cal/OSHA approval number: CA-025-06/CA-025-08


Tom Wangerin, MS, CAC
AHERA Training Director
Hazard Management Services, Inc.
367 Civic Drive, Suite 7
Pleasant Hill, CA 94523-1936
925-363-3442