

pu # 27

Maintenance and Operations
2455 Carmichael Drive
Chico, CA 95928
Phone: (530) 891-3095
Fax: (530) 891-3190

Chico Unified School District

July 8, 2002

COPY

Forensic Analytical Specialties, Inc.
3777 Depot Road, Suite 409
Hayward, CA 94545

Re: Chico Junior High School – Hallway at Gym

To Whom It May Concern:

Please test the enclosed samples from the Chico Junior High School Gym Hallway for asbestos. We would like a 24-hour turn around on the samples. Please fax the results to us as soon as they are available. Our fax number is (530) 891-3190.

Site Sampled: Chico Junior High School

Location: Hallway at Gym


Date Sampled: July 5, 2002

Number of Samples: Three (3)

Sample Taken by: Robert Peters

Thank you for your prompt response to this request.

Sincerely,



Rob Peters
Maintenance/Operations Supervisor

RP:dlg
Enclosure

Mary
Kip
Bob
Rob
Binkley (3)
File

BULK SAMPLE REQUEST FORM

CLIENT NAME & ADDRESS: 2921 Chico Unified School District 2455 Carmichael Drive Chico, CA 95928		PHONE: (916) 891- FAX: (916) 891-3190	DATE:
		Circle the Method and Turn Around Time 24 hr/12hr/24hr/48hr/Ext	Results Needed:
		PLM: Standard / Point Count	Gravimetry Prep
CONTACT: ROB-PETERS		TEM: QUAL. / QUANT. / WATER	
P.O.#	JOB #	AA/Flame AA/Furnace ICP	
SITE: CJH Gym		METALS:	

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
1	7/5/02	DRYWALL WEST HALLWAY AS GYM
2	7/5/02	" " " "
3	7/5/02	" " " "

Sampled by: ROB PETERS	Date: 7/5/02 Time: 10:45
Relinquished by: ROB PETERS	Received By:
Date/Time: 7/5/02 10:45	Date/Time:
	Sealed Condition (circle one) YES / NO
Relinquished by:	Received By:
Date/Time:	Date/Time:
	Sealed Condition (circle one) YES / NO

**Forensic Analytical**
Analytical Report**Preliminary FAX****Bulk Asbestos Analysis**

(EPA Method 600/R-93-116)

COPYChico Unified School Dist
Ron Peters2455 Carmichael Drive
Chico, CA 95928Client ID: 2921
Report Number: B041332
Date Received: 07/09/02
Date Analyzed: 07/09/02
Date Printed: 07/10/02**Job ID / Site:** JOB: CJH Gym, Chico Junior High School**FASI Job ID:** 2921-46

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
1	10170748						
	Layer: Paint		ND				
	Layer: Off-White Skimcoat/Joint Compound		ND				
	Layer: Off-White Fibrous Material		ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (30%)

2	10170749						
	Layer: Paint		ND				
	Layer: Off-White Skimcoat/Joint Compound		ND				
	Layer: Off-White Fibrous Material		ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (30%)

3	10170750						
	Layer: Paint		ND				
	Layer: Off-White Skimcoat/Joint Compound		ND				
	Layer: Off-White Fibrous Material		ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)
Cellulose (30%)*many
Kip
But
Rat
Bordas (3)
Gill*



Forensic Analytical
Analytical Report

Preliminary FAX

Bulk Asbestos Analysis

(EPA Method 600/R-93-116)

Chico Unified School Dist
Ron Peters

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B041332
Date Received: 07/09/02
Date Analyzed: 07/09/02
Date Printed: 07/10/02

Job ID / Site: JOB: CJH Gym, Chico Junior High School

FASI Job ID: 2921-46

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
---------------	------------	------------------	---------------------	------------------	---------------------	------------------	---------------------

James Flores, Laboratory Supervisor, Hayward Laboratory

Note: Limit of Quantification ('LOQ') = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

all results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full, unless approved by Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Forensic Analytical reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

2001-
Maintenance and Operations
2455 Carmichael Drive
Chico, CA 95928
Phone: (530) 891-3095
Fax: (530) 891-3190

Chico Unified School District

July 8, 2002

Forensic Analytical Specialties, Inc.
3777 Depot Road, Suite 409
Hayward, CA 94545

Re: Chico Junior High School – Hallway at Gym

To Whom It May Concern:

Please test the enclosed samples from the Chico Junior High School Gym Hallway for asbestos. We would like a 24-hour turn around on the samples. Please fax the results to us as soon as they are available. Our fax number is (530) 891-3190.

Site Sampled: Chico Junior High School
Location: Hallway at Gym
Date Sampled: July 5, 2002
Number of Samples: Three (3)
Sample Taken by: Robert Peters

Thank you for your prompt response to this request.

Sincerely,



Rob Peters
Maintenance/Operations Supervisor

RP:dlg
Enclosure



Bulk Asbestos Analysis

(EPA Method 600/R-93-116, Visual Area Estimation)

Chico Unified School Dist
Ron Peters

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B041332
Date Received: 07/09/02
Date Analyzed: 07/09/02
Date Printed: 07/10/02
First Reported: 07/10/02

Job ID / Site: JOB: CJH Gym, Chico Junior High School

FAJI Job ID: 2921-46

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
---------------	------------	---------------	------------------	---------------	------------------	---------------	------------------

1	10170748						
		Layer: Paint	ND				
		Layer: Off-White Skimcoat/Joint Compound	ND				
		Layer: Off-White Fibrous Material	ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (30%)

Comment: Collected on 07/05/2002

2	10170749						
		Layer: Paint	ND				
		Layer: Off-White Skimcoat/Joint Compound	ND				
		Layer: Off-White Fibrous Material	ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (30%)


Comment: Collected on 07/05/2002

3	10170750						
		Layer: Paint	ND				
		Layer: Off-White Skimcoat/Joint Compound	ND				
		Layer: Off-White Fibrous Material	ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (30%)

Comment: Collected on 07/05/2002

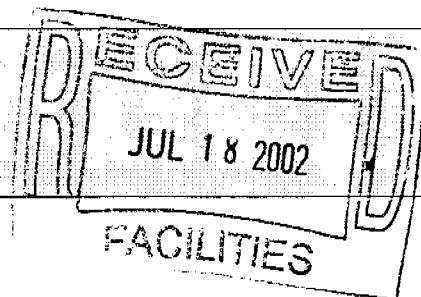

cc: Mary
Kip
Bob m.
Bob B.
Rob
Binders (3)
File

Jim Flores

James Flores, Laboratory Supervisor, Hayward Laboratory

Note: Limit of Quantification ('LOQ') = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

All results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full, unless approved by Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Forensic Analytical reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.



BULK SAMPLE REQUEST FORM

NAME & ADDRESS: 2921 ⁴⁶ Chico Unified School District 2455 Carmichael Drive Chico, CA 95928		PHONE: (916) 891- FAX: (916) 891-3190	DATE:
		Circle the Method and Turn Around Time 24 hr/12hr/24hr/48hr/Ext	Results Needed:
		PLM: Standard / Point Count	Gravimetry Prep
CONTACT: ROB-PETERS		TEM: QUAL. / QUANT. / WATER	
P.O.#	JOB #	AA/Flame AA/Furnace ICP	
SITE: CJH Gym		METALS:	

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
1	7/5/02	DRYWALL WEST HALLWAY AS GYM
2	7/5/02	" " " "
3	7/5/02	" " " "

Sampled by: ROB PETERS	Date: 7/5/02 Time: 10:45
Relinquished by: ROB PETERS	Received By: <i>Melissa Chen</i>
Date/Time: 7/5/02 10:45	Date/Time: 7/9/02 11:51
	Sealed Condition (circle one) YES / NO
	Received By:
	Date/Time:
	Sealed Condition (circle one) YES / NO

2001-

Maintenance and Operations
2455 Carmichael Drive
Chico, CA 95928
Phone: (530) 891-3095
Fax: (530) 891-3190

Chico Unified School District

July 8, 2002

Forensic Analytical Specialties, Inc.
3777 Depot Road, Suite 409
Hayward, CA 94545

Re: Chico Junior High School – Hallway at Gym

To Whom It May Concern:

Please test the enclosed samples from the Chico Junior High School Gym Hallway for asbestos. We would like a 24-hour turn around on the samples. Please fax the results to us as soon as they are available. Our fax number is (530) 891-3190.

Site Sampled: Chico Junior High School

Location: Hallway at Gym

Date Sampled: July 5, 2002

Number of Samples: Three (3)

Sample Taken by: Robert Peters

Thank you for your prompt response to this request.

Sincerely,



Rob Peters
Maintenance/Operations Supervisor

RP:dlg
Enclosure

**Forensic Analytical
Analytical Report****Final FAX**

Bulk Asbestos Analysis

(EPA Method 600/R-93-116)

Chico Unified School Dist
Rob Peters2455 Carmichael Drive
Chico, CA 95928Client ID: 2921
Report Number: B045699
Date Received: 12/09/02
Date Analyzed: 12/10/02
Date Printed: 12/10/02

Job ID / Site: Chico Jr. High

FAS1 Job ID: 2921-58

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
200E-1	10200155						
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				

Composite Values of Fibrous Components:

Asbestos:(ND)

Cellulose (45%) Fibrous Glass (Trace%)

Comment: Bulk complex sample.

200E-2 10200156

Layer: Black Tar	ND
Layer: Black Felt	ND
Layer: Black Tar	ND
Layer: Black Felt	ND
Layer: Black Tar	ND
Layer: Black Felt	ND

Total Composite Values of Fibrous Components:

Asbestos:(ND)

Cellulose (45%) Fibrous Glass (Trace%)

Comment: Bulk complex sample.

200E-3 10200157

Layer: Black Tar	ND
Layer: Black Felt	ND
Layer: Black Tar	ND
Layer: Black Felt	ND
Layer: Black Tar	ND
Layer: Black Felt	ND

Composite Values of Fibrous Components:

Asbestos:(ND)

Cellulose (7%) Fibrous Glass (35%)

Comment: Bulk complex sample.

*c: Mary
Kip m.
Rob
Bunker (3)
Gier*



Forensic Analytical

BULK SAMPLE REQUEST FORM

IT NAME & ADDRESS: 2921 ⁵⁸ Chico Unified School District 2455 Carmichael Drive Chico, CA 95928		PHONE: (916) 891- FAX: (916) 891-3190	DATE: 12/6/02
		Circle the Method and Turn Around Time	Results Needed:
		24 hr/12hr/24hr/48hr/Ext	Gravimetry Prep
		PLM: Standard / Point Count	
CONTACT: ROB PETERS		TEM: QUAL / QUANT. / WATER	
P.O.#	JOB #	AA/Flame AA/Furnace ICP	
SITE: CHICO SR		METALS:	

SAMPLE NUMBER	DATE COLLECTED	SAMPLE LOCATION/DESCRIPTION
200E-1	12/6	UNIT 200 EAST
200E-2		UNIT 200 EAST
200E-3		UNIT 200 EAST
200E-4		UNIT 200 EAST
200E-5	12/6	UNIT 200 EAST

Sampled by: ROB PETERS	Date: 12/6/02 Time: 11:15
Relinquished by:	Received By: MELISSA CARR
Date/Time:	Date/Time: 12/10/02 10:34
	Sealed Condition (circle one) YES / NO
Inquired by:	Received By:
Date/Time:	Date/Time:
	Sealed Condition (circle one) YES / NO

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters
1:15 p.m.

School: Chico Junior High School

Building: MPR (AKA Building A)

Material Class	Material	Homo. Mat. #	% Asb.	Fr ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT	1	1-5%	UNDETERMINED	KITCHEN OFFICE, MAIN HALLWAY, MPR, TEACHER'S LOUNGE, & FAN ROOMS	(7) RENOVATION TOOK PLACE IN THE SUMMER OF 2000.	N/A
T	MUDDIED JOINTS	6	1-5%	UNDETERMINED	WATER TANK ROOMS	(7) RENOVATION TOOK PLACE IN THE SUMMER OF 2000.	N/A
S	CEILING PLASTER	8	1-5%	UNDETERMINED	TEACHER'S LOUNGE, MPR, REST OF THE WING, & REFRIGERATOR ROOM	(1) (4) (7) THE PLASTER WAS REMOVED FROM THE CEILING IN THE REFRIGERATOR ROOM. PART OF THE RENOVATION IN THE SUMMER OF 2000.	N N/A
T	TANK WRAP	16	40-45%	UNDETERMINED	HOT WATER CLOSET	(7)	N/A
M	DRYWALL	104	ASSUMED	UNDETERMINED	THROUGH UNIT	(1) (7) Abated	N

School: Chico Junior High School

Building: B (AKA Hallways)

Material Class	Material	Homo. Mat. #	% Asb.	Fr ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	HALLWAY & UPPER WALLS	(7) From fire doors south (1) (4)	N/A

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: Rooms 200, 202, 204, 206, & 208 (AKA Wing C)

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	ROOM 11 (TITLE ONE OFFICE) & BOY S RESTROOM	(1) (4) MINOR CRACKS IN THE MIDDLE AREA. SAME	N
M	9" VFT BROWN	20	5-10%	UNDETERMINED	ROOMS 200, 202, 206, & 208	(7) REPLACED WITH 12" CREAM VFT.	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) SAME	N
M	12" VFT CREAM	97	ASSUMED	UNDETERMINED	ROOMS 200, 202, 206, & 208	(1) THE DISTRICT MUST CERTIFY. SAME	N
M	2 X 4 FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOM WING	(1) NEW MATERIAL. THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON-ASBESTOS. CONTAINING. (Need Letter)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

Check for Letter

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: Rooms 300, 302, 304, & 306 (AKA Wing D)

Material Class	Material	Homo. Mat. #	% Asb.	Fr/L.F.	Location	Condition: Code & Comments	Frable Yes / No
M	9" VFT RED	2	1-5%	UNDETERMINED	JANITOR S CLOSET (ROOM 310)	(1) (4) Letter	N
S	CEILING PLASTER	8	1-5%	UNDETERMINED	ROOM 311 (ROOM 11)	Same	N
M	9" VFT GREY	24	1-5%	UNDETERMINED	ROOMS 300, 302, 304, 306, & 308	(7) REPLACED WITH 12" CREAM VFT DURING THE SUMMER OF 2000.	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	Same	N
M	12" VFT CREAM	97	ASSUMED	UNDETERMINED	ROOMS 300, 302, 304, 306, & 308	(1) THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON-ASBESTOS CONTAINING.	N
M	2 X 4 FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) NEW MATERIAL. THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON-ASBESTOS CONTAINING.	N

CONDITION CODE

Letter

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: Rooms 500, 502, 504, & 506 (AKA Wing F)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frangible Yes / No
M	9" VFT RED	2	1-5%	UNDETERMINED	MIGRANT EDUCATION OFFICE	(1) (4) Letter	N
S	CEILING PLASTER	8	1-5%	UNDETERMINED	MIGRANT EDUCATION OFFICE S & GIRLS RESTROOM	(1) (4) Same	N
M	9" VFT LIGHT BROWN	20	5-10 %	UNDETERMINED	ROOMS 500, 502, 504, & 506	(7) 12" VFT WAS PUT IN PLACE AFTER THE REMOVAL OF THE 9" VFT DURING THE SUMMER OF 2000.	N/A
T	PIPE WRAP STRAIGHT	26	40-45%	UNDETERMINED	ROOM 502	(11)	N
T	PIPER WRAP STRAIGHT	95	ASSUMED	UNDETERMINED	ROOM 506	(11)	N
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) Same	N
M	12" VFT	98	ASSUMED	UNDETERMINED	ROOMS 500, 502, 504, & 506	(1) THE DISTRICT MUST CERTIFY THIS IS A NON-ASBESTOS CONTAINING MATERIAL.	N

School: Chico Junior High School

Building: Maintenance (AKA Wing G)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frangible Yes / No
T	BOILER REFRACTORY	100	ASSUMED	UNDETERMINED	TWO BOILER UNITS	(1) (4) Same	N
						(1) (4) Same	

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: 501 (AKA Unit H-Industrial Arts/Wood Shop),
503 & 505(AKA Unit N-Durst Theatre & Music Room)

Material Class	Material	Homo. Mat. #	% Asb.	Fr ² /L.F.	Location	Condition: Code & Comments	Frangible Yes / No
M	9" VFT BEIGE	14	1-5%	UNDETERMINED	COMPUTER ROOM, MATERIAL STORAGE, & STAFF OFFICE, DURST THEATRE, OFFICES, MUSIC ROOM, & PRACTICE ROOMS 1-5	(7) REMOVED AND REPLACED WITH 12" VFT DURING SUMMER OF 2000.	N/A
M	12" ACT	17	NONE DETECTED	UNDETERMINED	WOOD SHOP, DURST THEATRE, MUSIC ROOM, & PRACTICE ROOMS 1-5	(13) SAMPLE HMS-CJH-17 COLLECTED IN 1988.	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) →	N
M	12" VFT CREAM	97	ASSUMED	UNDETERMINED	COMPUTER ROOM, MATERIAL STORAGE, & STAFF OFFICE, DURST THEATRE, OFFICES, MUSIC ROOM, & PRACTICE ROOMS 1-5	(1) THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL. ↗	N
						LETTER	

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: J (AKA Main Office Building)

Material Class	Material	Homo. Mat. #	% Asb.	FI ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT RED	2	1-5%	UNDETERMINED	ADMINISTRATION OFFICES, HALLWAY, & LIBRARY	(7) REMOVED AND REPLACED WITH 12" CREAM VFT DURING SUMMER OF 2000. THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING	N/A
S	CEILING PLASTER	8	1-5%	UNDETERMINED	LIBRARY	(1) (7) THE PLASTER FROM ALL ROOMS EXCEPT THE LIBRARY HAS BEEN REMOVED.	N N/A
T	PIPE WRAP	10	25-50%	UNDETERMINED	WORK ROOM CLOSET	(7)	N/A
T	PIPE WRAP	11	50-55%	UNDETERMINED	WORK ROOM CLOSET	(7)	N/A
M	12" VFT CREAM	97	ASSUMED	UNDETERMINED	ADMINISTRATION OFFICES, HALLWAY, & LIBRARY	(1) THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL.	N
M	DRYWALL	101	ASSUMED	UNDETERMINED	THROUGHOUT UNIT	(1) NEW DRYWALL WAS PUT INTO THIS UNIT DURING THE RENOVATION IN THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

Letters

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: K (AKA Rooms 201, 203, 205, 207, 209, & 211)

Material Class	Material	Homo. Mat. #	% Asb.	FI ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT	18	1-5%	UNDETERMINED	ROOMS 201, 203, 205, 207, & 209	(7)	N/A
T	PIPE WRAP STRAIGHTS	75	ASSUMED	UNDETERMINED	ENCLOSED UNDER CABINETS	(7)	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) Same	N
M	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N
M	12" VFT GREY	102	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School Building: L (AKA Rooms 301, 303, 305, 307, 309, & 311)

Material Class	Material	Homo. Mat. #	% Asb.	FF/L.F.	Location	Condition: Code & Comments	Friable Yes / No
T	PIPE WRAP STRAIGHTS	75	ASSUMED	UNDETERMINED	ENCLOSED UNDER CABINETS	(7)	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1)	N
M	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N
M	12" VFT GREY	103	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N
Same							

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

Building: M (AKA Rooms 401, 403, 405, 407, & 409)

Material Class	Material	Homo. Mat. #	% Asb.	Fr ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT TAN	23	5-10%	UNDETERMINED	ROOMS 401, 403, 405, 407, & 409	(7)	N/A
T	PIPE WRAP STRAIGHTS	75	ASSUMED	UNDETERMINED	ENCLOSED UNDER CABINETS	(7)	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1) Same	N
M	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N
M	12" VFT GREY	103	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N

School: Chico Junior High School

Building: O (AKA Gymnasium)

Material Class	Material	Homo. Mat. #	% Asb.	Fr ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT GREEN	5	1-5%	UNDETERMINED	RESTROOMS	(1) (4) Same	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 11/05/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School Building: P (AKA PE Locker Rooms)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT GREEN	5	1-5%	UNDETERMINED	ROOM 18 STORAGE	(12) COULD NOT FIND DURING TIME OF INSPECTION.	N
T	PIPE WRAP	105	ASSUMED	UNDETERMINED	IN CEILING PIPE CHASE	(10)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

Same

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHS VEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: MPR (AKA Building A)

Material Class	Material	Homo. Mat. #	% Asb.	FI ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT	1	1-5%	UNDETERMINED	KITCHEN OFFICE, MAIN HALLWAY, MPR, TEACHER'S LOUNGE, & FAN ROOMS	(7) RENOVATION TOOK PLACE IN THE SUMMER OF 2000.	N/A
T	MUDDIED JOINTS	6	1-5%	UNDETERMINED	WATER TANK ROOMS	(7) RENOVATION TOOK PLACE IN THE SUMMER OF 2000.	N/A
S	CEILING PLASTER	8	1-5%	UNDETERMINED	TEACHER'S LOUNGE, MPR, REST OF THE WING, & REFRIGERATOR ROOM	(1) (4) (7) THE PLASTER WAS REMOVED FROM THE CEILING IN THE REFRIGERATOR ROOM, PART OF THE RENOVATION IN THE SUMMER OF 2000.	N N/A
T	TANK WRAP	16	40-45%	UNDETERMINED	HOT WATER CLOSET	(7)	N/A
M	DRYWALL	104	ASSUMED	UNDETERMINED	THROUGH UNIT	(1) (7) Abated	N

School: Chico Junior High School

Building: B (AKA Hallways)

Material Class	Material	Homo. Mat. #	% Asb.	FI ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	HALLWAY & UPPER WALLS	(7) From fire doors south (1) (4)	N/A

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHS VEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: Rooms 200, 202, 204, 206, & 208 (AKA Wing C)

Material Class	Material	Homo. Mat. #	% Asb.	FI ² /L.F.	Location	Condition: Code & Comments	Frable Yes / No
S	CEILING PLASTER	8	1-5%	UNDETERMINED	ROOM 11 (TITLE ONE OFFICE) & BOY S RESTROOM	(1) (4) MINOR CRACKS IN THE MIDDLE AREA.	N
M	9" VFT BROWN	20	5-10%	UNDETERMINED	ROOMS 200, 202, 206, & 208	(7) REPLACED WITH 12" CREAM VFT.	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1)	N
M	12" VFT CREAM	97	ASSUMED	UNDETERMINED	ROOMS 200, 202, 206, & 208	(1) THE DISTRICT MUST CERTIFY.	N
M	2 X 4 FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOM WING	(1) NEW MATERIAL. THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON-ASBESTOS. CONTAINING. (Need Letter)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTH SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: Rooms 300, 302, 304, & 306 (AKA Wing D)

Material Class	Material	Homo. Mat. #	% Asb.	Fr ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT RED	2	1-5%	UNDETERMINED	JANITOR S CLOSET (ROOM 310)	(1) (4) Letter	N
S	CEILING PLASTER	8	1-5%	UNDETERMINED	ROOM 311 (ROOM 11)	(1) (4)	N
M	9" VFT GREY	24	1-5%	UNDETERMINED	ROOMS 300, 302, 304, 306, & 308	(7) REPLACED WITH 12" CREAM VFT DURING THE SUMMER OF 2000.	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1)	N
M	12" VFT CREAM	97	ASSUMED	UNDETERMINED	ROOMS 300, 302, 304, 306, & 308	(1) THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON-ASBESTOS CONTAINING.	N
M	2 X 4 FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) NEW MATERIAL. THE DISTRICT MUST CERTIFY THIS MATERIAL IS NON-ASBESTOS CONTAINING.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHS VEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: Rooms 500, 502, 504, & 506 (AKA Wing F)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT RED	2	1-5%	UNDETERMINED	MIGRANT EDUCATION OFFICE	(1) (4) Letter	N
S	CEILING PLASTER	8	1-5%	UNDETERMINED	MIGRANT EDUCATION OFFICE S & GIRLS RESTROOM	(1) (4)	N
M	9" VFT LIGHT BROWN	20	5-10 %	UNDETERMINED	ROOMS 500, 502, 504, & 506	(7) 12" VFT WAS PUT IN PLACE AFTER THE REMOVAL OF THE 9" VFT DURING THE SUMMER OF 2000.	N/A
T	PIPE WRAP STRAIGHT	26	40-45%	UNDETERMINED	ROOM 502	(11)	N
T	PIPER WRAP STRAIGHT	95	ASSUMED	UNDETERMINED	ROOM 506	(11)	N
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1)	N
M	12" VFT	98	ASSUMED	UNDETERMINED	ROOMS 500, 502, 504, & 506	(1) THE DISTRICT MUST CERTIFY THIS IS A NON-ASBESTOS CONTAINING MATERIAL.	N

School: Chico Junior High School

Building: Maintenance (AKA Wing G)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
T	BOILER REFRACTORY	100	ASSUMED	UNDETERMINED	TWO BOILER UNITS	(1) (4) Same	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (if Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHLY VEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: 501 (AKA Unit H-Industrial Arts/Wood Shop),
503 & 505(AKA Unit N-Durst Theatre & Music Room)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frable Yes / No
M	9" VFT BEIGE	14	1-5%	UNDETERMINED	COMPUTER ROOM, MATERIAL STORAGE, STORAGE, & STAFF OFFICE, DURST THEATRE, OFFICES, MUSIC ROOM, & PRACTICE ROOMS 1-5	(7) REMOVED AND REPLACED WITH 12" VFT DURING SUMMER OF 2000.	N/A
M	12" ACT	17	NONE DETECTED	UNDETERMINED	WOOD SHOP, DURST THEATRE, MUSIC ROOM, & PRACTICE ROOMS 1-5	(13) SAMPLE HMS-CJH-17 COLLECTED IN 1988.	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1)	N
M	12" VFT CREAM	97	ASSUMED	UNDETERMINED	COMPUTER ROOM, MATERIAL STORAGE, STORAGE, & STAFF OFFICE, DURST THEATRE, OFFICES, MUSIC ROOM, & PRACTICE ROOMS 1-5	(1) THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL.	N
						LETTER	

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHS SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: J (AKA Main Office Building)

Material Class	Material	Homo. Mat. #	% Asb.	Fr ¹ /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT RED	2	1-5%	UNDETERMINED	ADMINISTRATION OFFICES, HALLWAY, & LIBRARY	(7) REMOVED AND REPLACED WITH 12" CREAM VFT DURING SUMMER OF 2000. THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING	N/A
S	CEILING PLASTER	8	1-5%	UNDETERMINED	LIBRARY	(1) (7) THE PLASTER FROM ALL ROOMS EXCEPT THE LIBRARY HAS BEEN REMOVED.	N N/A
T	PIPE WRAP	10	25-50%	UNDETERMINED	WORK ROOM CLOSET	(7)	N/A
T	PIPE WRAP	11	50-55%	UNDETERMINED	WORK ROOM CLOSET	(7)	N/A
M	12" VFT CREAM	97	ASSUMED	UNDETERMINED	ADMINISTRATION OFFICES, HALLWAY, & LIBRARY	(1) THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL.	N
M	DRYWALL	101	ASSUMED	UNDETERMINED	THROUGHOUT UNIT	(1) NEW DRYWALL WAS PUT INTO THIS UNIT DURING THE RENOVATION IN THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY THIS MATERIAL AS NON-ASBESTOS CONTAINING MATERIAL.	N

CONDITION CODE

Letters

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHS VEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: K (AKA Rooms 201, 203, 205, 207, 209, & 211)

Material Class	Material	Homo. Mat. #	% Asb.	Fr/L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT	18	1-5%	UNDETERMINED	ROOMS 201, 203, 205, 207, & 209	(7)	N/A
T	PIPE WRAP STRAIGHTS	75	ASSUMED	UNDETERMINED	ENCLOSED UNDER CABINETS	(7)	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1)	N
M	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N
M	12" VFT GREY	102	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHS VEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: L (AKA Rooms 301, 303, 305, 307, 309, & 311)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
T	PIPE WRAP STRAIGHTS	75	ASSUMED	UNDETERMINED	ENCLOSED UNDER CABINETS	(7)	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1)	N
M	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N
M	12" VFT GREY	103	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHS VEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: M (AKA Rooms 401, 403, 405, 407, & 409)

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT TAN	23	5-10%	UNDETERMINED	ROOMS 401, 403, 405, 407, & 409	(7)	N/A
T	PIPE WRAP STRAIGHTS	75	ASSUMED	UNDETERMINED	ENCLOSED UNDER CABINETS	(7)	N/A
M	TRANSITE PANELS	96	ASSUMED	UNDETERMINED	EXTERIOR OF UNIT	(1)	N
M	2' X 4' FCP	99	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N
M	12" VFT GREY	103	ASSUMED	UNDETERMINED	THROUGHOUT CLASSROOMS	(1) RENOVATED DURING THE SUMMER OF 2000. THE DISTRICT MUST CERTIFY.	N

School: Chico Junior High School

Building: O (AKA Gymnasium)

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes / No
M	9" VFT GREEN	5	1-5%	UNDETERMINED	RESTROOMS	(1) (4) Same	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

SIX MONTHS SURVEILLANCE HOMOGENEOUS ACBM MATERIAL RECORDS

Date of Inspection: 05/09/2002

District: Chico Unified School District

Inspector: Robert Peters

School: Chico Junior High School

Building: P (AKA PE Locker Rooms)

Material Class	Material	Homo. Mat. #	% Asb.	Fr ² /L.F.	Location	Condition: Code & Comments	Frivable Yes / No
M	9" VFT GREEN	5	1-5%	UNDETERMINED	ROOM 18 STORAGE	(12) COULD NOT FIND DURING TIME OF INSPECTION.	N
T	PIPE WRAP	105	ASSUMED	UNDETERMINED	IN CEILING PIPE CHASE	(10)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments) (13) Non-Asbestos/Not Inspected
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS



Forensic Analytical

San Francisco • Los Angeles • Paris

Bulk Asbestos Analysis

(EPA Method 600/R-93-116, Visual Area Estimation)

Chico Unified School Dist
Rob Peters

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045699
Date Received: 12/09/02
Date Analyzed: 12/10/02
Date Printed: 12/10/02
First Reported: 12/10/02

Job ID / Site: Chico Jr. High

FASI Job ID: 2921-58

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
200E-1	10200155						
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (45%) Fibrous Glass (Trace%)

Comment: Bulk complex sample. Collected on 12/06/2002

200E-2	10200156						
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (45%) Fibrous Glass (Trace%)


Comment: Bulk complex sample. Collected on 12/06/2002

200E-3	10200157						
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (7%) Fibrous Glass (35%)

Comment: Bulk complex sample. Collected on 12/06/2002

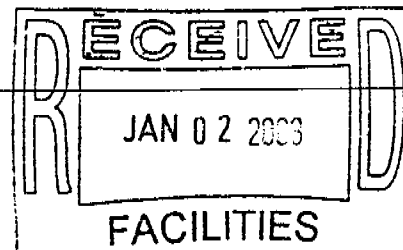

C: Mary
Kip
Bob M.
Rob
Peters (3)



Bulk Asbestos Analysis

(EPA Method 600/R-93-116, Visual Area Estimation)

Chico Unified School Dist
Rob Peters

2455 Carmichael Drive
Chico, CA 95928

Client ID: 2921
Report Number: B045699
Date Received: 12/09/02
Date Analyzed: 12/10/02
Date Printed: 12/10/02
First Reported: 12/10/02

Job ID / Site: Chico Jr. High

FASI Job ID: 2921-58

Sample Number	Lab Number	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer	Asbestos Type	Percent in Layer
200E-4	10200158						
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (7%) Fibrous Glass (35%)

Comment: Bulk complex sample. Collected on 12/06/2002

200E-5	10200159						
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				
Layer: Black Tar			ND				
Layer: Black Felt			ND				

Total Composite Values of Fibrous Components: Asbestos:(ND)

Cellulose (7%) Fibrous Glass (35%)

Comment: Bulk complex sample. Collected on 12/06/2002

James Flores, Laboratory Supervisor, Hayward Laboratory

Note: Limit of Quantification ('LOQ') = 1%. 'Trace' denotes the presence of asbestos below the LOQ. 'ND' = 'None Detected'.

Analytical results and reports are generated by Forensic Analytical at the request of and for the exclusive use of the person or entity (client) named on such report. Results, reports or copies of same will not be released by Forensic Analytical to any third party without prior written request from client. This report applies only to the sample(s) tested. Supporting laboratory documentation is available upon request. This report must not be reproduced except in full, unless approved by Forensic Analytical. The client is solely responsible for the use and interpretation of test results and reports requested from Forensic Analytical. This report must not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government. Forensic Analytical is not able to assess the degree of hazard resulting from materials analyzed. Forensic Analytical reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. All samples were received in acceptable condition unless otherwise noted.



BULK SAMPLE REQUEST FORM

NAME & ADDRESS:

2921 ⁵⁸ Chico Unified School District
2455 Carmichael Drive
Chico, CA 95928

PHONE: (916) 891-
FAX: (916) 891-3190

DATE: 12/6/02

Circle the Method and
Turn Around Time

Results Needed:

24 hr/12hr/24hr/48hr/Ext

PLM: Standard / Point Count

Gravimetry Prep

CONTACT: ROB PETERS

TEM: QUAL. / QUANT. / WATER

P.O.#

JOB #

AA/Flame AA/Furnace ICP

SITE: CHICO 512

METALS:

SAMPLE NUMBER

DATE
COLLECTED

SAMPLE LOCATION/DESCRIPTION

200E-1

12/6

UNIT 200 EAST

200E-2

200E-3

200E-4

200E-5

12/6

UNIT 200 EAST

Sampled by: ROB PETERS

Date: 12/6/02 Time: 11:15

Reinquished by:

Received By: Melvin Cerna

Date/Time:

Date/Time: 12/6/02 10:15
Sealed Condition (circle one) YES / NO

Reinquished by:

Received By:

Date/Time:

Date/Time:
Sealed Condition (circle one) YES / NO

Maintenance and Operations
2455 Carmichael Drive
Chico, CA 95928
Phone: (530) 891-3195
Fax: (530) 891-3190

Chico Unified School District

December 6, 2002

Forensic Analytical Specialties, Inc.
3777 Depot Road, Suite 409
Hayward, CA 94545

Re: Chico Junior High School


To Whom It May Concern:

Please test the enclosed samples from the Chico Junior High School Unit 200 Roof East for asbestos. We would like a 24-hour turnaround on the samples. Please fax the results to us as soon as they are available. Our fax number is (530) 891-3190.

Site Sampled:	Chico Junior High School
Location:	Unit 200 Roof, East
Date Sampled:	December 6, 2002
Number of Samples:	Five (5)

Thank you for your prompt response to this request.

Sincerely,



Rob Peters
Maintenance/Operations Supervisor

RP:dlg
Enclosures