

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: A

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' FCP	1	NONE DETECTED	5,735 S	ADMINISTRATION AREA	(13) SAMPLE HMS-CHS-01 COLLECTED ON 3-28-88.	N/A
M	12" VFT BEIGE	2	TRACE	5,700 S	RECEPTION AREA	(1) (4)	N
M	12" ACT	3	NONE DETECTED	3,550 S	PRINCIPLES OFFICE, COMPTROLLER, DW, & ROOMS 102-107	(13) SAMPLE HMS-CHS-03 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	7	5-10%	20 JOINTS	DARK ROOM ATTIC (ROOM 111)	(1) (4)	N
T	MESH WRAP	8	12-20%	½ L	DARK ROOM ATTIC (ROOM 111)	(11) INACCESSIBLE.	N
M	TRANSITE PANELS	95	ASSUMED	1,300 S	ALONG WALKWAYS, JANITORS CLOSETS, RESTROOMS, & STAIRWELLS	(1) (5) PANELS PAINTED WHITE.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: A (Unit 200) Upstairs

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VFT BEIGE	2	TRACE	5,800 S	UPSTAIRS CLASSROOMS	(1) (4)	N
M	2' X 4' FCP	6	NONE DETECTED	10,000 S	UPSTAIRS CLASSROOMS	(13) SAMPLE HMS-CHS-06 COLLECTED ON 3-28-88.	N/A

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

Inspector: Douglas R. Colley/Cory Sanders

District: Chico Unified School District

Building: B (Unit 100)

School: Chico Senior High School

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	2' X 4' FCP	13	NONE DETECTED	10, 000 S	ALL CLASSROOMS	(13) SAMPLE HMS-CHS-13 COLLECTED ON 3-28-88.	N/A
M	12" VFT	14	1-5%	9,430 S	ALL CLASSROOMS	(1) (4)	N
M	TRANSITE PANELS	95	ASSUMED	1,300 S	ALONG WALKWAYS, JANITORS CLOSETS, RESTROOMS, & STAIRWAYS	(1) (5) PANELS PAINTED WHITE.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: C (Unit 300)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VFT	14	1-5%	9,513 S	ALL CLASSROOMS	(1) (4)	N
M	TRANSITE PANELS	95	ASSUMED	1,300 S	EXTERIOR OF BUILDING	(1) (5) PANELS PAINTED WHITE.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: D & H (Unit 700 Music & Home EC)

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	BOILER INSULATION	37	25-35%	48 S	HOME EC & BOILER ROOM	(1) (6) REPAIRED.	N
S	TROWELED ON CEILING	38	1-5%	300 S	INSTRUMENT STORAGE ROOM & BAND ROOM OFFICE	(1) (4)	N
M	9" VFT YELLOW	39	5-10%	1,410 S	MUSIC WING HALL, CHORAL ROOM UNDER RISERS, BAND ROOM OFFICE, & CHORAL ROOM STORAGE	(7) (1) (4) REPLACED WITH 12" VFT GREY. 9" VFT UNDER CARPET IN BAND ROOM OFFICE.	N/A N
M	TRANSITE PEG BOARD	41	15-20%	1,000 S	BAND PRACTICE ROOM & CUSTODIAL ROOM	(2) PIECES BROKEN & MISSING.	N
T	PIPEWRAP STRAIGHT	80	75-80%	58 L	HOME EC STORAGE CLOSET	(1) (4)	N
T	PIPEWRAP STRAIGHT	81	75-80%	120 L	2 ND HOME EC STORAGE CLOSET	(1) (4)	N
T	PIPEWRAP CORNER	82	75-80%	>1 EACH	HOME EC STORAGE CLOSET	(1) (4)	N
M	FIRE DOOR	83	25-35%	1 EACH	HOME EC HEATER ROOM	(1) (4)	N
M	HOLDING TANK	94	ASSUMED	72 S	HOME EC HEATER ROOM	(1) (4)	N
M	12" VFT GREY	100	ASSUMED	810 S	MUSIC WING HALL	(1)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

Inspector: Douglas R. Colley/Cory Sanders

District: Chico Unified School District

Building: 700 (Music)

School: Chico Senior High School

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frangible Yes/No
T	PIPEWRAP STRAIGHT	84	5-10%	58 L	HOME EC HEATER ROOM	(1) (4)	N
T	PIPEWRAP AIRCELL	97	ASSUMED	70 L	UNDER CHORAL RISERS	(10)	N
M	TRANSITE PIPE	98	ASSUMED	8 L	HOME EC HEATER ROOM	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: L (Unit 400 Library)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" VFT	14	1-5%	1,000 S	LIBRARY ENTRY & OFFICE AREA	(1) (4)	N
M	2' X 4' FCP	17	NONE DETECTED	11,155 S	ALL ROOMS	(13) SAMPLE HMS-CHS-17 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	19	5-10%	20 JOINTS	LIBRARY ATTIC	(1) (6) REPAIRED.	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: F (Unit 500)

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
T	MUD JOINTS	52	5-10%	125 JOINTS	FINE ARTS	(1) (4)	N
M	2' X 4' FCP	59	NONE DETECTED	4,500 S	ALL CLASSROOMS	(13) SAMPLE HMS-CHS-59 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	60	5-10%	12 L	ROOM F-1	(1) (4)	N
M	9" VFT	61	TRACE	4,500 S	ALL CLASSROOMS	(1) (4)	N
M	TRANSITE PANELS	95	ASSUMED	150 S	2 KILNS	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

Inspector: Douglas R. Colley/Cory Sanders

Building: S (Unit 600 Science)

District: Chico Unified School District

School: Chico Senior High School

Material Class	Material	Homo. Mat. #	% Asb.	FT ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
M	2' X 4' FCP	22	NONE DETECTED	8,000 S	ALL ROOMS	(13) SAMPLE HMS-CHS-22 COLLECTED ON 3-28-88.	N/A
T	MUD JOINTS	23	5-10%	40 JOINTS	ALL ROOMS	(1) (4)	N
M	9" VFT	24	1-5%	8,100 S	ALL ROOMS	(1) (4)	N
T	PIPE WRAP STRAIGHT	26	65-70%	12 L	ROOM 5 (STORE ROOM)	(1) (6)	N
M	BLACK COUNTER TOPS	99	ASSUMED	UNDETERMINED	IN ALL SCIENCE ROOMS	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: LH-800

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
T	PIPEWRAP STRAIGHT	45	35-40%	3 L	CUSTODIAL ROOM	(1) (4)	N
T	MUD JOINTS	52	5-10%	10 EACH	UNDER STAGE	(1) (4)	N
M	9" VFT GREY	55	1-5%	6,800 S	KITCHEN & MPR	(1) (6) REPAIRED.	N
S	TROWELED ON CEILING	57	1-5%	900 S	ALL ROOMS	(1) (6) PAINTED.	N
M	TRANSITE PANELS	95	ASSUMED	364 S	SNACK BAR, STAGE, & CAFE	(1) (4)	N
M	9" VFT	101	ASSUMED	250 S	UNDER STAGE	(1) (4)	N
T	MUD JOINTS	102	5-10%	10 EACH	TEACHER'S LOUNGE RESTROOMS	(1) (4)	N
M	TRANSITE PIPE	103	ASSUMED	12 L	WATER HEATER ROOM (2 PIPES)	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)

Change in Condition: (4) No (5) Yes (If Yes, explain under comments)

Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted

Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: 900 GYM

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
S	WALLS & CEILING PLASTER	46	NONE DETECTED	2,000 S	ALL ROOMS EXCEPT BOILER	(13) SAMPLE HMS-CHS-46A-C COLLECTED ON 3-28-88. ADDITIONAL SAMPLES HMS-93103-03A-C COLLECTED ON 7-8-93.	N/A
T	PIPEWRAP STRAIGHT	50	50-55%	2,700 S	GIRL'S & BOY'S LOCKER ROOM & BOILER ROOM CRAWL SPACE	(10) ISOLATED & RESTRICTED	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: IT-1000

Material Class	Material	Homo. Mat. #	% Asb.	FT ² /L.F.	Location	Condition: Code & Comments	Frable Yes/No
T	PIPEWRAP STRAIGHT	45	35-40%	700 L	AUTO SHOP, LOFT, & WOOD SHOP	(1) (4)	N
T	BREECHING	90	ASSUMED	100 S	WOOD FINISHING ROOM	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: AG-1100

Material Class	Material	Homo. Mat. #	% Asb.	FF ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
S	WALL PLASTER	46	1-5%	950 S	AG CLASSROOM 2 (SPACE 3)	(1) (4)	N
M	TRANSITE PANELS	48	15-20%	200 S	AG SHOP WELD BOOTHS & TABLES	(1) (4)	N
M	12" VFT	89	ASSUMED	400 S	CLASSROOM	(1) (4)	N
M	TRANSITE PIPES	96	ASSUMED	12 L	AG SHOP (2 PIPES)	(1) (4)	N

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: May 2, 2001

District: Chico Unified School District

Inspector: Douglas R. Colley/Cory Sanders

School: Chico Senior High School

Building: 17 Portable Classrooms and 2 Portable Restrooms on West Campus

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
					17 PORTABLE CLASSROOM AND 2 PORTABLE RESTROOMS	DISTRICT CERTIFICATION REQUIRED.	

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

athletic fields

student parking area

tennis courts

PC14 PC13 PC12 PC11
PC10 PC9 PC8 PC7 RR
BC3 PC6 PC5 PC4 PC3
BC2 BC1 PC2 PC1 RR

shop yard

AG

3

1100

green house

2

1

staff parking

900

GYM

BOYS

GIRLS

bus loading zone

deliveries only

KITCHEN

snack bar

LINCOLN HALL

lunch area

LH

STAGE

LH-1

800

500

F

1

2

3

4

5

400

15

13

L

LIBRARY

A-V

CAREER CENTER

Music Wing

2

1

3

2

1

4

700

Home economics

WEST SACRAMENTO

N

S

600

2

1

3

4

5

6

7

WEST LINCOLN

100

B

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

128

127

126

125

124

123

122

121

120

119

118

117

116

115

114

113

112

111

110

109

108

107

106

105

104

103

102

101

100

99

98

97

96

ATTEND

1st FLOOR

MAIN BUILDING

THE ESPLANADE

200

300

200

203

202

201

200

199

198

197

196

195

194

193

192

191

190

189

188

187

186

185

184

183

182

181

180

179

178

177

176

175

174

173

172

171

170

169

168

167

166

165

164

163

162

161

160

159

158

157

156

155

154

153

152

151

150

149

148

147

146

145

144

143

142

141

140

139

138

137

136

135

134

133

132

131

130

129

128

127

126

125

124

123

122

121

120

119

118

117

116

115

114

113

112

111

110

109

108

107

106

105

104

103

102

101

100

99

98

97

96

95

94

93

92

91

90

89

88

87

86

85

84

83

82

81

80

79

78

77

76

75

74

73

72

71

70

69

68

67

66

65

64

63

62

61

60

59

58

57

56

55

54

53

52

51

50

49

48

47

46

45

44

43

42

41

40

39

38

37

36

35

34

33

32

31

30

29

28

27

26

25

24

23

22

21

20

19

18

17

16

15

14

13

12

11

10

9

8

7

6

5

4

3

2

1

0

-1

-2

-3

-4

-5

-6

-7

-8

-9

-10

-11

-12

-13


-14

-15

-16

DEPARTMENT OF INDUSTRIAL RELATIONS
DIVISION OF OCCUPATIONAL SAFETY AND HEALTH
BESTOS CONSULTANT CERTIFICATION UNIT

Park Towne Circle, Suite 1
Sacramento, CA 95825
(916) 574-2993 Fax (916) 483-0572

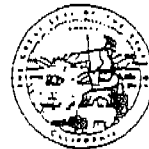

207010222C 11
Douglas R Colley
Hazard Management Services Inc.
4200 Rocklin Road, Suite 11A
Rocklin, CA 95767

8/14/2000

Dear Certified Asbestos Consultant or Technician:

Enclosed is your certification card. **To maintain your certification, please abide by the rules printed on the back of the certification card.**

Your certification is valid for a period of one year. If you wish to renew your certification, you must apply for renewal at least 60 days before the expiration date shown on your card.

Please hold and do not send copies of your required AHERA refresher renewal certificates to the Division until you apply for renewal of your certification.

Please inform the Division of any changes in your mailing address or work address within 15 days.

Sincerely,

Rick Axe, CIH
Senior Industrial Hygienist

RA/dor

Attachment

cc: File

State of California
Division of Occupational Safety and Health

Certified Asbestos Consultant

Douglas R Colley

Name

Certification No. **92-0222**

Expires on **9/17/2001**

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq. of the Business and Professions Code



CAL

ENVIRONMENTAL

SERVICES

INC

This is to certify that

Douglas R. Colley

has successfully completed the EPA approved A.H.E.R.A. course for
Asbestos Building Inspector/Management Planner Refresher
as required under TSCA Title II

8/1/2000 to 8/1/2000

Course Date(s)

David Esparza

David Esparza - President

8/1/2001

Expiration Date

CA - 001 - 06

AC-22870

CA - 001 - 08

Certificate Number

Cal/OSHA Course Approval #

CAL INC 2040 Peabody Rd Vacaville, CA 95696 707-446-7996

University of California, Berkeley

UNIVERSITY EXTENSION


This is to confirm that

Cory Sanders

has attended and satisfactorily passed the examination for the forty hour AHERA approved course
Building Inspection and Management Planning for Asbestos
and has completed the requisite training for asbestos accreditation under TSCA Title II

May 7-11, 2001

Date of Exam: May 11, 2001
Expiration Date: May 11, 2002
Certificate number: 3091
CAL/ OSHA approval number: CA-002-07

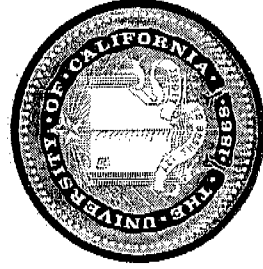

Richard V. Tsina

Richard V. Tsina
Chair, Environmental Management
UC Berkeley Extension
1995 University Avenue
Berkeley, CA 94720
(510) 643-7143