

PRECISION I
MICRO-ANALYSIS C

SPECIALISTS IN ASBESTOS-RELATED ANALYSIS

Bulk Sample Analysis (PLM) Report

Report # 94028009

Ron Jones
Chico Unified School District
2455 Carmichael Drive
Chico, CA 95969

Date Collected:01/27/94
Date Received:01/28/94
Date Analyzed:01/31/94

Phone:(916)891-3095

Job Information:
Chico High School
200 Wing


Sample Number	Sample Location	Sample Description	Analytical Results
01 Lab # 94-100854	North end of roof 8' in	Black roofing material and brown wood	No asbestos detected 45-50% Fibrous glass 1-5% Cellulose fibers
02 Lab # 94-100855	North end of roof 30' in	Black roofing material with brown wood	No asbestos detected 60-65% Cellulose fibers 20-25% Fibrous glass
03 Lab # 94-100856	Center of roof	Black roofing sample and brown wood	No asbestos detected 45-50% Fibrous glass 35-40% Cellulose fibers
04 Lab # 94-100857	Southeast of Sample 003 - 20'	Black roofing material	No asbestos detected 70-75% Cellulose fibers
05 Lab # 94-100858	Southwest roof in 10'	Black roofing material and brown wood	No asbestos detected 45-50% Fibrous glass 1-5% Cellulose fibers
06 Lab # 94-100859	Southeast roof in 10'	Black roofing material and brown wood	No asbestos detected 35-40% Cellulose fibers 20-25% Fibrous glass

OFFICIAL NOTICE: After 45 days, samples are disposed of at a licensed waste disposal site unless client requests their return, identifying samples by our laboratory identification #'s. Charges for sample returns are a \$5.00 retrieval fee plus \$2.00 per sample to cover costs of retrieval, handling, and shipping.

Total Number of Samples: 6
Supervisor: Ron Jones

Page 1 of 2
Analyst: Holly Bence

Note: The test result findings are made to the methodologies and parameters described on the reverse of this page.

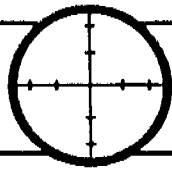

PRECISION I
MICRO-ANALYSIS N
C

SPECIALISTS IN ASBESTOS-RELATED ANALYSIS

Bulk Sample Analysis (PLM) Report

Report # 94028009

Ron Jones
Chico Unified School District
2455 Carmichael Drive
Chico, CA 95969

Date Collected:01/27/94
Date Received:01/28/94
Date Analyzed:01/31/94

Phone:(916)891-3095

Job Information:
Chico High School
200 Wing

Sample Number	Sample Location	Sample Description	Analytical Results
07	South end of roof in 10'	Black roofing sample and brown wood	No asbestos detected 55-60% Cellulose fibers 10-15% Fibrous glass
Lab # 94-100860			

OFFICIAL NOTICE: After 45 days, samples are disposed of at a licensed waste disposal site unless client requests their return, identifying samples by our laboratory identification #'s. Charges for sample returns are a \$5.00 retrieval fee plus \$2.00 per sample to cover costs of retrieval, handling, and shipping.

Total Number of Samples: 7
Supervisor *[Signature]*

Analyst *[Signature]* Page 2 of 2

Note: The test result findings are made to the methodologies and parameters described on the reverse of this page.

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE December 19, 1994

SCHOOL Chico Senior High INSPECTOR Ron Jones

HOMOG. ASBESTOS
 MAT.# MATERIAL

BLDG.	MAT.#	MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
A	Mud Jnt	5-10	Darkroom - Attic	1-4
A	Mesh wrap	15-20	Darkroom - Attic	1-4
A	Tran panl	Assumed	Red painted panels along walkways, janitor closets, rr, stairwells	1-4
B	12" VFT	1-5	All rooms	1-4
C	12" VFT	1-5	Room 10	2-4 (two broken tiles)
C	12" VFT	1-5	All rooms	1-4
400	Mud jnt	5-10	Library Attic	1-4
500	Tran panl	Assumed	2 - Kilns	1-4
500	Mud jnts	5-10	Fine Arts	1-4
500	Mud jnts	5-10	Room F-1	1-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE December 19, 1994

SCHOOL Chico Senior High INSPECTOR Ron Jones *RJ*

BLDG.	HOMOG. MAT.#	ASBESTOS MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
S	Heat Shld paper	75-80	Rm S-3	7
S	Bl countr	Assumed	Science Rooms	1-4
S	Mud jnts	5-10	All Rooms	1-4
S	9" VFT Bg	1-5	All Rooms	(Rm S6 - 2 tiles) 2-4
S	PW Str	65-70	Rm S-5 Storeroom	2-4
H 700	Bir Ins	25-35	Home Ec Boiler Room	2-4
700	TOC	1-5	Music wing hall ceiling	7
700	TOC	1-5	Instrument storage room	1-4
700	9" VFT y1	5-10	Music Wing Hall	7
700	Tran Peg Board	15-20	Custodial & Band Room	(broken & missing) 2-4
700	Hold tank	Assumed	Home Ec Heater Room	2-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE December 19, 1994

SCHOOL Chico Senior High INSPECTOR Ron Jones



BLDG.	HOMOG.	ASBESTOS	MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
	MAT.#				
700	PW Str	75-80		Home Ec Storage Closet	1-4
700	PW Str	75-80		2nd Home Ec Storage Closet	1-4
700	PW Cnr	75-80		Home Ec Storage Closet	1-4
700	Door Fill	25-35		Home Ec Heater Room	1-4
700	PW Str	5-10		Home Ec Heater Room	1-4
700	Tran pipe	Assumed		Home Ec Heater Room	1-4
700	PW Aircel	Assumed		Under Choral Room Risers	2-4
700	PW Debris	Assumed		Under Choral Room Risers	1-4
1000	PW Str	35-40		Auto Shop, Loft, Woodshop	2-4 Wood shop 12" missing 2-4
1100	Wall plas	1-5		Ag Classroom 2 (space 3)	1-4
1100	Tran panl	15-20		Ag Shop Welding Booth	2-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE December 19, 1994

SCHOOL Chico Senior High INSPECTOR Ron Jones

HOMOG. ASBESTOS MATERIAL LOCATION CONDITION: CODE & COMMENTS

BLDG.	MAT.#	MATERIAL	LOCATION	CONDITION: CODE & COMMENTS	
1100		Tran pipe	Assumed	Ag Shop (two pipes)	1-4
900		PW Str	50-55	Girls/Boys Locker Room	7
900		PW Str	50-55	Girls/Boys Boil rm crawl sp	4-7-10
900		Tank Wrap	1-5	Gym Boiler Room	7
900		Mud Jnt	5-10	Gym Boiler Room	7
900		Boiler rm gasket	85-90	Gym Boiler Room	7
900		Wall & ceil plas	1-5	All rooms except Boiler Room	Retested - not asbestos
800		9" VFT Gy	1-5	Kitchen & MPR	2-4 70 tiles missing/broken
800		TOC	1-5	All Rooms	2-4
800		Tran panl	Assumed	Snack Bar	1-4
800		Tran panl	Assumed	Stage & Cafe	1-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE December 19, 1994

SCHOOL Chico Senior High INSPECTOR Ron Jones *RJ*

HOMOG. ASBESTOS MATERIAL LOCATION CONDITION: CODE & COMMENTS
 BLDG. MAT.#

800	Mud Jnts	5-10	Under stage	1-4
800	9" VFT		Under stage	1-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)

CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)

ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED

MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE July 7, 1994
 SCHOOL Chico Senior High INSPECTOR Ron Jones

HOMOG. ASBESTOS MATERIAL LOCATION CONDITION: CODE & COMMENTS

BLDG.	MAT.#	MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
A	Mud Jnt	5-10	Darkroom - Attic	1-4
A	Mesh wrap	15-20	Darkroom - Attic	1-4
A	Tran panl	Assumed	Red painted panels along walkways, janitor closets, rr, stairwells	1-4
B	12" VFT	1-5	All rooms	1-4
C	12" VFT	1-5	Room 10	2-4 (two broken tiles)
C	12" VFT	1-5	All rooms	1-4
400	Mud jnt	5-10	Library Attic	1-4
500	Tran panl	Assumed	2 - Kilns	1-4
500	Mud jnts	5-10	Fine Arts	1-4
500	Mud jnts	5-10	Room F-1	1-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE July 7, 1994

SCHOOL Chico Senior High INSPECTOR Ron Jones

HOMOG. ASBESTOS MATERIAL LOCATION CONDITION: CODE & COMMENTS

BLDG.	HOMOG.	ASBESTOS MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
S	Heat Shld paper	75-80	Rm S-3	7
S	Bl countr	Assumed	Science Rooms	1-4
S	Mud jnts	5-10	All Rooms	1-4
S	9" VFT Bg	1-5	All Rooms	(Rm S6 - 2 tiles) 2-4
S	PW Str	65-70	Rm S-5 Storeroom	2-4
H 700	Bir Ins	25-35	Home Ec Boiler Room	2-4
700	TOC	1-5	Music wing hall ceiling	7
700	TOC	1-5	Instrument storage room	1-4
700	9" VFT y1	5-10	Music Wing Hall	7
700	Tran Peg Board	15-20	Custodial & Band Room	(broken & missing) 2-4
700	Hold tank	Assumed	Home Ec Heater Room	2-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE July 7, 1994
 SCHOOL Chico Senior High INSPECTOR Ron Jones

BLDG.	HOMOG. MAT.#	ASBESTOS MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
700	PW Str	75-80	Home Ec Storage Closet	1-4
700	PW Str	75-80	2nd Home Ec Storage Closet	1-4
700	PW Cnr	75-80	Home Ec Storage Closet	1-4
700	Door Fill	25-35	Home Ec Heater Room	1-4
700	PW Str	5-10	Home Ec Heater Room	1-4
700	Tran pipe	Assumed	Home Ec Heater Room	1-4
700	PW Aircel	Assumed	Under Choral Room Risers	2-4
700	PW Debris	Assumed	Under Choral Room Risers	1-4
1000	PW Str	35-40	Auto Shop, Loft, Woodshop	2-4 Wood shop 12" missing 2-4
1100	Wall plas	1-5	Ag Classroom 2 (space 3)	1-4
1100	Tran panl	15-20	Ag Shop Welding Booth	2-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE July 7, 1994

SCHOOL Chico Senior High INSPECTOR Ron Jones

RJ

HOMOG. ASBESTOS MATERIAL LOCATION CONDITION: CODE & COMMENTS

BLDG.	HOMOG.	ASBESTOS MATERIAL	LOCATION	CONDITION: CODE & COMMENTS
1100	Tran pipe	Assumed	Ag Shop (two pipes)	1-4
900	PW Str	50-55	Girls/Boys Locker Room	7
900	PW Str	50-55	Girls/Boys Boil rm crawl sp	4-7-10
900	Tank Wrap	1-5	Gym Boiler Room	7
900	Mud Jnt	5-10	Gym Boiler Room	7
900	Boiler rm gasket	85-90	Gym Boiler Room	7
900	Wall & ceil plas	1-5	All rooms except Boiler Room	Retested - not asbestos
800	9" VFT Gy	1-5	Kitchen & MPR	2-4 70 tiles missing/broken
800	TOC	1-5	All Rooms	2-4
800	Tran panl	Assumed	Snack Bar	1-4
800	Tran panl	Assumed	Stage & Cafe	1-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)

SIX-MONTH SURVEILLANCE

DISTRICT Chico Unified School District DATE July 7, 1994
 SCHOOL Chico Senior High INSPECTOR Ron Jones

HOMOG. ASBESTOS MATERIAL LOCATION CONDITION: CODE & COMMENTS
 BLDG. MAT.#

800	Mud Jnts	5-10	Under stage	1-4
800	9" VFT		Under stage	1-4

CONDITION CODES

GENERAL CONDITION: (1) GOOD (2) DAMAGED (3) SIGNIFICANTLY DAMAGED (25% OR MORE)
 CHANGE IN CONDITION: (4) NO (5) YES (IF YES, EXPLAIN UNDER COMMENTS)
 ABATED: (6) REPAIRED (7) REMOVED (8) ENCAPSULATED (9) ENCLOSED (10) ISOLATED & RESTRICTED
 MISC: (11) INACCESSIBLE, NO SURVEILLANCE DATA (12) OTHER (EXPLAIN UNDER COMMENTS)